Dual Measurement Multimeter

GDM-8261

USER MANUAL

GW INSTEK PART NO. 82DM-82610EA1

ISO-9001 CERTIFIED MANUFACTURER

This manual contains proprietary information, which is protected by copyrights. All rights are reserved. No part of this manual may be photocopied, reproduced or translated to another language without prior written consent of Good Will company.

The information in this manual was correct at the time of printing. However, Good Will continues to improve products and reserves the right to change specifications, equipment, and maintenance procedures at any time without notice.

Good Will Instrument Co., Ltd.

No. 7-1, Jhongsing Rd., Tucheng Dist., New Taipei City 236, Taiwan (R.O.C.).

Table of Contents

SAFETY INSTRUCTIONS 6
Safety Symbols 6
Safety Guidelines 7

GETTING STARTED 10
GDM-8261 Characteristics 11
Front Panel Overview 12
Rear Panel Overview 17
Set Up 19

BASIC MEASUREMENT 22
Basic Measurement Overview 24
AC/DC Voltage Measurement 26
AC/DC Current Measurement 30
2W/4W Resistance Measurement 32
Diode Test 34
Continuity Test 35
Frequency/Period Measurement 38
Temperature Measurement 40

DUAL MEASUREMENT 46
Dual Measurement 46

ADVANCED MEASUREMENT 52
Advanced Measurement Overview 53
dBm/dB Measurement 55
Max/Min Measurement 57
Relative Value Measurement 58
Hold Measurement 60
Compare Measurement 61
Math Measurement 64

SYSTEM/DISPLAY CONFIGURATION 70
Refresh Rate Setting 71

View Serial Number 71
Trigger Setting 72
Digital Filter Setting 75
Display Setting 77
Measurement Configuration Settings 78
ADC Setting 83
Frequency / Period Settings 87

STORE/RECALL 90

Store Measurement Record 91
Recall Measurement Record 92
Save Instrument Settings 93
Recall Instrument Settings 94

SCANNER (OPTIONAL) 96

GDM-SC1 Scanner Specifications 97
Scanner Installation 97
Setup Scan 104
Run Scan 111

DIGITAL I/O 114

Digital I/O Terminal Configuration 115

REMOTE CONTROL 121

Configure Interface 122
Command Syntax 132
Command Set 133

FAQ 176

APPENDIX 177

Firmware Version 178
Fuse Replacement 179
Menu Tree 181
Specifications 183
EC Declaration of Conformity 192

INDEX 193

SAFETY INSTRUCTIONS

This chapter contains important safety instructions that you must follow when operating the GDM-8261 and when keeping it in storage. Read the following before any operation to insure your safety and to keep the GDM-8261 in the best possible condition.

Safety Symbols

These safety symbols may appear in this manual or on the GDM-8261.

WARNING	Warning: Identifies conditions or practices that could result in injury or loss of life.
CAUTION	Caution: Identifies conditions or practices that could result in damage to the GDM-8261 or to other property.
	DANGER High Voltage
	Attention Refer to the Manual
	Protective Conductor Terminal
	Earth (ground) Terminal
	Do not dispose electronic equipment as unsorted municipal waste. Please use a separate collection facility or contact the supplier from which this instrument was purchased.

Safety Guidelines

General Guideline

CAUTION

- Make sure that the voltage input level does not exceed DC1000V/AC750V.
- Make sure the current input level does not exceed 10A.
- Do not place any heavy object on the GDM-8261.
- Avoid severe impact or rough handling that can lead to damaging the GDM-8261.
- Do not discharge static electricity to the GDM-8261.
- Use only mating connectors, not bare wires, for the terminals.
- Do not block or obstruct the cooling fan vent opening.
- Do not perform measurement at the source of a low-voltage installation or at building installations (Note below).
- Do not disassemble the GDM-8261 unless you are qualified as service personnel.

(Note) EN 61010-1:2001 specifies the measurement categories and their requirements as follows. The GDM-8261 falls under category I or II.

- Measurement category IV is for measurement performed at the source of low-voltage installation.
- Measurement category III is for measurement performed in the building installation.
- Measurement category II is for measurement performed on the circuits directly connected to the low voltage installation.
- Measurement category I is for measurements performed on circuits not directly connected to Mains.

Power Supply

WARNING

- AC Input voltage: 100/120/220/240 V AC ±10%, 45Hz to 66Hz / 360Hz to 440Hz
- The power supply voltage should not fluctuate more than 10%.
- Connect the protective grounding conductor of the AC power cord to an earth ground, to avoid electrical shock.

Fuse WARNING	• Fuse type: 0.315AT 100/120VAC 0.125AT 220/240 VAC • Make sure the correct type of fuse is installed before power up. • To avoid risk of fire, replace the fuse only with the specified type and rating. • Disconnect the power cord before fuse replacement. • Make sure the cause of a fuse blowout is fixed before fuse replacement.
Cleaning the GDM-8261	• Disconnect the power cord before cleaning. • Use a soft cloth dampened in a solution of mild detergent and water. Do not spray any liquid into the GDM-8261. • Do not use chemicals or cleaners containing harsh material such as benzene, toluene, xylene, and acetone.
Operation Environment	• Location: Indoor, no direct sunlight, dust free, almost non-conductive pollution (Note below) • Temperature: Full accuracy for 0°C to 55°C. • Humidity: Full accuracy to 80% RH at 40°C (Note) EN 61010-1:2001 specifies the pollution degrees and their requirements as follows. The GDM-8261 falls under degree 2. Pollution refers to "addition of foreign matter, solid, liquid, or gaseous (ionized gases), that may produce a reduction of dielectric strength or surface resistivity". • Pollution degree 1: No pollution or only dry, non-conductive pollution occurs. The pollution has no influence. • Pollution degree 2: Normally only non-conductive pollution occurs. Occasionally, however, a temporary conductivity caused by condensation must be expected. • Pollution degree 3: Conductive pollution occurs, or dry, non-conductive pollution occurs which becomes conductive due to condensation which is expected. In such conditions, equipment is normally protected against exposure to direct sunlight, precipitation, and full wind pressure, but neither temperature nor humidity is controlled.
Storage Environment	• Location: Indoor • Temperature: −40°C to 70°C
Disposal	Do not dispose this instrument as unsorted municipal waste. Please use a separate collection facility or contact the supplier from which this instrument was purchased. Please make sure discarded electrical waste is properly recycled to reduce environmental impact.

Power cord for the United Kingdom

When using the GDM-8261 in the United Kingdom, make sure the power cord meets the following safety instructions.

NOTE: This lead / appliance must only be wired by competent persons

⚠ WARNING: THIS APPLIANCE MUST BE EARTHED

IMPORTANT: The wires in this lead are coloured in accordance with the following code:

Green/ Yellow: Earth

Blue: Neutral

Brown: Live (Phase)



As the colours of the wires in main leads may not correspond with the coloured marking identified in your plug/appliance, proceed as follows:

The wire which is coloured Green & Yellow must be connected to the Earth terminal marked with either the letter E, the earth symbol ⏚ or coloured Green/Green & Yellow.

The wire which is coloured Blue must be connected to the terminal which is marked with the letter N or coloured Blue or Black.

The wire which is coloured Brown must be connected to the terminal marked with the letter L or P or coloured Brown or Red.

If in doubt, consult the instructions provided with the equipment or contact the supplier.

This cable/appliance should be protected by a suitably rated and approved HBC mains fuse: refer to the rating information on the equipment and/or user instructions for details. As a guide, a cable of 0.75mm^2 should be protected by a 3A or 5A fuse. Larger conductors would normally require 13A types, depending on the connection method used.

Any exposed wiring from a cable, plug or connection that is engaged in a live socket is extremely hazardous. If a cable or plug is deemed hazardous, turn off the mains power and remove the cable, any fuses and fuse assemblies. All hazardous wiring must be immediately destroyed and replaced in accordance to the above standard.

GETTING STARTED

This chapter describes the GDM-8261 in a nutshell, including an Overview of its main features and front / rear panel introduction. After going through the Overview, follow the Power-up sequence to properly setup the GDM-8261.

Please note the information in this manual was correct at the time of printing. However as GW Instek continues to improve its products, changes can occur at any time without notice. Please see the GW Instek website for the latest information and content.

Characteristics	GDM-8261 Characteristics	11
Panel Overview	Front Panel Overview	12
	Measurement Keys (upper row)	13
	Measurement Keys (lower row)	15
	Rear Panel Overview	17
Setup	Tilt Stand	19
	Power Up	20

GDM-8261 Characteristics

The GDM-8261 is a portable, dual-display digital multimeter suitable for a wide range of applications, such as production testing, research, and field verification.

Performance	• High DCV accuracy: 0.0035% • High current range: 10A • High Voltage range: 1000V • High ACV frequency response: 300kHz
Features	• 6 ½ digits • Multi functions: ACV, DCV, ACI, DCI, 2W/4W R, Hz, Temp, Continuity, Diode test, MAX/MIN, REL, dBm, Hold, AutoHold, Compare, Statistics. • Manual or Auto ranging • AC true RMS
Interface	• Voltage/Resistance/Diode/Temperature input • Current input • 4W sense input • USB device/RS232/GPIB(optional)/LAN(optional) for remote control • 9-pin digital I/O • 16 channel scanner (optional)
Optional Items	• 16 channel scanner • GPIB port • Ethernet port

Front Panel Overview

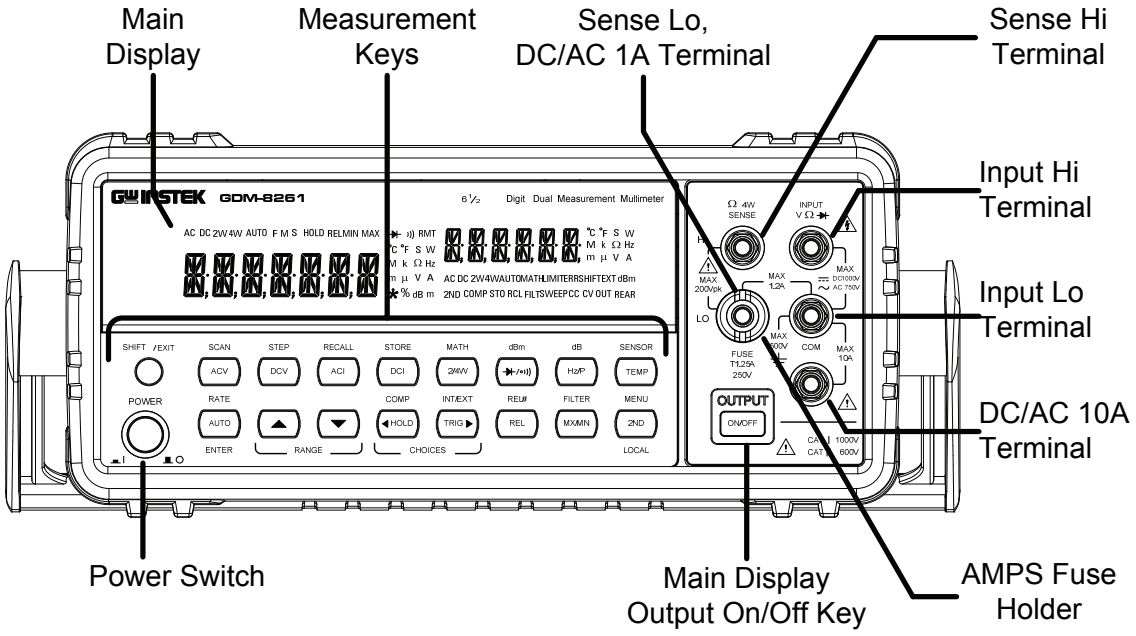

Power Switch	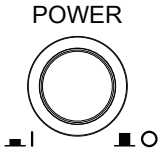	Turns On ▬ or Off ▙ the main power. For the power up sequence, see page 20.
Main Display		Shows measurement results and parameters. For display configuration details, see page 77 (light setting).
Sense Lo DC/AC 1A Terminal AMPS Fuse Holder	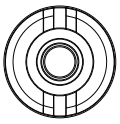	As a fuse, protects the instrument from over-current. Rating: T1.25A, 250V. For the fuse replacement procedure, see page 180. As a sense terminal, accepts 4W Ω measurement LO connection. For details, see page 32 Also accepts current input DC: 100μA~1A AC:1mA~1A For details see page 30.

Sense HI Terminal		Accepts HI sense line in 4W resistance measurement. For details, see page 32.
Input Lo Terminal	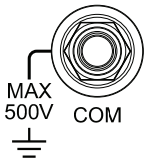	Accepts ground (COM) line in all measurements except the sense line in 4W Resistance (page 32).
Input Hi Terminal	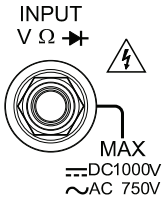	Used as an input port for all measurements except for DC/AC Current measurements.
DC/AC 10A Terminal	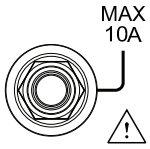	Accepts DC/AC Current input. For DCI or ACI details, see page 30.
Main Display Output On/Off key	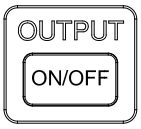	Turns the display on or off. When the display is turned off, all panel keys except the Output On/Off key become disabled. The Output On/Off key is On by default.

Measurement Keys (upper row)

SHIFT/EXIT		The Shift key is used to select the secondary functions assigned to each front panel key. When pressed, the **SHIFT** indicator appears in the display. As the Exit key, it gets out of the parameter configuration mode and goes back to the measurement result display mode.
ACV		Measures AC Voltage (page 26).
SHIFT → ACV (SCAN)		Starts the optional scan measurement (page 104).

DCV		Measures DC Voltage (page 26).
SHIFT → DCV (STEP)		Starts the step measurement (page 104) using the optional scanner.
ACI		Measures AC Current (page 30).
SHIFT → ACI (RECALL)		Recalls a normal measurement result, standard deviation measurement readings (page 92) or scan measurement results (page 112).
DCI		Measures DC Current (page 30).
SHIFT → DCI (STORE)		Stores a measurement result (page 91).
2/4W (Resistance)		Measures 2-wire or 4-wire Resistance (page 32).
SHIFT → 2/4W (MATH)	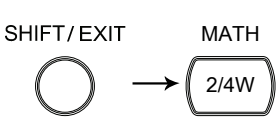	Enters the Math measurement mode (page 64).
⊣/•)) (Diode/ Continuity)		Tests Diode (page 34) or Continuity (page 35).
SHIFT → ⊣/•)) (dBm)	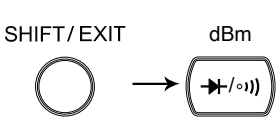	Measures dBm (page 55).
Hz/P (Frequency/ Period)		Measures Frequency or Period (page 38).
SHIFT + Hz/P (dB)	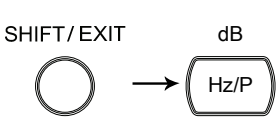	Measures dB (page 56).
TEMP (Temperature)		Measures Temperature (page 40).
SHIFT + TEMP (SENSOR)	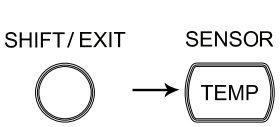	Selects the type of thermocouple used in the Temperature measurement (page 41).

Measurement Keys (lower row)

AUTO/ENTER		As the AUTO key, selects the measurement range automatically. As the Enter key, confirms the entered value.
SHIFT → AUTO (RATE)	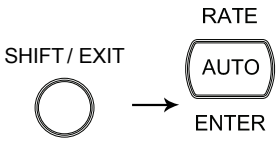	Selects the measurement update rate: Slow, Medium, or Fast (page 24).
Up/Down		Selects the parameter in various occasions: higher (▲) or lower (▼).
HOLD		Activates the Hold function (page 60).
SHIFT → HOLD (COMPare)		Activates the Compare measurement (page 61).
TRIG (Trigger)		Triggers sample acquisition manually (page 72).
SHIFT → TRIG (Int/Ext Trigger)		Selects the Internal or the External trigger source (page 72).
Left/Right		Selects parameters in various menus: left (◀) or right (▶).
REL		Measures the Relative value (page 58).
SHIFT → REL (RELative base)		Manually sets the reference value for the Relative value measurement (page 58).
MX/MN (MAX/ MIN)		Measures the Maximum or the Minimum value (page 57).
SHIFT → MX/MN (FILTER)		Selects the digital filter type for the signal sampling (page 75).

2nd (Display) / LOCAL		As the 2nd key, selects the measurement item on the 2nd display (page 46). Pressing and holding for more than 1 second turns off the 2nd display. As the Local key, releases the remote control and returns the instrument to local panel operation (page 122).
SHIFT → 2nd (Menu)	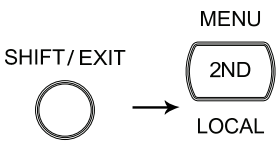	Enters the configuration mode for; System Settings, Measurement Settings, ADC Settings, Frequency/Period Settings, I/O Settings, TX TERM Settings and Scanner Settings.

Rear Panel Overview

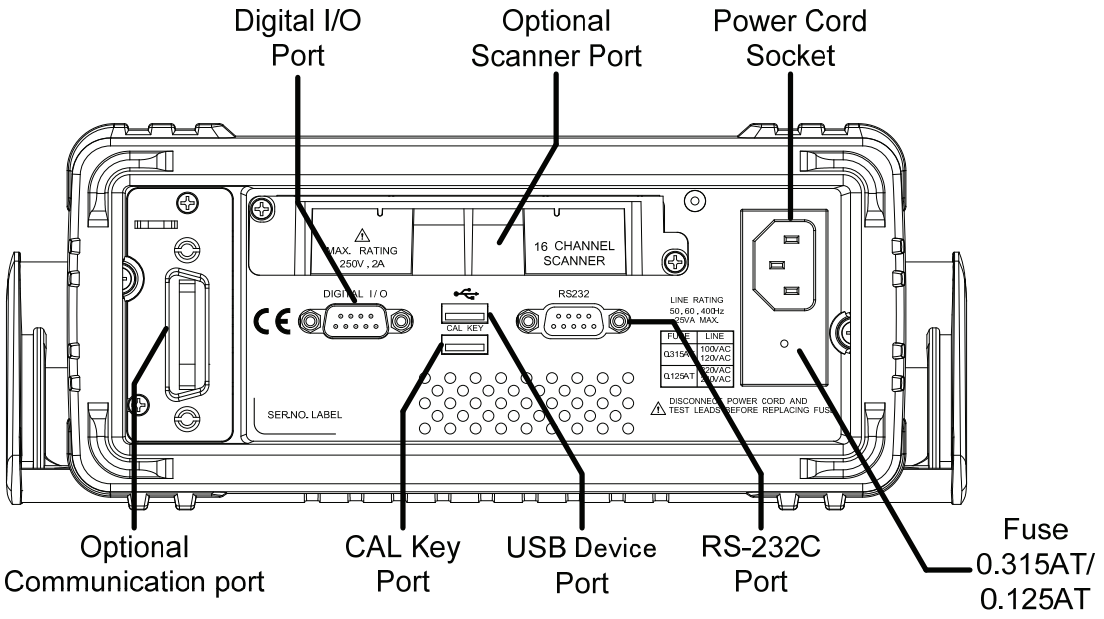

Power Cord Socket

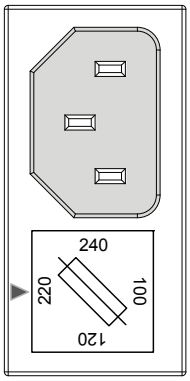

Accepts the power cord. AC 100/120/220/240V ±10%, 45Hz~66Hz, 360Hz~440Hz.

For power on sequence, see page 20.

Fuse Socket

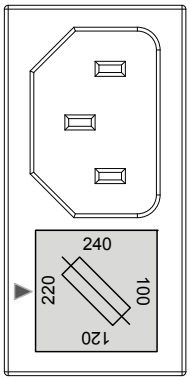

Holds the main fuse:

100/120 VAC: 0.315AT

220/240 VAC: 0.125AT

For fuse replacement details, see page 179.

RS-232C port



Accepts an RS-232C cable for remote control; DB-9 male connector.

For remote control details, see page 127.

USB device port		Accepts a USB device cable for remote control; Type A, female connector. For remote control details, see page 122.
CAL key port		Reserved for internal purposes such as firmware updates and calibration.
Digital I/O port		Accepts a digital I/O cable for the Hi/Lo limit tests; DB-9 pin, female connector. For digital I/O details, see page 115.
Optional slot x1	Accepts the optional 16 channel scanner module. For scanner details, see page 96. 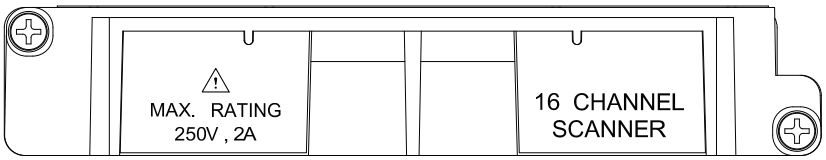	
Optional Communication port	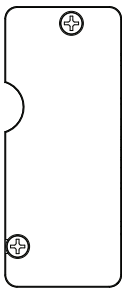	Accepts an optional GPIB or Ethernet card.

Set Up

Tilt Stand

Tilt stand steps

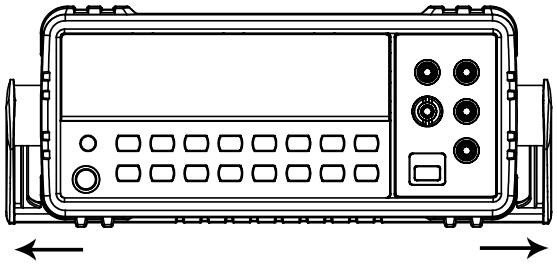

Pull out the handle sideways and rotate it.

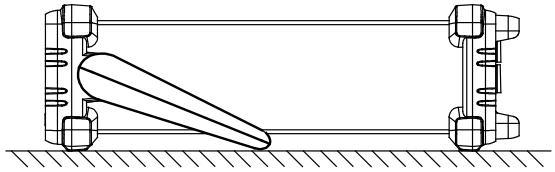

Place the unit horizontally,

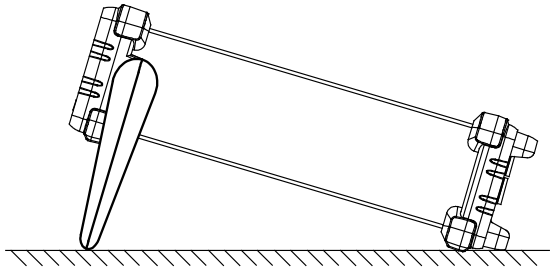

Or in the tilt stand position.

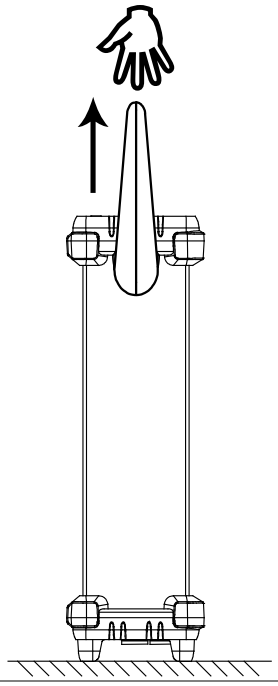

Place the handle vertically for hand carry.

Power Up

Steps

1. Ensure the correct line voltage is lined up with the arrow on the fuse holder. If not, see page 179 to set the line voltage and fuse.

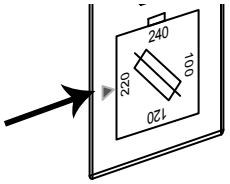

2. Connect the power cord to the AC Voltage input.

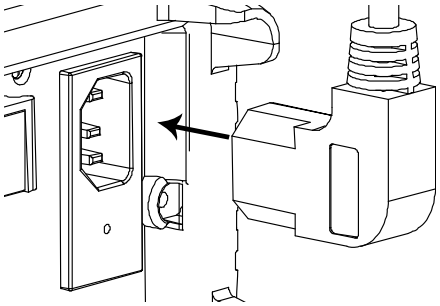

Note

Make sure the ground connector on the power cord is connected to a safety ground. This will affect the measurement accuracy.

3. Push to turn on the main power switch on the front panel.

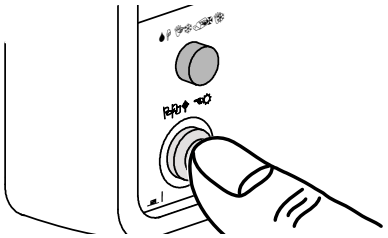

4. The display shows the model name and the version for a few seconds.
Example: GDM-8261, V1.00

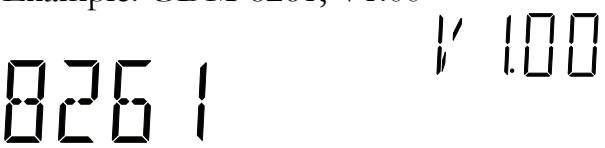

5. Followed by the default measurement settings.

6. And the interface I/O settings.

7. Then the default setting appears.
   Example: DCV, Auto, 100mV range

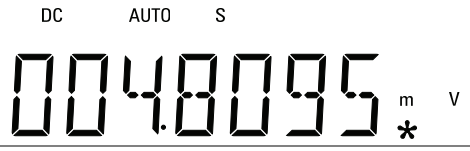

BASIC MEASUREMENT



Overview	Basic Measurement Overview	24
	Refresh Rate	24
	Reading Indicator	25
	Manual/Automatic Triggering	26
Voltage	AC/DC Voltage Measurement	26
	Select Voltage Range	27
	Voltage Conversion Table	28
	Crest Factor Table	29
Current	AC/DC Current Measurement	30
	Select Current Range	31
Resistance	2W/4W Resistance Measurement	32
	Select Resistance Range	33
Diode	Diode Test	34
Continuity	Continuity Test	35
	Set Continuity Threshold	36
	Select Beeper Setting	37
Frequency/ Period	Frequency/Period Measurement	38
	Select Frequency/Period Voltage Range	39

continued next page

Temperature	Temperature Measurement	40
	Select Thermocouple Type	41
	Set Reference Junction Temperature (T-CUP)	42
	Select Temperature Sensor Type	43
	Set User RTD	44

Basic Measurement Overview

Background

Basic measurement refers to the eight types of measurements assigned to the upper row keys on the front panel.



Measurement type

ACV	AC Voltage
DCV	DC Voltage
ACI	AC Current
DCI	DC Current
2/4W	2-wire and 4-wire Resistance
→+ •)))	Diode/Continuity
Hz/P	Frequency/Period
TEMP	Celsius/Fahrenheit Temperature

Advanced measurement

Advanced measurement (page 52) mainly refers to the operation using the result obtained from one or more of the basic measurements.

Refresh Rate

Background

Refresh rate defines how frequently the GDM-8261 captures and updates measurement data. A faster refresh rate yields a lower accuracy and resolution. A slower refresh rate yields a higher accuracy and resolution. Consider these tradeoffs when selecting the refresh rate.

For DC measurements, the frequency of the refresh rate depends on the rate settings (S, M, F) and the ADC speed settings (Accurate, Quick) (page 86).

For AC measurements, the refresh rate (S, M, F) is directly tied to the AC bandwidth settings (page 80).

For further details, please see the specifications.

Refresh Rate (Readings/s)	Function	S	M	F
	Continuity / Diode	100	200	300
	DCV/DCI/100Ω~ 100MΩ (Accurate)	5	60	240
	DCV/DCI/100Ω~ 100MΩ (Quick)	30	600	2400
	ACV/ACI	1.2 (sec/reading)	3.38	30
	Frequency / Period	1	10	100

Selection steps

1. Press the Shift key followed by the AUTO (RATE) key. The refresh rate switches to the next.



2. The refresh rate indicator shows the current status. S→M→F→S

Reading Indicator

Background

The reading indicator * next to the 1st display flashes according to the refresh rate setting.

When no data is captured

When there is no captured data, the reading indicator flashes once every two seconds (slower than the normal refresh rate), indicating the DMM is in standby mode.

Manual/Automatic Triggering

Automatic triggering (default)	The GDM-8261 triggers according to the refresh rate. See the previous page for refresh rate setting details.
Manual triggering	Press the Trig key to trigger measurement manually. The trigger must be set to external (EXT) for manual triggering. See page 72.

AC/DC Voltage Measurement

Voltage type	AC	0 ~ 750V
	DC	0 ~ 1000V
1. Activate ACV/ DCV	Press the ACV (AC Voltage) key or DCV (DC Voltage) key. 	
2. ACV/DCV mode display appears		
	AC or DC + V	Indicates AC, DC voltage
	AUTO	Indicates Automatic range selection
	100mV	2nd display shows the Voltage range
3. Connect the test lead and measure	Connect the test lead between the V and the COM port. The display updates the reading. 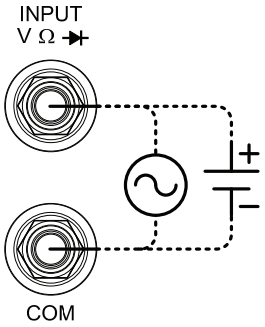	

Select Voltage Range

Auto range	To turn the automatic range selection On/Off, press the AUTO key.
Manual range	Press the Up or the Down key to select the range. The AUTO indicator turns Off automatically. If the appropriate range is unknown, select the highest range.

Selection list

Range	Resolution	Full scale @ slow rate
100mV	0.1μV	119.9999mV
1V	1μV	1.199999V
10V	10μV	11.99999V
100V	100μV	119.9999V
750V (AC)	1mV	750.000V
1000V (DC)	1mV	1000.000V

Note: For more detailed parameters, see the specifications on page183.

Voltage Conversion Table

This table shows the relationship between AC and DC reading in various waveforms.

Waveform	Peak to Peak	AC (True RMS)	DC
Sine 	2.828	1.000	0.000
Rectified Sine (full wave) 	1.414	0.435	0.900
Rectified Sine (half wave)	2.000	0.771	0.636
Square 	2.000	1.000	0.000
Rectified Square	1.414	0.707	0.707
Rectangular Pulse 	2.000	2K $K=\sqrt{(D-D^{2})}$ D=X/Y	2D D=X/Y
Triangle Sawtooth 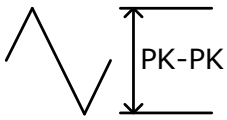	3.464	1.000	0.000

Crest Factor Table

Background

Crest factor is the ratio of the peak signal amplitude to the RMS value of the signal. It determines the accuracy of AC measurement.

If the crest factor is less than 3.0, voltage measurement will not result in error due to dynamic range limitations at full scale.

If the crest factor is more than 3.0, it usually indicates an abnormal waveform as seen from the below table.

Waveform	Shape	Crest factor
Square wave		1.0
Sine wave		1.414
Triangle sawtooth		1.732
Mixed frequencies		1.414 ~ 2.0
SCR output 100% ~ 10%		1.414 ~ 3.0
White noise		3.0 ~ 4.0
AC Coupled pulse train		3.0
Spike	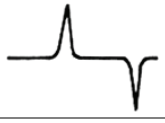	>9.0

AC/DC Current Measurement

Background	The GDM-8261 has two input ports for current measurement. A LO port for current less than 1.2A and a 10A port for measurements up to 10A. The GDM-8261 also features a "Current Input Port Auto-Detect" feature (default, off). For details, see page 82.	
Current type	AC	0 ~ 10A
	DC	0 ~ 10A
1. Activate ACI/ DCI	Press the ACI (AC Current) key or the DCI (DC Current) key.	ACI or DCI
2. ACI/DCI mode display appears		
	AC or DC + A	Indicates AC or DC Current (Note: AC = true RMS)
	AUTO	Indicates Automatic range selection
	10A	2nd display shows the Current range
3. Connect the test lead and measure	Connect the test lead between the 10A and COM port or LO and COM port, depending on the current. For current ≤ 1.2A use the LO port; For current up to 10A use the 10A port. The display updates the reading.	

0~1.2A

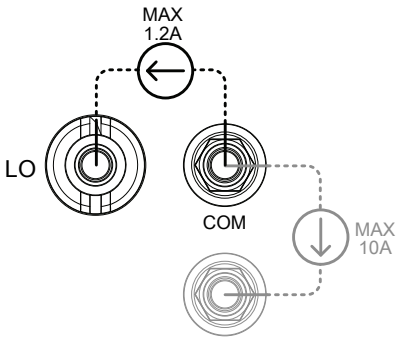

0~10A

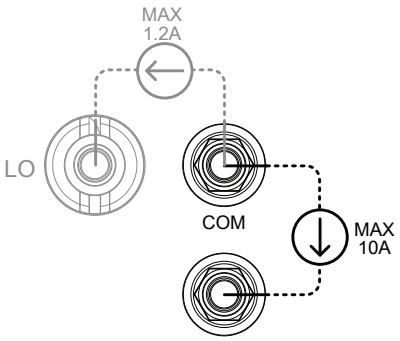

Select Current Range

Auto range	To turn the automatic range selection On/Off, press the AUTO key.	AUTO
Manual range	Press the Up or the Down key to select the range. AUTO indicator turns Off automatically. If the appropriate range is unknown, select the highest range.	▲ ▼

Selection list

Range	Resolution	Full scale @ slow rate
100μA(DC only)	0.1nA	119.9999μA
1mA	1nA	1.199999mA
10mA	10nA	11.99999mA
100mA	0.1μA	119.9999mA
1A	1μA	1.199999A
10A	10μA	10.00000A

2W/4W Resistance Measurement

Measurement type	2-wire	Uses the standard V-COM ports. Recommended for measuring resistances larger than 1kΩ.
	4-wire	Compensates the test lead effect using the 4W compensation ports, in addition to the standard V-COM ports. Recommended for measuring sensitive resistances smaller than 1kΩ.
1. Activate resistance measurement	For 2-wire resistance measurement, press the 2W/4W key once.	
	For 4-wire resistance measurement, press the 2W/4W key twice.	
2. 2W/4W resistance mode display appears		
	2W or 4W + Ω	Indicates 2W or 4W Resistance mode
	AUTO	Indicates Automatic range selection
	1K	2nd display shows the Resistance range
3. Connect the test lead and measure	Connect the test lead. For 2-wire resistance, use the Ω (V) and the COM port. For 4-wire resistance, use the Ω (V) and the COM port, plus the 4W sense, and LO port for sensing. The display updates the reading.	

2W connection

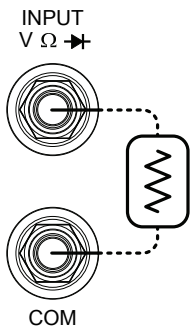

4W connection

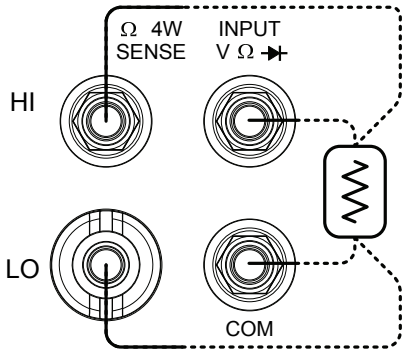

Select Resistance Range

Auto range

To turn the automatic range selection On/Off, press the AUTO key.

Manual range

Press the Up or the Down key to select the range. AUTO indicator turns Off automatically. If the range is unknown, select the highest range.

Selection list

Range	Resolution	Full scale @ slow rate
100Ω	0.1μΩ	119.9999Ω
1kΩ	1μΩ	1.199999kΩ
10kΩ	10μΩ	11.99999kΩ
100kΩ	100μΩ	119.9999kΩ
1MΩ	1Ω	1.199999MΩ
10MΩ	10Ω	11.99999MΩ
100MΩ	100Ω	119.9999MΩ

Note

For more detailed range, see the specifications at page 183.

Diode Test

Background	Diode test checks the forward bias characteristics of a diode by running a constant forward bias current, approx. 1mA, through the DUT.
1. Activate diode test	Press the ⊣/•)) key once.
2. Diode mode display appears	
⊣ + V	Indicates Diode test
DIODE	2nd display shows the title
3. Connect the test lead and measure	Connect the test lead between the ⊣ and COM port; Anode-V, Cathode-COM. The display updates the reading. 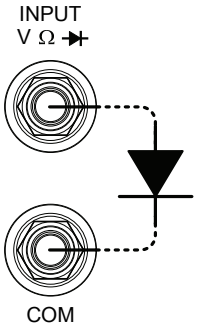

Continuity Test

Background	Continuity test checks that the resistance in the DUT is low enough to be considered continuous (of conductive nature).
1. Activate continuity test	Press the →⊣/•)) key twice. 
2. Continuity mode display appears	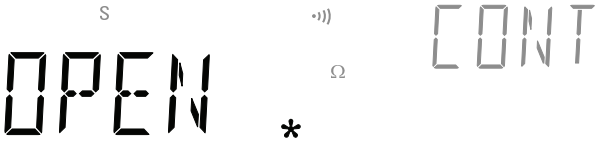
	•)) + Ω Indicates Continuity test
	CONT 2nd display shows the title
3. Connect the test lead and measure	Connect the test lead between the Ω and the COM port. The display updates the reading. 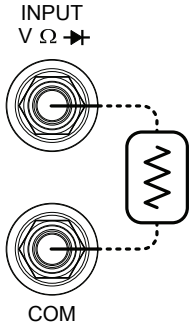

Set Continuity Threshold

Background	Continuity threshold defines the maximum resistance allowed in the DUT when testing the continuity.
Threshold Range	0 ~ 1000Ω, 1Ω resolution, 10Ω default

1. Activate threshold setting

1. Press the Shift key, the 2nd key, the Right key. The measurement menu appears.

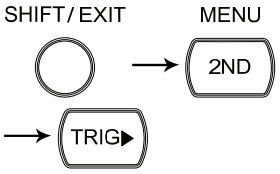

2. Press the Down key, the Right key, the Enter key. The continuity threshold setting appears.

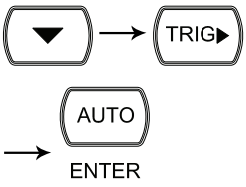

2. Edit threshold

1. Move the cursor (the flashing digit) using the Left/Right key.



2. Change the value using the Up/Down key.

Range: 1 ~ 1000Ω, 1Ω resolution, default 10Ω

3. Go back to the default display

Press the Enter key to confirm the edited threshold. Press the Exit key to go back to the default display.



Select Beeper Setting

Background	Beeper setting defines how the GDM-8261 notifies the continuity test result to the user. When the Beeper setting is off it will also turn the keypad sound off.	
Beeper parameter	Pass	Beeps when the test result is pass
	Fail	Beeps when the test result is fail
	Off	Beep function is turned Off

1. Activate beeper setting menu

1. Press the Shift key followed by the 2nd (Menu) key. The system menu appears.



2. Press the Down key. The beep menu appears.

3. Press the Down key. The beep setting appears.

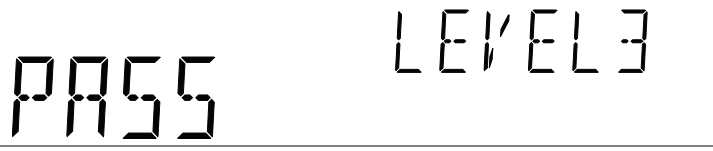

2. Select the beep setting

To change the setting, press the Up/Down key.

Beeper type: Pass (beep when pass), Fail (beep when fail, default), Off (beep off)

3. Go back to the default display

Press the Enter key to confirm. Press the Exit key to go back to the default display.



Frequency/Period Measurement

1. Activate frequency/period measurement	To measure Frequency, press the Hz/P key once.	
	To measure the Period, press the Hz/P key twice.	
2. Frequency (Period) mode display appears		
	Hz (S)	Indicates Frequency (period) measurement
	AUTO	Indicates Automatic range selection
	FREQ (PERIOD)	2nd display shows the measurement mode
3. Connect the test lead and measure	Connect the test lead between the V and the COM port. The display updates the reading.	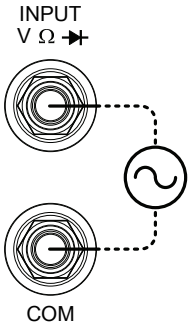

Select Frequency/Period Voltage Range

Frequency/Period mode	To select between period/frequency voltage range, press the 2nd key twice.	2ND 2ND
Auto range	To turn the automatic range selection On/Off, press the AUTO key.	AUTO
Manual range	Press the Up or the Down key to select the range. AUTO indicator turns Off automatically. If the appropriate range is unknown, select the highest range.	▲ ▼

Range		
	Frequency	3Hz~300kHz
	Period	3.3μs ~333.3ms
	Voltage Range	100mV~750V

Temperature Measurement

Background

The GDM-8261 can measure temperature using either thermocouples or RTD sensors. For thermocouples, the GDM-8261 accepts a thermocouple input and calculates the temperature from the voltage fluctuation. The thermocouple type and reference junction temperature are also considered.

For RTD sensors, the GDM-8261 calculates voltage based on the resistance of the chosen RTD.

1. Activate temperature measurement

For Celsius units, press the TEMP key once.

For Fahrenheit units, press the TEMP key twice.

2. Temperature mode display appears

°C	Indicates Temperature measurement
TYPE J	2nd display shows the thermocouple/RTD type

3. Connect the test lead and measure

Connect the sensor lead between the V and the COM port for thermocouple and 2W RTD measurements. For 4W RTD measurements, also connect the sense HI and LO ports to the sensor. The display updates the reading.

Thermocouple 2W RTD 4W RTD

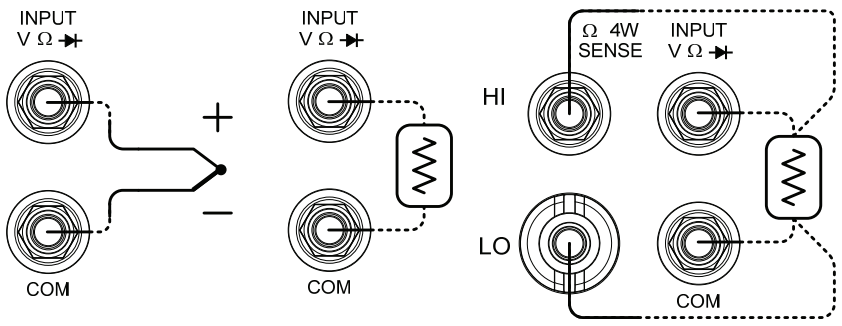

Range	RTD: -200°C ~ +600°C (sensor dependent) Thermocouple: -210°C ~ +1820°C (sensor dependent)

Select Thermocouple Type

Background	The GDM-8261accepts thermocouple inputs and calculates the temperature from the voltage difference of two dissimilar metals. Thermocouple type and reference junction temperature are also considered.

Parameter

Thermocouple	Range	Resolution
E	-200 to +1000°C	0.002 °C
J	-210 to +1200°C	0.002 °C
T	-200 to +400°C	0.002 °C
K	-200 to +1372°C	0.002 °C
N	-200 to +1300°C	0.003 °C
R	-50 to +1768°C	0.01 °C
S	-50 to +1768°C	0.01 °C
B	+350 to +1820°C	0.01 °C

1. Open sensor selection menu

Press the Shift key, then the TEMP (Sensor) key. The sensor selection menu appears on the display.



2. Select sensor type

Press the Left and Right arrow keys and select T-CUP (thermocouple).



3. Select sensor

Press the Down key twice. The sensor selection menu appears on the display.



4. Select sensor type	Press the Up/Down key. The thermocouple type switches to the next one.	
5. Confirm and go back to the default display	Press the Enter key to confirm. Press the Exit key to go back to the default display.	

Set Reference Junction Temperature (T-CUP)

Background

When a thermocouple is connected to the GDM-8261, the temperature difference between the thermocouple lead and the GDM-8261 input terminal should be taken into account and be cancelled; otherwise an erroneous temperature might be added.

Type	Range	Resolution
SIM (simulated)	0 ~ +50°C	0.01°C

The terminal temperature is manually defined by the user. Default value: 23.00

1. Open reference junction menu

Press the Shift key, then the TEMP (Sensor) key. The sensor selection menu appears on the display.



Press the Left and Right arrow keys and select T-CUP (thermocouple).



Press Down, Right arrow key and then Down again. The reference junction selection menu appears on the display.

2. Edit reference temperature	Use the Left/Right key to move the cursor, and use the Up/Down key to change the value. Default: 23.00	HOLD TRIG ▲ ▼
	Press the Enter key to confirm the value, or the Exit key to cancel. The display goes back to the previous menu.	AUTO ENTER (confirm) SHIFT/ EXIT (cancel)

Select Temperature Sensor Type

Background	The GDM-8261 supports a number of thermocouple types as well as 2 or 4 wire RTD. It is important to specify the type of temperature sensor used.		
Parameter	RTD type	Range	Resolution
	All (based on PT100)	-200~600°C	0.001°C

1. Open sensor selection menu	Press the Shift key, then the TEMP (Sensor) key. The sensor selection menu appears on the display.	SHIFT/ EXIT → SENSOR TEMP

2. Select sensor type	Press the Left and Right arrow keys to highlight the 2WRTD or 4WRTD sensor type. Press the down key to go to the next menu level.	HOLD TRIG → ▼

3. Select sensor

Press the Up and Down keys to highlight the RTD sensor type.

RTD Type: PT 100, PT 3916, PT 385, F 100, D 100, USER

4. Confirm and go back to the default display

Press the Enter key to confirm. Press the Exit key to go back to the default display.



Set User RTD

Background

The USER setting allows any custom RTD sensor coefficients to be used. The USER setting can configure the alpha, beta and delta coefficients, as defined by the Callendar–Van Dusen equation.

Coefficient range	
Alpha	0.000000~10.00000
Beta	0.000000~10.00000
Delta	0.000000~10.00000

1. Open sensor selection menu

Press the Shift key, then the TEMP (Sensor) key. The sensor selection menu appears on the display.



2. Select sensor type

Press the Left and Right arrow keys and select 2WRTD or 4WRTD



Press the Down key twice. The RTD selection menu appears on the display.

Use the Up/Down keys to select USER.

3. Open USER type menu

Press Enter. The alpha coefficient menu appears on the display.

AUTO
ENTER

4. Edit coefficient values

Use the Left/Right key to move the cursor, and use the Up/Down key to change the coefficient value.

Default: 0.00385

HOLD TRIG

Press the Enter key to confirm the value and move onto to the next coefficient.

Default: Alpha 0.00385, Beta 00.10863, Delta 1.49990

AUTO
ENTER (confirm)

Press the Exit key to cancel at any time. The display goes back to the previous menu.

SHIFT/ EXIT (cancel)

DUAL MEASUREMENT

Dual Measurement

Background

The dual measurement mode allows you to use the 2nd display to show another item, thus viewing two different measurement results at once.

When the multimeter is used in dual measurement mode, both displays are updated from either a single measurement or from two separate measurements.

If the primary and secondary measurement modes have the same range, rate and rely on the same fundamental measurement, then a single measurement is taken for both displays; such as ACV and frequency/period measurements.

If the primary and secondary displays use different measurement functions, ranges or rates, then separate measurements will be taken for each display. For example, ACV and 2W/4W resistance measurements.

Example Dual Measurement Applications

Combination		Applications
DCV	ACV	• Measure DC signals that have AC components*. For example: Measure the DC offset and AC noise from an amplifier output. Measure the DC output voltage and ripple from a DC power supply. * Ripple or the AC noise frequency must be within the DMM's measurable AC bandwidth for the noise to be measured.

Amplifier Output

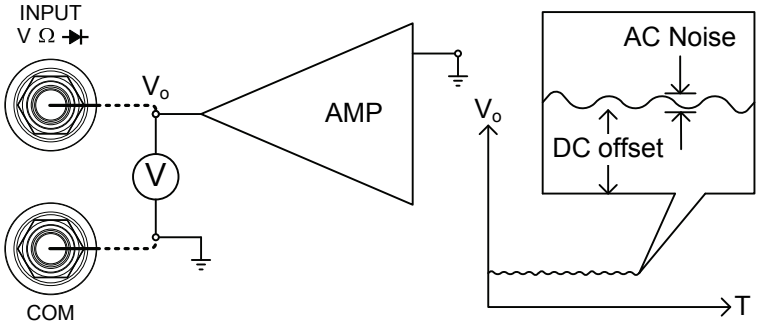

DC Power Supply Output

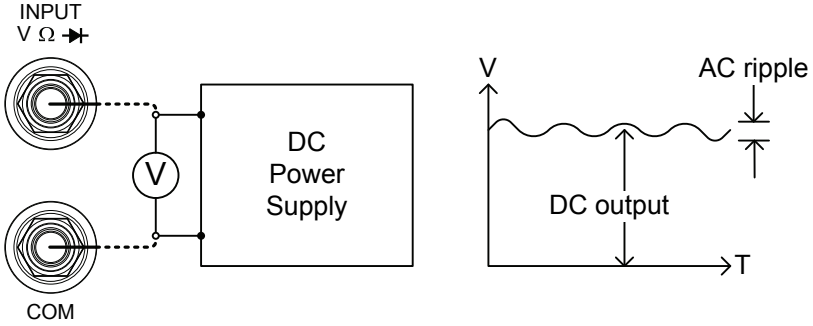

DCV DCI

- Monitor the voltage and current present on a component in a circuit or the output voltage and current of a DC power supply.

Monitor Voltage and Current

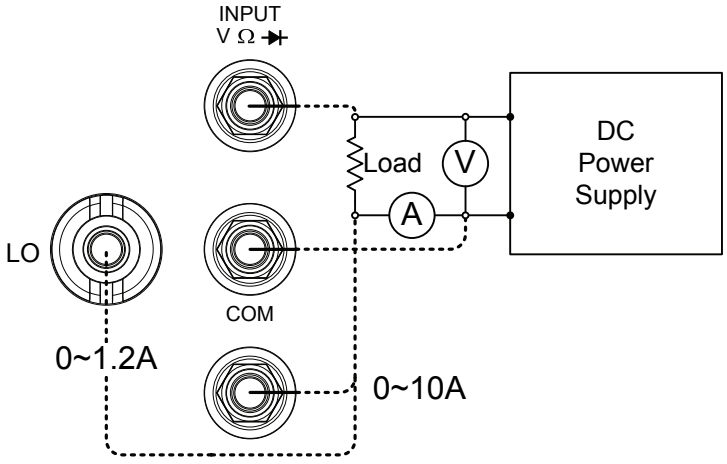

ACV Hz

- Measure the frequency response of devices such as amplifiers or buffers*.

  * The frequencies of the amplifier output must be within the DMM's measurable AC bandwidth for the amplitude at a spot frequency to be measured accurately.

Frequency Response

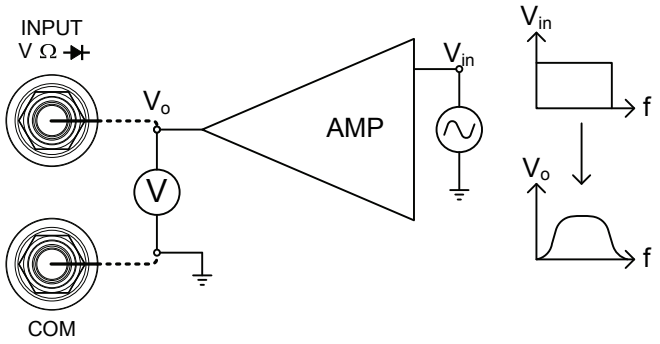

The following table shows the available measurement combinations.

1st Display	2nd Display					
	ACV	DCV	ACI	DCI	Hz/P	2W/4W*
ACV	●	●	●	●	●	—
DCV	●	●	●	●	●	—
ACI	●	●	●	●	●	—
DCI	●	●	●	●	●	—
2W/4W*	●	●	●	●	●	●
Hz/P	●	●	●	●	●	—

Note

- 2w/4W measurements in combination with other measurements are possible but may not be practical as the measurement accuracy is not guaranteed.
- When two separate measurements are taken, there is a switching delay between the first measurement and the second measurement.

1st Measurement item setting

Choose a basic measurement from the above table. Example: press the ACI key.

Page 22

Example: ACI

2nd Measurement item setting	Press the 2nd key, then the target item (example: ACV). The display updates the measurement result. (example: ACI + ACV)	2ND → ACV

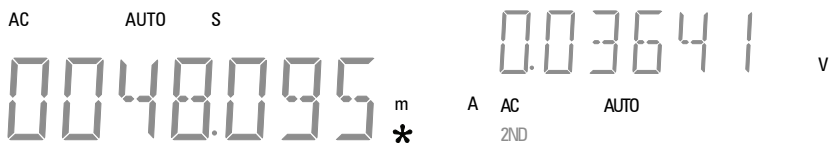

1st Display	Shows the primary measurement result
2nd Display	Shows the secondary measurement result
2ND	Indicates that dual measurement is active

Editing 1st or 2nd measurement item settings	After the secondary measurement function has been activated, the rate, range and measurement item can be edited for either the primary or secondary display. Note however, it is more practical to configure the first or second measurement items before activating dual measurement mode.	
1. Select active display	Toggle whether the primary or secondary display is the active display by pressing the 2ND key: Primary display: 2ND *is not visible* on the display Secondary display: 2ND *is* visible on the display *Do not hold the 2ND key. This will turn the dual measurement off.*	2ND (toggle active display)
2. Edit active display settings	Edit the range, rate or measurement item for the active display in the same way as for single measurement operation. See the Basic Measurement chapter for details.	Page 22
Turn Off 2nd Measurement	To turn Off the 2nd measurement, press and hold the 2nd key for more than 1 second.	2ND (hold 1 sec.)

Connect the test leads and measure

When using the dual measurement function, the connection method and number of test leads required depends on the measurement combination. Use the connect diagrams below as guide when taking dual measurements.

Voltage and Frequency/Period Measurement

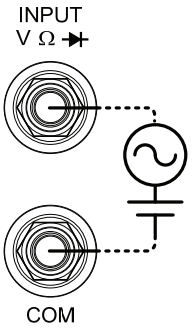

2W/4W Resistance Measurement

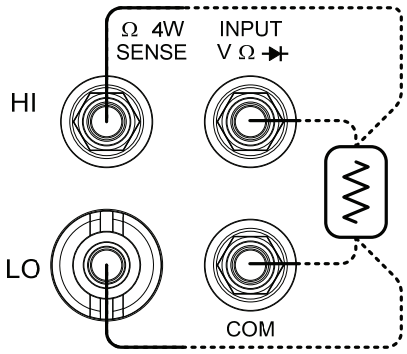

Voltage/Frequency/Period/Resistance and Current Measurement

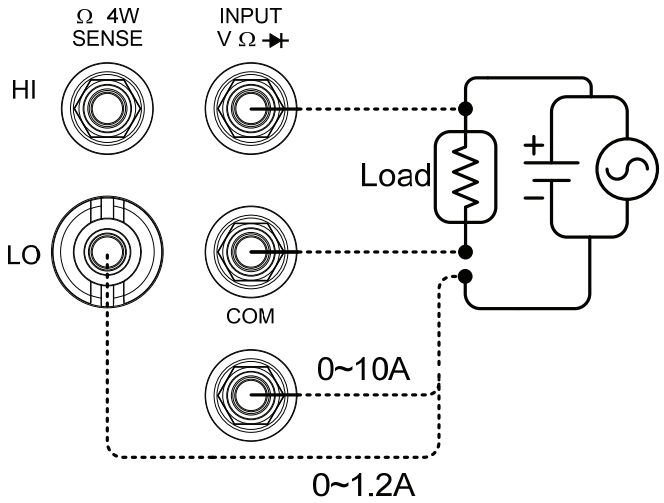

Note: Current measurements will be displayed as a negative value as the polarity of the current leads has been reversed.

Please take into account the resistance of the test leads and internal resistance of the current connection as it is in series with the test circuit.

The above measuring configuration is used to measure the voltage present on the resistance under test and the current through the resistance under test when using the DCI/DCV or ACI/ACV dual measurement function.

ADVANCED MEASUREMENT



Overview	Advanced Measurement Overview	53
	Refresh Rate	53
	Reading Indicator	54
	Common Attribute: Manual/Automatic Triggering	54
dBm/dB	dBm/dB Measurement	55
	Measure dBm	55
	Measure dB	56
Max/Min	Max/Min Measurement	57
Relative	Relative Value Measurement	58
Hold	Hold Measurement	60
Compare	Compare Measurement	61
Math	Measure MX+B	64
	Measure 1/X	66
	Measure Percentage	66
	Statistics Calculations	67

Advanced Measurement Overview

Background

Advanced measurement mainly refers to the type of measurement which uses the result obtained by one of the basic measurements: ACV, DCV, ACI, DCI, 2/4W, Diode/Continuity, Frequency/Period, and Temperature.



Advanced Measurement	Basic Measurement					
	AC/DCV	AC/DCI	2/4W	Hz/P	TEMP	→|/•))
dB	●	—	—	—	—	—
dBm	●	—	—	—	—	—
Max/Min	●	●	●	●	●	—
Relative	●	●	●	●	●	—
Hold	●	●	●	●	●	—
Compare	●	●	●	●	●	—
Math	●	●	●	●	●	—

Refresh Rate

Background

Refresh rate defines how frequently the GDM-8261 captures and updates measurement data. A faster refresh rate yields a lower accuracy and resolution. A slower refresh rate yields a higher accuracy and resolution. Consider these tradeoffs when selecting the refresh rate.

For DC measurements, the frequency of the refresh rate depends on the rate settings (S, M, F) and the ADC speed settings (Accurate, Quick) (page 86).

For AC measurements, the refresh rate (S, M, F) is directly tied to the AC bandwidth settings (page 80).

For further details, please see the specifications.

Refresh Rate (Readings/s)	Function	S	M	F
	Continuity / Diode	100	200	300
	DCV/DCI/100Ω~ 100MΩ (Accurate)	5	60	240
	DCV/DCI/100Ω~ 100MΩ (Quick)	30	600	2400
	ACV/ACI	1.2 (sec/reading)	3.38	30
	Frequency/Period	1	10	100

Selection steps

1. Press the Shift key followed by the AUTO (RATE) key. The refresh rate switches to the next.



2. The refresh rate indicator shows the current status. S→M→F→S

Reading Indicator

Background

The reading indicator * next to the 1st display flashes according to the refresh rate when the captured data is updated on the display.

When no data is captured

When there is no captured data, the reading indicator flashes once every two seconds (slower than the normal refresh rate), indicating the DMM is in the waiting mode.

Common Attribute: Manual/Automatic Triggering

Automatic triggering (default)

The GDM-8261triggers according to the refresh rate. See the previous page for refresh rate setting details.

Manual triggering	Press the Trig key to trigger the measurement manually. The trigger must be set to external (EXT) for manual triggering. See page 72.

dBm/dB Measurement

Applicable to		
Background	Using the ACV or DCV measurement result, the GDM-8261 calculates the dB or dBm value based on a reference resistance value in the following way.	
	dBm	10 x $\log_{10}$ (1000 x Vreading^2 / Rref)
	dB	dBm – dBmref
Parameters	Vreading	Input Voltage, ACV or DCV
	Vref	Reference voltage obtained by Rref/1mW
	Rref	Reference resistance simulating an output load
	dBmref	Reference dBm value

Measure dBm

Activate dBm	Press the Shift key followed by the ⊣/•)) key. The 1st display shows dBm, and the 2nd display shows the reference resistance. 	
dBm result appears		
	dBm	Indicates dBm measurement
	600Ω	2nd display indicates the reference resistance

Select reference resistance

To change the reference resistance, press the Up/Down key. The new resistance appears in the 2nd display. The following is the resistance list.

2	4	8	16	50	75	93
110	124	125	135	150	250	300
500	600	800	900	1000	1200	8000

Deactivate dBm measurement

To cancel the dBm measurement, press the Shift key followed by the ⊣/•)) key, or simply activate another measurement.



Measure dB

Background

dB is defined as [dBm−dBmref]. When the dB measurement is activated, the GDM-8261 calculates the dBm using the reading at the first moment and stores it as dBmref.

Activate dB

Press the Shift key followed by the Hz/P key. The 1st display shows dB, and the 2nd display shows the current Voltage reading.



dB result appears

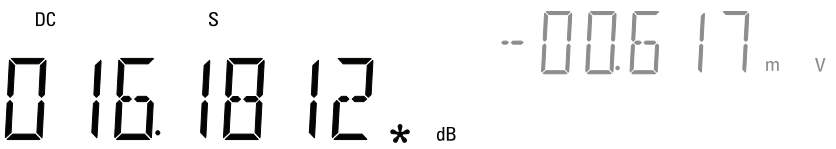

dB	Indicates dB measurement
-00.617mV	Indicates the present Voltage reading

dBmref

Press the 2nd key to see the dBm ref value.

Deactivate dB measurement

To cancel the dB measurement, press the Shift key followed by the Hz/P key, or simply activate another measurement.



Max/Min Measurement

Applicable to	ACV DCV ACI DCI 2/4W Hz/P TEMP	
Background	Maximum and Minimum measurement stores the highest (maximum) or lowest (minimum) reading and shows it on the 1st display when the 2nd key is pressed.	
1. Activate Max/Min	For Max measurement, press the MX/MN key once.	MX/MN
	For Min measurement, press the MX/MN key twice.	MX/MN MX/MN
2. Max (Min) result is activated		
	MIN (MAX)	Indicates Min (Max) measurement is activated
	1V	2nd display shows the Min (Max) range
View Max (Min)value	Press the 2nd key to view the Max (Min) value.	2ND
Max (Min) measurement appears		
	2nd display	Indicates that the Max (Min) value is displayed on the 1st display
	1st display	Shows the Max (Min)value at full scale
Deactivate Max/Min measurement	To cancel the Max/Min measurement, press the MX/MN key for 2 seconds, or simply activate another measurement.	MX/MN (hold for 2 seconds)

Relative Value Measurement

Applicable to	ACV DCV ACI DCI 2/4W Hz/P TEMP
Background	Relative measurement stores a value, typically the data at the moment, as the reference. The following measurement is shown as the delta between the reference. The reference value will be cleared upon exit.
1. Activate Relative measurement	Press the REL key. The measurement reading at the moment becomes the reference value. REL
2. Relative measurement display appears	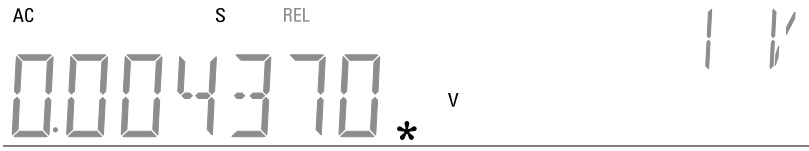
View reference (REL) value	Press the 2nd key to view the reference (REL) value. 2ND
Reference (REL) measurement display appears	
Manually set the reference value	1. To set the reference (REL) value manually, press the Shift key followed by the REL key. The setting appears. SHIFT/ EXIT → REL# REL

REL	Indicates Relative value measurement
2nd display	Shows the measurement range.
1st display	Shows the delta between the current measurement data and the reference value

2nd display	Indicates that the reference (REL) value is displayed on the 1st display
1st display	Shows the reference (REL)value at full scale

REL	Indicates Relative measurement
1st display	Shows the reference value (to full scale)
2nd display	Indicates Relative value modification

2. Use the Left/Right key to move the flashing point (cursor), and use the Up/Down key to change the value.

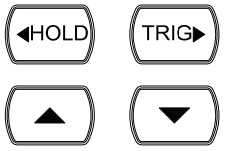

3. Press the Enter key to confirm the value, or the Exit key to cancel. The display switches to measurement.

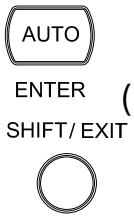

(confirm)

(cancel)

Deactivate Relative measurement

To cancel the Relative measurement, press the REL key again, or simply activate another measurement.

Hold Measurement

Applicable to	ACV DCV ACI DCI 2/4W Hz/P TEMP
Background	The Hold Measurement function retains the current measurement data and updates it only when it exceeds the set threshold (as a percentage of the retained value).
1. Activate Hold measurement	Press the Hold key.
2. Hold measurement display appears	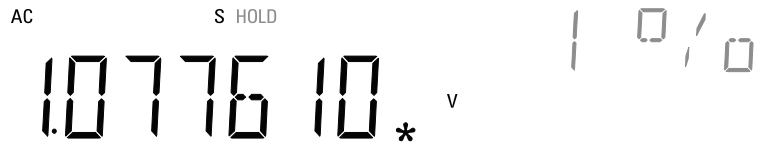

HOLD	Indicates Hold measurement
2nd display	Shows the Hold threshold
1st display	Shows the measurement data.

3. Select hold threshold	Select the hold threshold using the Up/Down key. The 2nd display changes accordingly.
Range	0.01%, 0.1%, 1%, 10%
Deactivate Hold measurement	To cancel the Hold measurement, press the Hold key for 2 seconds, or simply activate another measurement.

Compare Measurement

Applicable to	ACV DCV ACI DCI 2/4W Hz/P TEMP
Background	Compare measurement checks and updates if the measurement data stays between the upper (high) and lower (low) limit specified.
1. Activate Compare measurement	Press the Shift key, then the Hold (Comp) key. 
2. High limit setting	

1st display	Shows the high limit value
2nd display	Indicates high limit setting

1. Use the Left/Right key to move the cursor (flashing point) between high/low setting, digits, and decimal point.

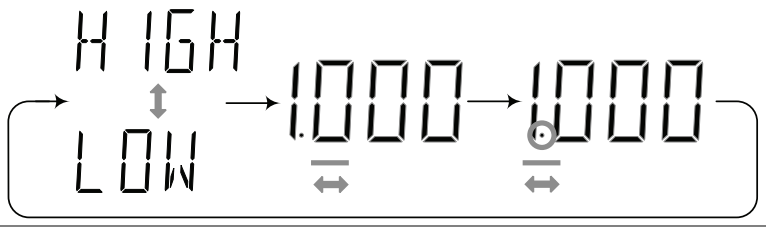

2. Change the parameter using the Up/Down key.

3. Press the Enter key to confirm editing and move to the low limit setting.

3. Low limit setting

1st display	Shows the low limit value
2nd display	Indicates low limit setting

1. Use the Left/Right key to move the cursor (flashing point) between high/low setting, digits, and decimal point.

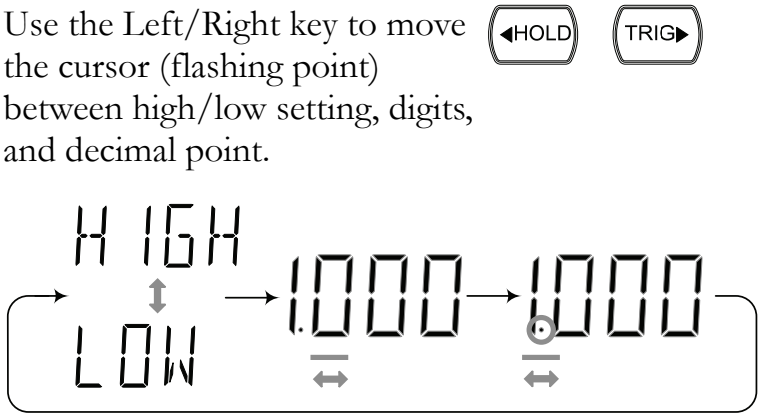

2. Change the parameter using the Up/Down key.

3. Press the Enter key to confirm editing. The compare measurement starts right away.

4. Compare measurement appears

COMP	Indicates Compare mode
2nd display	Shows the compare measurement result: Pass, High, or Low.

5. Result	High	If the 2nd display shows High, the result is above the High limit.
		Digital I/O: FAIL Out (Pin 6) and HIGH Limit FAIL Out (Pin 7) are activated.
	Low	If the 2nd display shows Low, the result is below the Low limit.
		Digital I/O: FAIL Out (Pin 6) and LOW Limit FAIL Out (Pin 8) are activated.
	Pass	If the 2nd display shows Pass, the result is staying between the High and the Low limit.
		Digital I/O: PASS Out (Pin 5) is activated.
Digital I/O	The Compare measurement result comes out from the rear panel Digital I/O terminal. For the terminal details, see page 115.	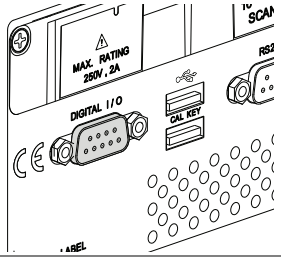
Deactivate Compare measurement	To cancel the Compare measurement, press the Shift key followed by the Hold (Comp) key, or simply activate another measurement.	

Math Measurement

Applicable to	ACV DCV ACI DCI 2/4W Hz/P TEMP
Background	Math measurement runs four types of mathematical operations, MX+B, 1/X, Percentage and Stats, based on the other measurement results.

Math type		
	MX+B	Multiplies the reading (X) by the factor (M) and adds/subtracts offset (B).
	1/X	Inverse. Divides 1 by the reading (X).
	Percentage	Runs the following equation. $\frac{(\text{ReadingX} - \text{Reference})}{\text{Reference}} \times 100\%$
	Stats	Performs standard deviation calculations on measurement data.

Measure MX+B

1. Activate MX+B

Press the Shift key followed by the 2/4W (Math) key. The MX+B setting appears.



2. Set the factor (M)

1st display	Shows the factor (M)
2nd display	Indicates MX+B (The letter M flashes)

1. Use the Left/Right key to move the cursor (flashing point) between the factor, digits, and decimal point.



2. Change the parameter using the Up/Down key.

3. Press the Enter key to confirm editing and move to offset setting.

3. Set the offset (B)

1st display Shows the offset (B)

2nd display Indicates MX+B (The letter B flashes)

1. Use the Left/Right key to move the cursor (flashing point) between the offset and digits. 

2. Change the parameter using the Up/Down key.

3. Press the Enter key to confirm the editing. The MX+B measurement result appears.

4. View MX+B

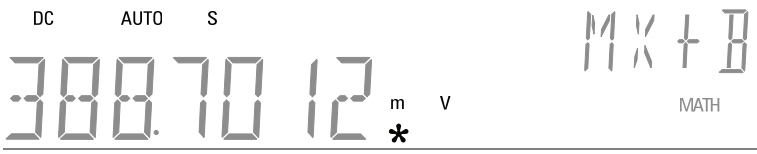

1st display Shows the calculated result

2nd display Indicates MX+B

MATH Indicates Math operation

Measure 1/X

1. Activate 1/X

Press the Shift key, the 2/4W (Math) key, the Down key twice. The 1/X setting appears.

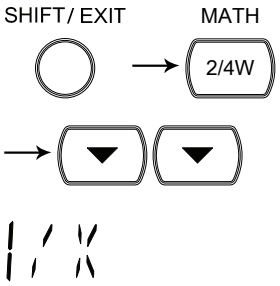

2. View 1/X

Press the Enter key to view the 1/X measurement result.

1st display	Shows the 1/X value
2nd display	Indicates 1/X
MATH	Indicates Math operation

Measure Percentage

1. Activate Percentage

Press the Shift key, the 2/4W (Math) key, the Up key twice. The Reference setting appears. The Percentage is calculated as: [Reading−Reference]/Reference x 100%.

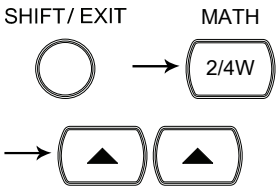

2. Set the reference number

1st display	Shows the reference number
2nd display	Indicates Percentage setting

1. Use the Left/Right key to move the cursor (flashing point) between the digits and decimal point.

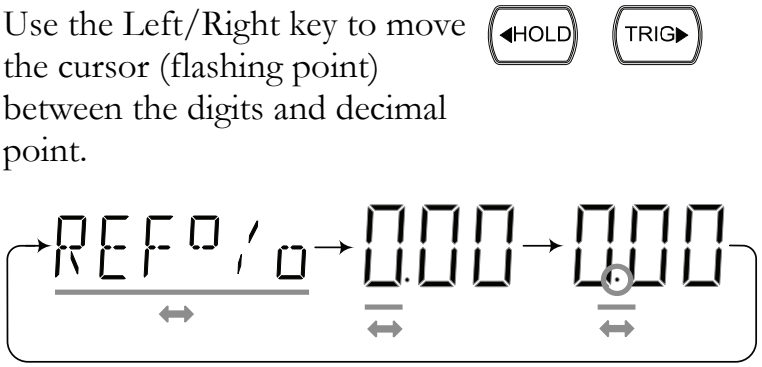

2. Change the parameter using the Up/Down key.

3. Press the Enter key to confirm editing.

3. View Percentage

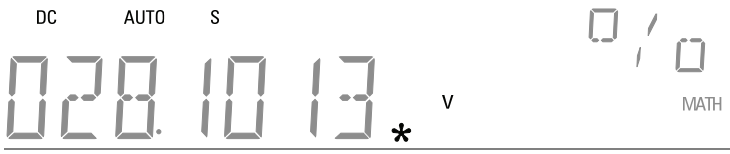

1st display	Shows the calculated result
2nd display	Indicates the Percentage measurement
MATH	Indicates Math operation

Statistics Calculations

Background

The Analyze Stats menu allows you to make statistical calculations on a continuous or user-defined number of measurement counts. The measurements supported include, Maximum, Minimum, Average and Standard deviation.

Number of counts	User Defined	2~100,000 counts
	Continuous	9,999,999 count

1. Activate Statistics

Press the Shift key, the 2/4W (Math) key, the Up key. The Analyze Stats setting menu appears.

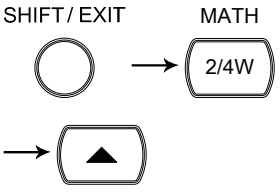

2. Set Count

Press the Enter key to set the number of measurements (counts) that will be used for the Stats function. The Count menu appears.

1st display	Shows the count number as continuous
2nd display	Indicates the count setting

2a.Continuous count

1. To set the count to Continuous and to start measurement, press Enter when CONTINU is displayed on the 1st display.

2. Measurement starts automatically.

2b. User-defined count

1. To set a user-defined count number, press the Left key followed by Up when CONTINU is displayed on the screen. The Count setting menu will appear.

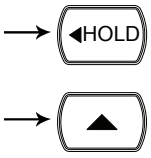

1st display	Shows the count number (2~100,000)
2nd display	Indicates the count setting

2. Use the Left/Right key to move the flashing point (cursor), and use the Up/Down key to change the count number.

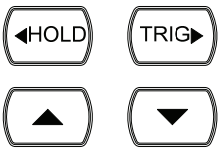

3. Press the Enter key to confirm editing and to start measurement.

3. View Data

1st display	Shows the current count number/measurement
2nd display	Indicates the count measurement mode.
MATH	Indicates Math operation

Press the 2nd key to cycle through the different statistical data measurements.



S:COUNT⇔S MIN⇔S MAX⇔S AVG⇔SSTDEV

COUNT	Indicates the current measurement count
MIN	Indicates the minimum data value
MAX	Indicates the maximum data value
AVG	Indicates the mean (average) value
STDEV	Indicates the standard deviation of the data

Stop/Restart Measuring

Press the SHIFT key and the OUPUT key to stop or restart measuring.

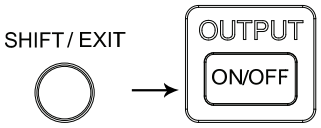

S:COUNT⇔P:COUNT

S:	Indicates the measurement has started
P:	Indicates the measurement has stopped

Exit

Press the SHIFT key and the 2/4W key to exit.



SYSTEM/DISPLAY CONFIGURATION



Refresh Rate	Refresh Rate Setting	71
	View Serial Number	71
Trigger	Manual/Automatic Triggering	72
	Use External Trigger	72
	Set Trigger Delay	74
Digital Filter	Overview	75
	Filter Setting	76
Display	Display Light Setting	77
	Display On/Off Setting (+ key lock)	78
Measurement Configuration Settings	D-Shift Settings	78
	Input Resistance Setting	79
	AC Bandwidth Setting	80
	Current Input Port Auto-Detect Setting	82
ADC Settings	Auto-Zeroing	83
	Auto-Gain	85
	ADC Speed Setting	86
Frequency/ Period settings	Input Port Selection	87
	Gate Time Setting	88

Refresh Rate Setting

Background

Refresh rate defines how frequently the GDM-8261 captures and updates the measurement data. A faster refresh rate yields a lower accuracy and resolution. Slower refresh rates yield a higher accuracy and resolution. Consider this trade-off when selecting the refresh rate.

The refresh rate settings are individually set for all measurement modes except for ACV/ACI measurements. ACV/ACI use the same refresh rate settings.

Display/Range

S	6 ½ digits
M	5 ½ digits
F	4 ½ digits

Refresh rate selection

Press the Shift key followed by the AUTO (Rate) key. The refresh rate indicator switches to the next rate setting.



Refresh Rate S→M→F→S

View Serial Number

Background

View the serial number using the System menu.

Panel operation

1. Press the Shift key, the 2nd key, followed by down and the left key.

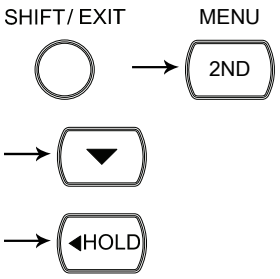

2. Press the Down key. The serial number is shown on the display.

1st display	Shows 2 characters (AA~ZZ).
2nd display	Shows 6 numbers (000000~99999).

3. Press the Enter key or the Exit key to go back to the previous display.

AUTO ENTER or SHIFT/EXIT

Trigger Setting

Manual/Automatic Triggering

Automatic triggering (default)	The GDM-8261 triggers according to the refresh rate. See the previous page for refresh rate setting details.
Manual triggering	Press the Trig key to trigger measurement manually. See below for details. TRIG

Use External Trigger

Background	The GDM-8261 uses the internal trigger by default, for example to count the frequency and the period. Using an external trigger allows customized triggering conditions.
Signal connection	Connect the external trigger signal to the Digital I/O port located on the rear panel.

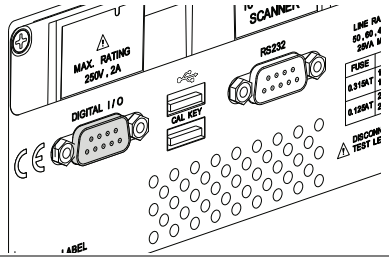

DB-9, female

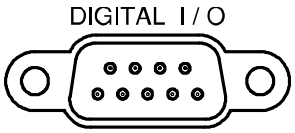

Digital I/O pin assignment

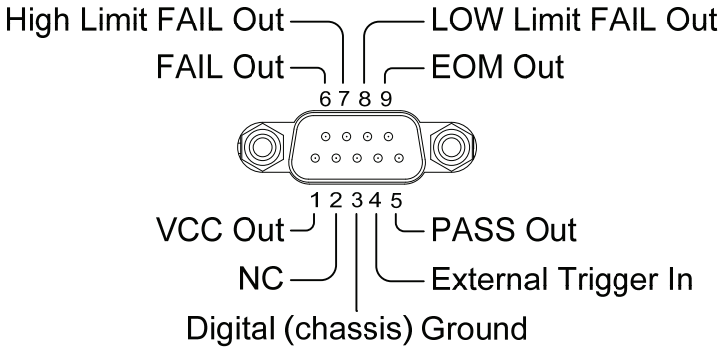

1. Activate external trigger

Press the Shift key followed by the Trig (Int/Ext) key. The EXT indicator appears on the display.



2. Start trigger

Press the Trig key to start triggering manually. The * indicator turns On.

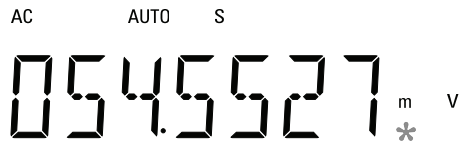

Reading indicator

The reading indicator * does not flash before triggering (can be on or off). After triggering, the indicator flashes according to the external signal trigger timing.

Exit external trigger

Press the Shift key followed by the Trig key. The EXT indicator disappears and the trigger goes back to internal mode.



Set Trigger Delay

Background

Trigger delay defines the time delay between triggering and measurement start. The default is set at 10ms. The delay settings are not supported when the optional scanner is installed.

Panel operation

1. Press the Shift key, the 2nd (Menu) key, the Right key, the Down key. The delay menu appears.

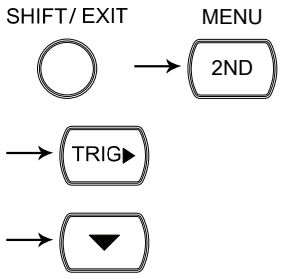

2. Press the Down key. The delay setting appears.

3. Move the flashing point (cursor) using the Left/Right key. Change the value using the Up/Down key.

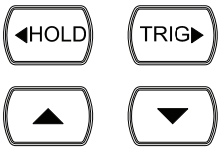

4. Press the Enter key to confirm editing and press the Exit key. The display goes back to previous mode.



Range 0 ~ 9999ms, 1ms resolution

Digital Filter Setting

Overview

Filter basics

The GDM-8261's internal digital filter converts the analog input signal into digital format before passing it to internal circuits for processing. The filter affects the amount of noise included in the measurement result.

Filter type

The digital filter averages a specific number of input signal samples to generate one reading. The filter type defines the averaging method. The following diagrams highlight the differences between the Moving and Repeating filter using 4 samples per reading.

Moving (default)

The Moving filter takes in one new sample and discards the oldest sample per reading. This is the default behavior when the digital filter is not specified, and is recommended for most applications except for the optional scanner operation (page 96).

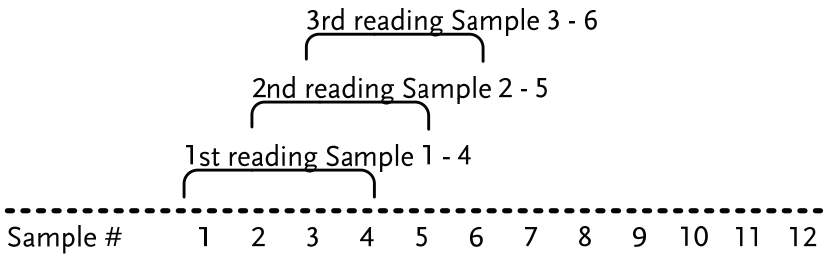

Repeating

The Repeating filter renews a whole group of samples per reading. This method is recommended when using the optional scanner (page 96).

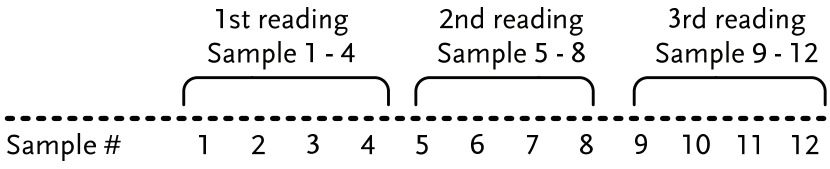

Filter count	Filter count defines the number of samples to be averaged per reading. More samples offer low noise but long delay. Less samples offer high noise but short delay.
Range	2 ~ 100

Filter Setting

Turn on Filter

1. Press the Shift key followed by the MX/MN (Filter) key.



1st display	Shows the filter count
2nd display	Shows the filter type (flashing)

2. Select the filter type using the Up/Down key.

3. Move the cursor to filter count using the Left/Right key. Change the value using the Up/Down key.

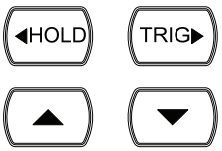

4. Press the Enter key to confirm editing. The Filter indicator appears on the display.

FILT	Indicates manual Filter setting

Turn off Filter	Press the Shift key followed by the MX/MN (Filter) key. The Filter indicator will disappear from the display.	

Display Setting

Display Light Setting

Background	The display light setting adjusts the brightness of the display reading. Use light 3 or more (brighter) when working indoor; use light 2 or 1 (darker) when working outdoor under the sun.	
	Level 5 (brightest) ~ 1 (darkest), default = 3	
Panel operation	1. Press the Shift key followed by the 2nd (Menu) key. The system menu appears.	
	2. Press the Down key, then the Right key twice. The light menu appears.	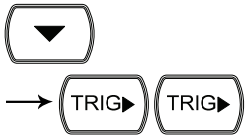
	3. Press the Down key. The light level setting appears.	
	1st display Shows the current display light level	

4. Select the level using the Up/Down key.

5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



Display On/Off Setting (+ key lock)

Background

The display can be turned off when not used for a long time. Note that when this function is used, the panel keys are also locked except for the Output On/Off key. The display is turned on by default.

Panel operation

1. Press the Output On/Off key once. The display will be turned off and the panel keys become locked.

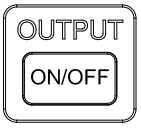

2. To on the display and enable the panel keys, press the Output On/Off key again.

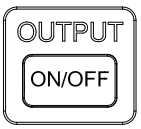

Measurement Configuration Settings

D-Shift Settings

Background

The D-Shift setting automatically shifts the decimal point depending on the measurement. If D-Shift is turned off, the measured readings will be displayed at the full 6 ½ digits with a fixed decimal place. The D-Shift setting is on by default.

D-Shift	On, Off (default, On)

Panel operation

1. Press the Shift key, the 2nd (Menu) key followed by the Right key. The MEAS menu appears.

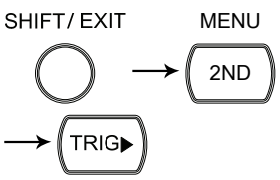

2. Press the down key, followed by the right key twice to enter the D-SHIFT menu.

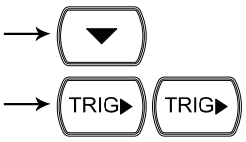

3. Press the Down key. The D-Shift setting appears.

1st display Shows the D-Shift setting

4. Select the setting using the Up/Down keys.

5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



Input Resistance Setting

Background

The 0.1V and 1V DC voltage ranges can be set to an input resistance of 10MΩ or 10GΩ. This setting is only applicable for DC Voltage only.

Input Resistance 10MΩ, 10GΩ (default = 10M)

Panel operation

1. Press the Shift key, the 2nd (Menu) key followed by the Right key. The MEAS menu appears.

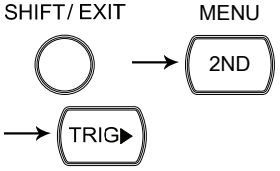

MEAS LEVEL 1

2. Press the down key followed by the right key three times. The Input Resistance menu appears.

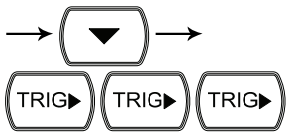

INPUT R LEVEL 2

3. Press the Down key. The input resistance setting appears.

10M IN R

1st display Shows the input resistance setting

4. Select the setting using the Up/Down keys.

5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



AC Bandwidth Setting

Background

Sets the AC Bandwidth (filter) setting for AC measurements. The Slow, Medium, Fast (S, M, F) rate settings are directly tied to the AC bandwidth settings.

Rate	Digits	Input Frequency	Readings/s
S	6 ½	3 Hz – 300 kHz	1.2 (sec/reading)
M	5 ½	20 Hz – 300 kHz (default)	3.38
F	4 ½	200 Hz – 300 kHz	30

Panel operation

1. Press the Shift key, the 2nd (Menu) key followed by the Right key. The MEAS menu appears.

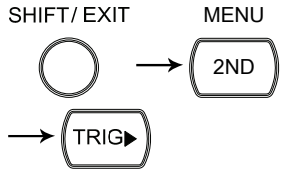

2. Press the down key followed by the left key twice. The AC Bandwidth menu appears.

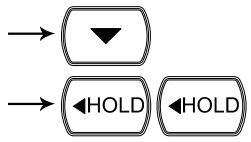

3. Press the Down key. The input bandwidth setting appears.

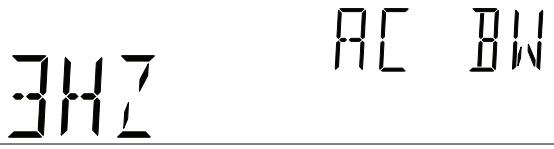

1st display Shows the bandwidth setting

4. Select the setting using the Up/Down keys.

5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



Current Input Port Auto-Detect Setting

Background

The Current Input Port Auto-Detect setting will allow the DMM to detect whether current is applied to the 1A or 10A input ports and enables it to set the correct range when Auto range is on.

The Current detect feature works by activating the input port only when a certain Detect Threshold is reached and deactivating the input port when the input current dips below a certain Reset Threshold.

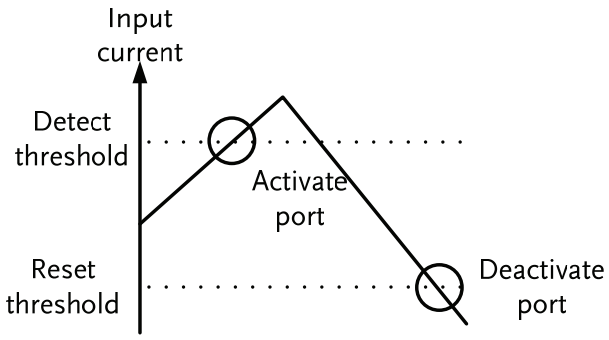

I-DET On, Off (default = Off)

Panel operation

1. Press the Shift key followed by the 2nd (Menu) key. The system menu appears.



2. Press the Right key, then the down key. Press the left key. The Current detect menu appears.

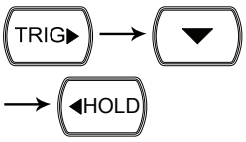

3. Press the Down key. The input current detect setting appears.

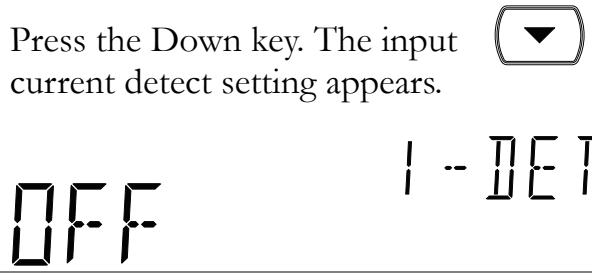

1st display Shows the current detect setting

4. Select the setting using the Up/Down keys.

5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



ADC Setting

Auto-Zeroing

Background

The Auto Zeroing (A-Zero) function can be used in resistance, TC, RTD, DCV and DCI measurements.

Auto zeroing is used to prevent measurements from drifting by taking offset measurements.

Setting Off, On (default=On)

Theory

The combined offset from the input buffer, A/D driver and ADC is called the total offset. Due to temperature variations inside the GDM-8261, the offsets for the Buffer, A/D driver and ADC vary over time, and thus the total offset will also vary over time.

Auto Zero deducts this total offset from the measured signal to obtain a more accurate reading. If Auto Zero is turned off, this total offset will not be deducted from the measured signal.

Auto zero works in the following manner:

Internally, the DMM will periodically short the Buffer's Hi and Lo input to obtain a total offset. The frequency at which the offset is obtained depends on the sample rate.

The diagram below shows how the total offset is obtained.

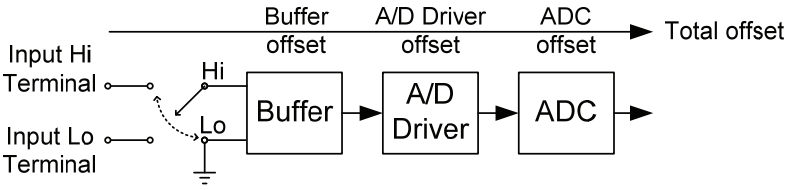

Applicable Measurement Mode, Rate and Speed settings

Mode	Rate	Accuracy Speed	Quick Speed
DCV, DCI, 4W/2W	S	✓	✓
	M	✓	
	F	✓	
TC, RTD	✓ (No Speed setting)		

Panel operation

1. Press the Shift key followed by the 2nd (Menu) key. Press the right key twice. The ADC setting menu appears.

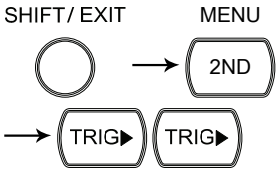

2. Press the Down key twice. The A-Zero setting appears.

1st display Shows A-Zero setting

3. Select the setting using the Up/Down key.

4. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



Auto-Gain

Background

The Auto-Gain (A-GAIN) setting performs auto gain correction of the internal amplifiers.

Setting Off, On (default=On)

Applicable Measurement Mode, Rate and Speed settings

Mode	Rate	Accuracy Speed	Quick Speed
DCV, DCI	S	✓	✓
	M	✓	
	F	✓	
TC	✓ (No Speed setting)		

Panel operation

1. Press the Shift key followed by the 2nd (Menu) key. Press the right key twice to choose the SET ADC menu.

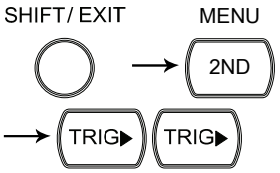

2. Press the Down key and then the Left key to choose A-GAIN. Press the Down key. The A-GAIN setting appears.

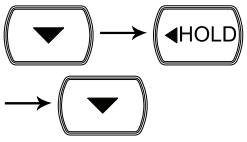

1st display Shows A-Zero setting

3. Select the setting using the Up/Down key.



4. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



ADC Speed Setting

Background

The analog to digital converters have a Quick and Accurate Speed setting. The ADC Speed settings only apply to DCV, DCI or 2/4W resistance measurements. The ADC Speed settings can only be set if DCV, DCI or 2/4W mode is active.

Setting	Quick, Accurate (default=Accurate)

Speed/Rate Settings

The Speed settings depend on the operating mode and the rate settings.

			Readings/s	
Function	Rate	Digits	Accurate	Quick
DCV, DCI, 2/4W (100Ω ~100MΩ)	S	6 ½	5	30
	M	5 ½	60	600
	F	4 ½	240	2400

Panel operation

1. Ensure a DC related measurement function is selected.

DCV page 26
DCI page 30
2/4W page 32

2. Press the Shift key followed by the 2nd (Menu) key. Press the right key twice. The SET ADC menu appears.

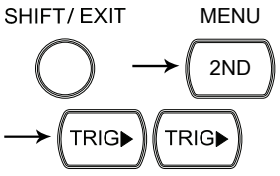

3. Press the Down key, the right key and then the down key. The Speed settings menu appears.

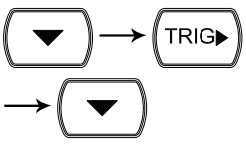

1st display	Shows the Speed setting

4. Use the Up/Down keys to select either ACCUR or QUICK.

5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



Frequency / Period Settings

Input Port Selection

Background The INJACK settings set which input port is used for frequency or period measurements.

Setting VOLT, 1A, 10A

Panel operation

1. Press the Shift key followed by the 2nd (Menu) key. Press the right key three times. The Frequency/Period menu appears.

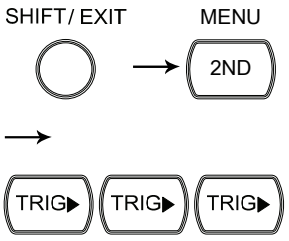

2. Press the Down key twice. The INJACK setting appears.

1st display Indicates which input port is assigned as the input port.

3. Select the input using the Up/Down key.

4. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



Gate Time Setting

Background

The gate time settings determine the accuracy of the frequency and period measurements. The gate time settings are the equivalent to the Fast, Medium and Slow rate settings.

Setting	10ms, 100ms, 1000ms

Rate Settings

The gate time settings are analogous to the rate settings.

Function	Digits	Rate	Readings/s	Gate time
Frequency, Period	6 ½	Slow	1	1000ms
	5 ½	Med.	10	100ms
	4 ½	Fast	100	10ms

Panel operation

1. Press the Shift key followed by the 2nd (Menu) key. Press the right key three times. The Hz/P menu appears.

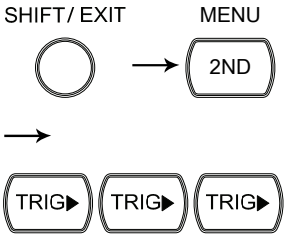

2. Press the Down key, the right key and then the down key. The gate time settings menu appears.

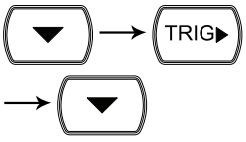

1st display	Shows the gate time setting

3. Select the gate time using the Up/Down key.

4. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



STORE/RECALL

The GDM-8261 can store and recall measurement history (for up to 10000 counts) as well as the instrument settings. For storing and recalling measurement results using the Scanner, see page 96.

STORE RECALL

DCI ACI

Store Measurement Record 91
Recall Measurement Record 92
Save Instrument Settings..... 93
Recall Instrument Settings..... 94

Store Measurement Record

Background

The GDM-8261 can log up to 9999 measurement results (counts) which can be stored and recalled later for analysis. Basic measurement statistics such as Maximum, Minimum, Average value as well as Standard Deviation are also recorded with the data.

Note: Previously recorded measurements will be erased every time the store function is used or if power is reset.

Data count	2 ~ 9999

Not applicable to

Store/recall measurement history is not applicable to the Diode/Continuity tests ⊣/•)).

Store step

1. Press the Shift key followed by the DCI (Store) key. The store menu appears.



2. Move the cursor using the Left/Right key. Change the data count using the Up/Down key.

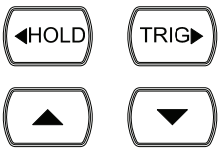

3. Press the Enter key to confirm editing and to go back to the previous display.

STO	Indicates the measurement history is stored

Recall Measurement Record

Background	The GDM-8261 can recall previously recorded measurement results for observation and analysis. The Standard Deviation, Maximum Value, Minimum Value and Average Value can also be viewed.
Not applicable to	Store/recall measurement history is not applicable to the Diode/Continuity tests ⊣/•)).
Recall stored record	Press the Shift key, then the ACI (Recall) key. The stored measurement record appears. 
View each reading	Change the reading count using the Up/Down key.
View Max/Min/ Average	Switch to the Standard Deviation/Average/Maximum/ Minimum value of the recorded data using the Right key. Use the left key to go back. 

1st display	Shows the stored measurement result
2nd display	Shows the reading count
RCL	Indicates the data has been recalled

Save Instrument Settings

Background

The GDM-8261 can save up to 5 instrument settings. The settings can save the state, function, I/O and range. Upon powering up, the current instrument setting is displayed.

Parameter	Save (1-5), Del-All

Saved Parameters

- Main display parameters
- 2nd display parameters
- Filter settings
- Beep settings
- I/O settings
- System Delay Time
- Backlight (Light) settings
- Math settings
- Auto-Zero settings
- Auto-Gain settings
- Scanner settings
- Settings for each function
- Continuity threshold
- TCO settings
- D-Shift
- Bandwidth
- Gate time
- RTD settings
- Input Resistance
- Input Jack
- I-DET
- TX TERM

Set Instrument Setting

1. Press the Shift key followed by the 2nd (Menu) key. The SYSTEM menu appears.



2. Press the Down key followed by the Right key three times. The Save menu appears.

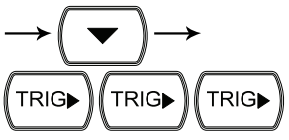

3. Press the Down key to enter the Save menu.

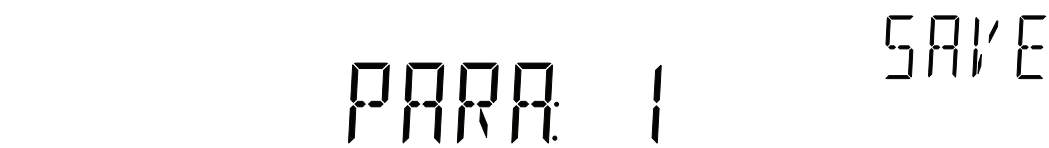

	1st display	Shows the memory number
	4. Select the memory number using the Up/Down key or select Del-All to delete the save settings in memory.	
	5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.	
Note	The current instrument settings have been saved. To enable the settings at power up, follow the instructions in the next section.	

Recall Instrument Settings

Background	The Recall function enables saved settings or default settings to be recalled at power up.	
	Parameter	Recall (0-5), 0 = recall default settings
Recall Instrument Setting	1. Press the Shift key followed by the 2nd (Menu) key. The SYSTEM menu appears.	
	2. Press the Down key followed by the Left key two times. The Recall menu appears.	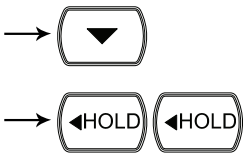
	3. Press the Down key to enter the Recall menu.	

PARA: 0 RECALL

1st display Shows the memory number

4. Select the memory number using the Up/Down key.



5. Press the Enter key to confirm your selection. Press the Exit key to go back to the default display.



When the instrument is reset or upon the next power up, the recalled settings will be enabled.

SCANNER (OPTIONAL)

The optional scanner GDM-SC1 lets you effectively measure multiple channels connected to a single GDM-8261 DMM.

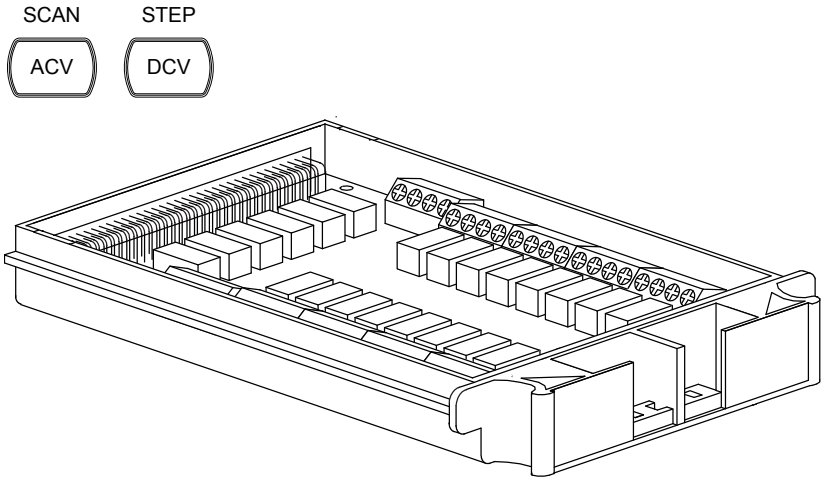

Installation	GDM-SC1 Scanner Specifications	97
	Configure Scanner	97
	Select Channel Group and Enable Scanner	99
	Connect Wires	100
	Insert Scanner	101
	Scanner Configuration Record	103
Setup	Overview	104
	Setup Simple Scan	105
	Setup Advanced Scan	107
	Use External Trigger	110
Run	Overview	111
	Run Scan/Step	111
	Recall Scan/Step Result	112
	Setup and Run Monitoring	112

GDM-SC1 Scanner Specifications

2-wire channel	16 pairs	Maximum current	2A (ch17, ch18)
4-wire channel	8 pairs	Resistance	2/4 wire
Single wire channel	N/A	Cold junction	N/A (internal)
Maximum voltage	250V	Connection	Screw terminal

Scanner Installation

Configure Scanner

Open Scanner cover

1. Take off four screws from the bottom panel of the scanner.

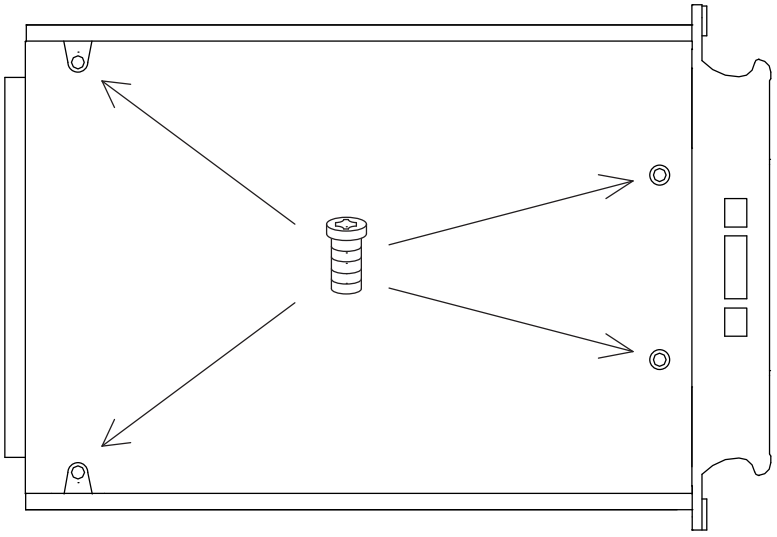

2. Remove the top panel.

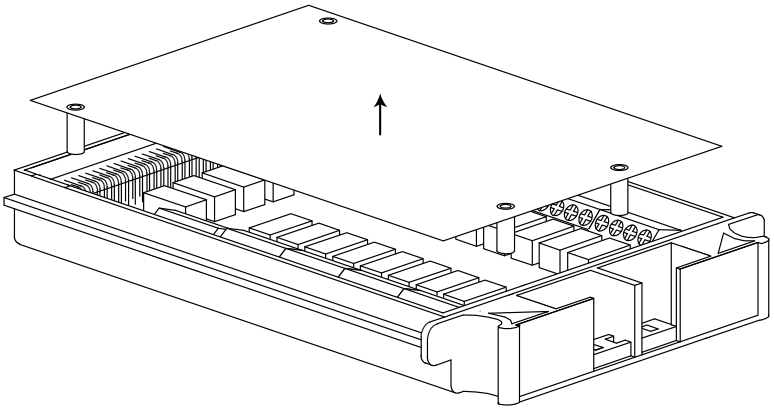

3. The connection terminals are revealed.

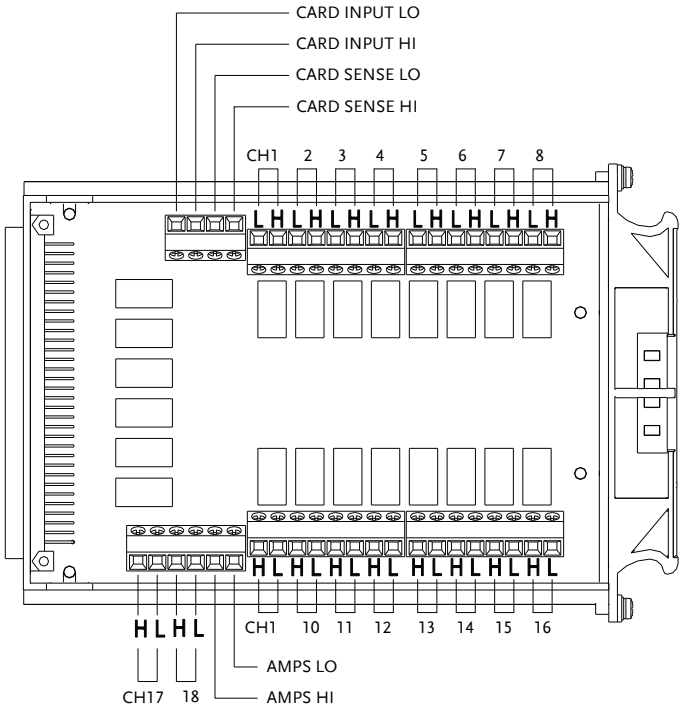
CARD INPUT LO
CARD INPUT HI
CARD SENSE LO
CARD SENSE HI
CH1 2 3 4 5 6 7 8
L H L H L H L H L H L H L H L H
H L H L H L H L H L H L H L H L
H L H L
CH1 10 11 12 13 14 15 16
AMPS LO
AMPS HI
CH17 18

Overview

16 general purpose channels are available, 8 on the left row, 8 on the right row. Current (ACI, DCI) measurement uses 2 extra channels. All channels are fully isolated (Hi and Lo).

Scan/Step connection

Refer to the below table for measurement and test line connections.

Item	No. of wires	No. of channels
DCV, ACV	2 wires (H, L)	16 (CH1 ~ 16)
DCI, ACI	2 wires (H, L)	2 (CH17, 18)
2W Resistance	2 wires (H, L)	16 (CH1 ~ 16)
4W Resistance	4 wires (Input H, L + Sense H, L)	8 pairs (CH1 [input]& 9[sense], 2&10,....8&16)
Diode/Continuity	2 wires (H, L)	16 (CH1 ~ 16)
Period/Frequency	2 wires (H, L)	16 (CH1 ~ 16)
Temperature	2 wires (H, L)	16 (CH1 ~ 16)

Select Channel Group and Enable Scanner

Background

16 channels are available for the scanner when using the GDM-8261.

Group1	CH101 ~ 118

Select group (Jumper J8)

Set the jumper J8 in the center of the board to the MASTER configuration. Move the jumper to the right (pins 2-3) to select CH1xx (101 ~ 118). The GDM-8261 does not support the SLAVE operation mode with the optional scanner.

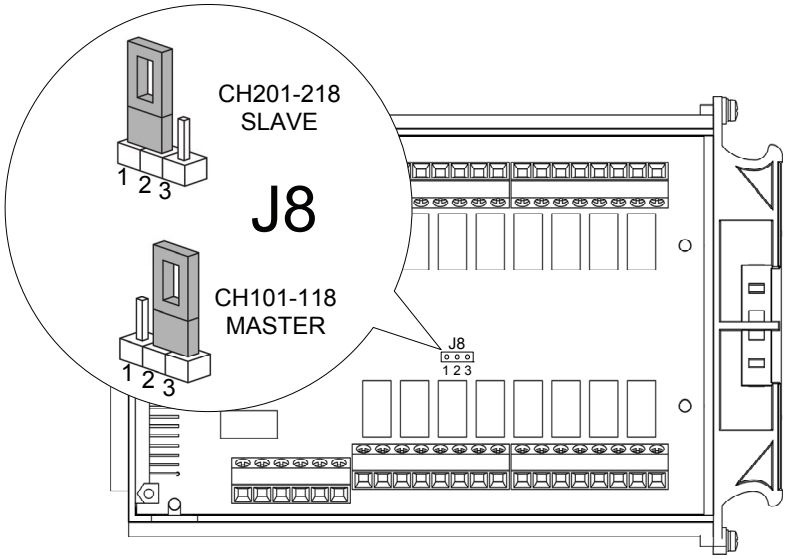

Enable scanner (Jumper J9)

Set the jumper J9 on the rear side of the board accordingly. Move the jumper up (pins 3-2) to disable the scanner, and down (pins 2-1) to enable the scanner.

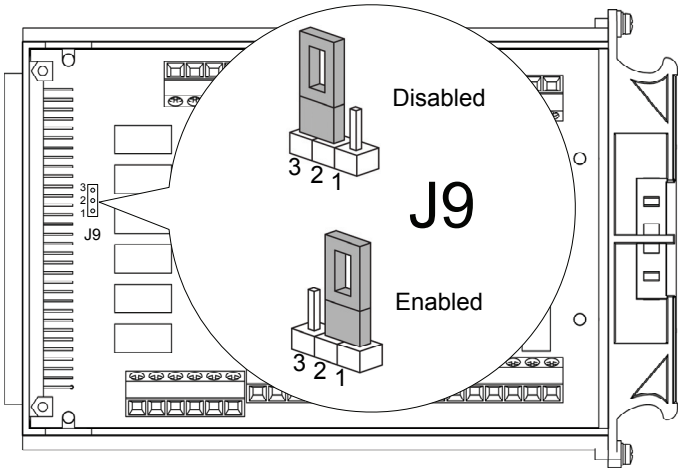

Connect Wires

Wire selection

Make sure the wires have at least the same voltage and current capacity as the maximum ratings of the measurement.

Connection

1. Turn the screw left (loose) using a screw driver and insert the wire. Turn the screw right (tighten) and secure the connection.

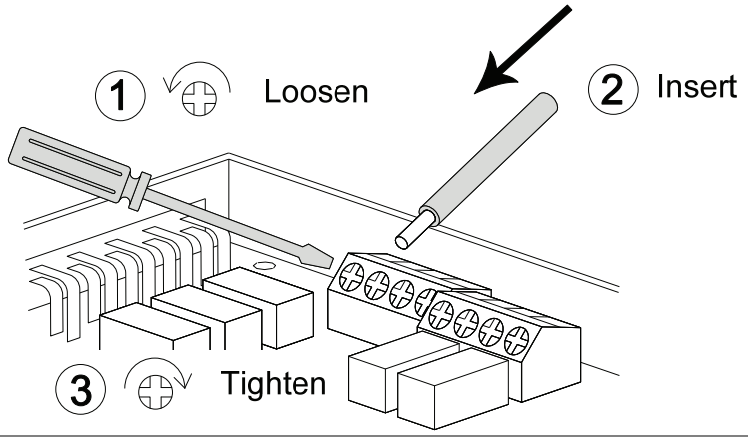

2. Route the wires as shown below via the two openings (left and right) at the front cover.

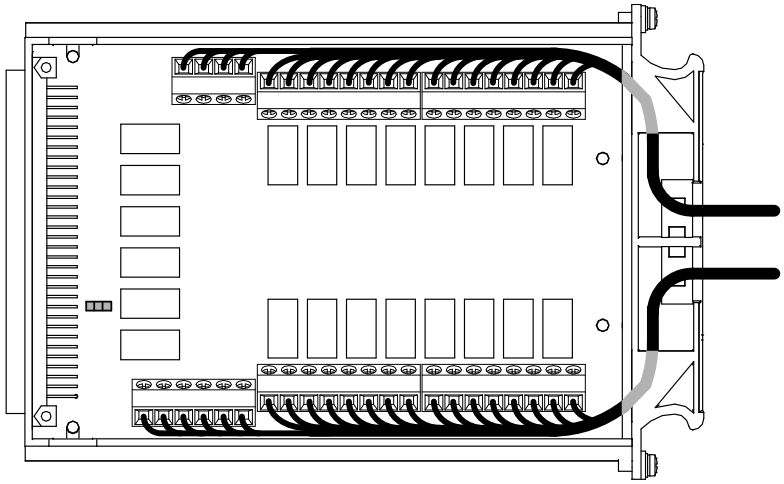

3. Bundle the wires at the front cover using the holes at the bottom.

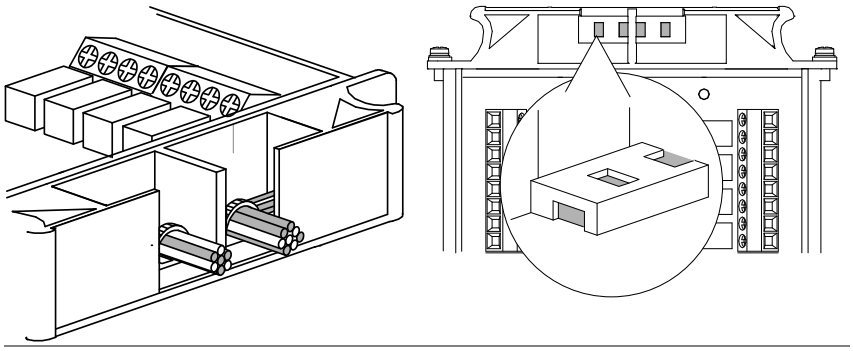

4. Close the top cover and tighten the screw from the bottom.

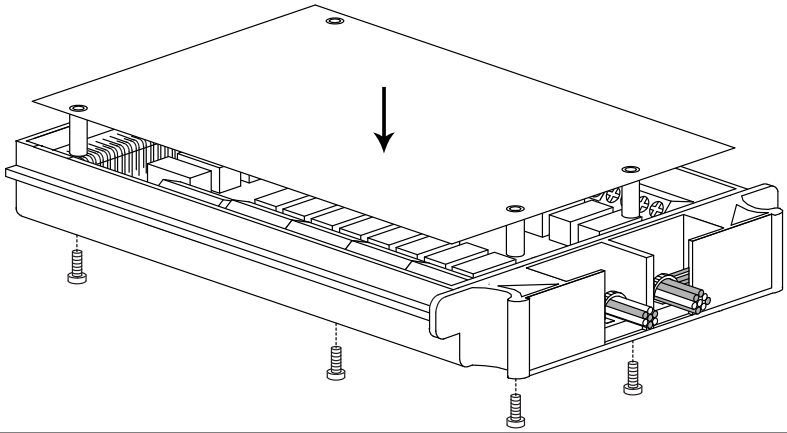

Configuration Record	Print out the configuration record list on page 103, fill in the details, and keep it with the GDM-8261.

Insert Scanner

Power Off

Turn the Power Off and take out the power cord.

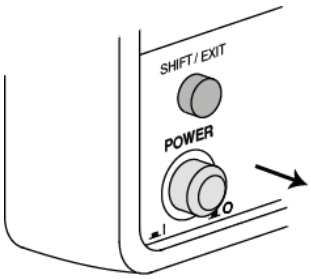

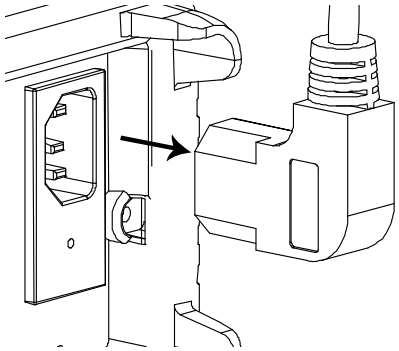

Open the GDM-8261 rear panel slot

Take off the two screws on the slot corners to remove the optional slot cover. Keep the screws for later reuse.

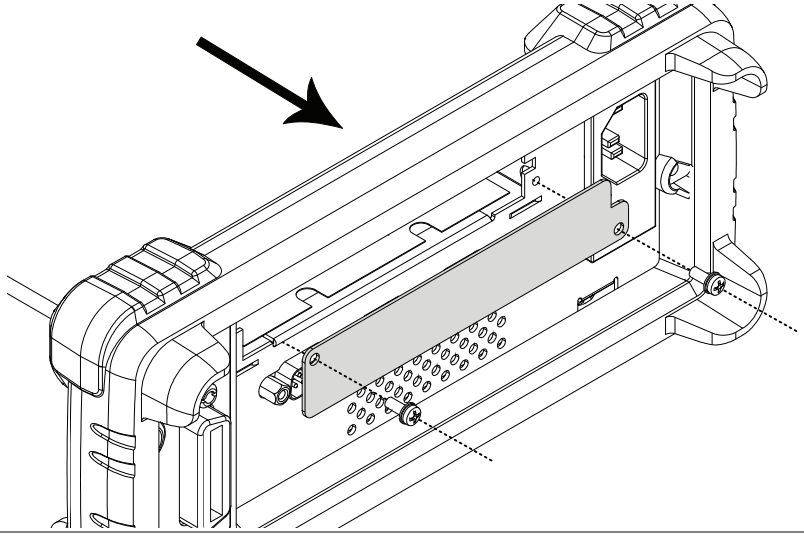

Insert the scanner

Insert the scanner bottom-side-up (already configured according to the procedures on page 97) into the slot. Close the cover by tightening the screws.

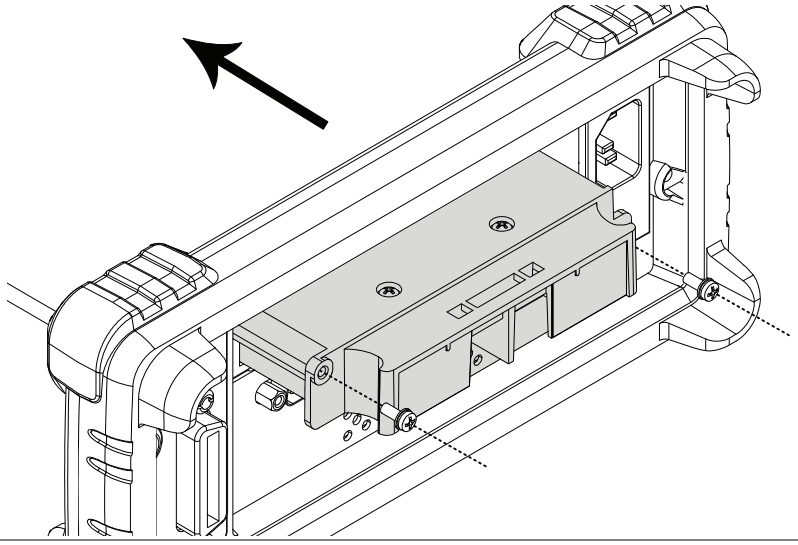

Power On

Connect the power cord and turn On the power.

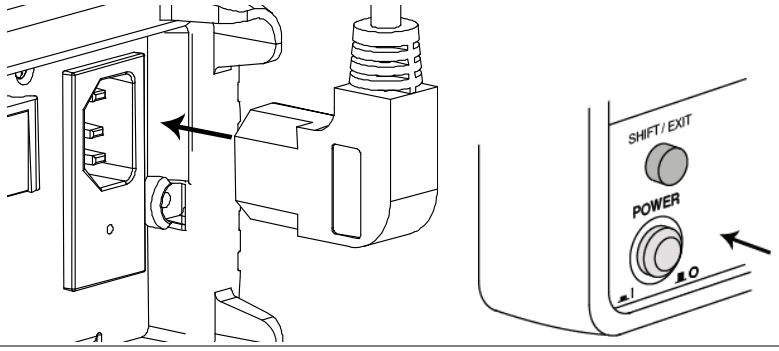

Scanner Configuration Record

Channel	Wire color		Measurement type	Note
CH1	H	L		
CH2	H	L		
CH3	H	L		
CH4	H	L		
CH5	H	L		
CH6	H	L		
CH7	H	L		
CH8	H	L		
CH9	H	L		
CH10	H	L		
CH11	H	L		
CH12	H	L		
CH13	H	L		
CH14	H	L		
CH15	H	L		
CH16	H	L		
CH17	H	L		
CH18	H	L		
CARD INPUT	H	L		
CARD SENSE	H	L		
AMPS	H	L		

Setup Scan

Overview

Scan type	Simple	Sets the scanned channel range, loop count, and timer length. All channels have a common measurement item.
	Advanced	In addition to the above Simple Scan settings, the advanced mode has custom settings for each channel, such as measurement item, range, and rate.
Timer setting	Sets the duration between each scan loop (Scan operation) or between each scanned channel (Step operation).	
Count setting	Sets the number of scan operations (loop).	
Trigger setting	Internal (Continuous)	The GDM-8261 keeps triggering continuously until the scan reaches the end of the loop count. Then it goes into the idle mode.
	External (Manual)	The GDM-8261 stays in the idle mode by default. The trigger timing is manually controlled by the user from the front panel using the Trig key.
Scan operation	Scan	Measures all specified channel ranges (Channel MIN~MAX) for each trigger event. Timer settings (page 106) are applied between each scan for the whole channel range.

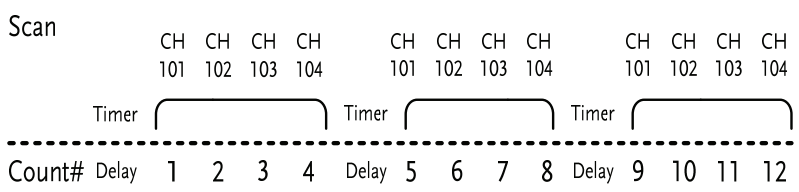

Example: Scan channels 1~4 with a count setting of 12.

Step	Measures a single channel in the specified range (Channel MIN~MAX)at each trigger event. Timer settings (page 106) apply for each channel.

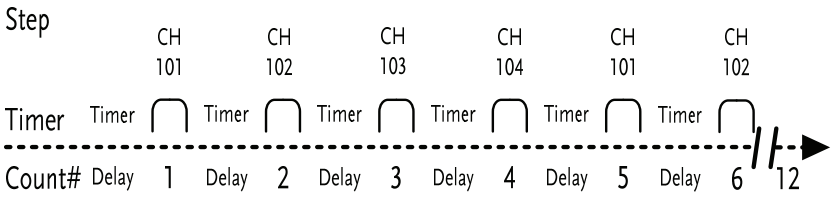

Example: Step through channel 1~4 with a count of 12.

Monitor	Selects just one channel and continuously measures it.

Setup Simple Scan

Ensure the scanner has been installed before trying to configure the scanner (page 97).

Panel operation

1. Press the Shift key, the 2nd key (MENU), the Left key. The Scan menu appears.

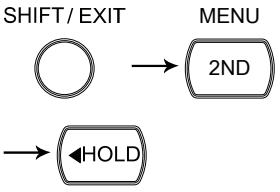

2. Press the Down key. The Simple Scan menu appears.

3. Press the Down key again. The Starting (Minimum) channel setting appears.

4. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.

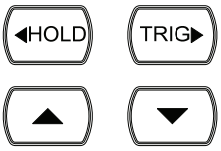

Range 101 ~ 118

5. When finished, press the Enter key. The End (Maximum) channel setting appears.

6. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.

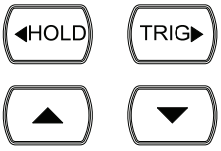

Range 101 ~ 118, (must be equal to or greater than the Start (Min) channel)

7. When finished, press the Enter key. The Timer setting appears.

8. Move the cursor to the time setting using the Left/Right key, and change the value using the Up/Down key.

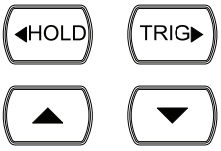

Range 1ms ~ 9999ms

9. Press the Enter key. The loop (step) Count setting appears.

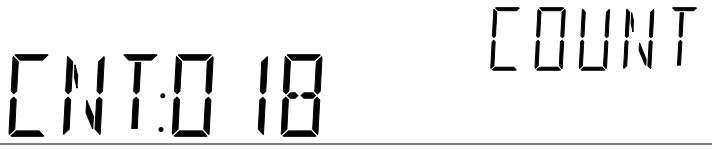

10. Move the cursor to the count number using the Left/Right key, and change the value using the Up/Down key.

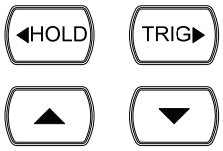

Range 1 ~ 999

11. Press the Enter key followed by the Exit key. The setting is stored and the display goes back to the normal mode.



Setup Advanced Scan

Panel operation

1. Press the Shift key, the 2nd key (MENU), the Left key. The Scan menu appears.

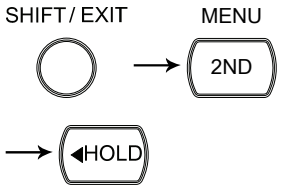

2. Press the Down key followed by the Right key. The Advanced Scan menu appears.



3. Press the Down key. The Starting (Minimum) channel setting appears.

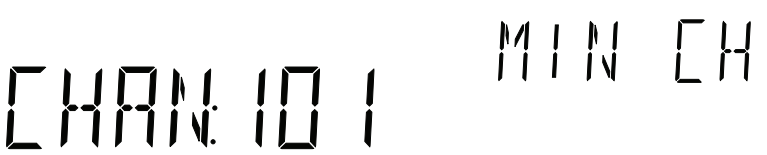

4. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.

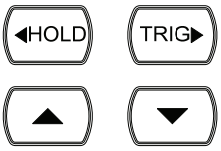

Range 101 ~ 118

5. When finished, press the Enter key. The End (Maximum) channel setting appears.

6. Move the cursor to the channel using the Left/Right key, and change the value using the Up/Down key.

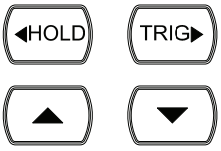

Range 101 ~ 118 (must be greater than or equal to the Start (Min) channel)

7. When finished, press the Enter key. The Timer setting appears.

8. Move the cursor to the timer setting using the Left/Right key, and change the value using the Up/Down key.

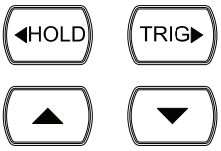

Range 1ms ~ 9999ms

9. When finished, press the Enter key. The Count setting appears.

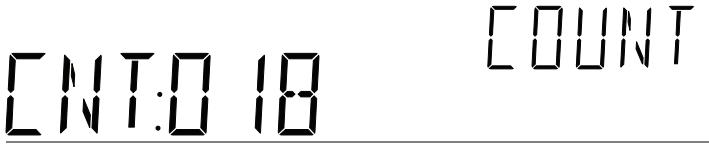

Range 1 ~ 999

10. Move the cursor to the count number using the Left/Right key, and change the value using the Up/Down key.

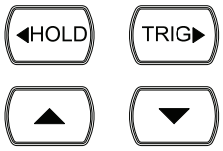

11. When finished, press the Enter key. The channel setting appears.

12. The Minimum (first) scanned channel, as set in the Simple Scan setting, appears. The default setting is CH101.

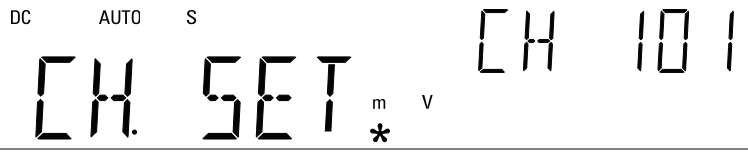

13. Set the measurement conditions.

- To select measurement item, press the target key.

- To select Auto range, press the AUTO key.



- To manually select the range, press the Up/Down key.

14. When finished, press the Right key to confirm the edit and to move to the next channel.

15. When all channel configurations are completed, press the Exit key followed by the ACV or DCV key. The display goes back to the default mode.

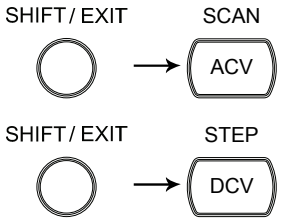

Use External Trigger

Background

The GDM-8261 uses the internal trigger by default. Using an external trigger allows customized triggering.

Signal connection

Connect the external trigger signal to the Digital I/O port located on the rear panel.

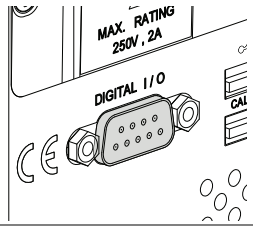

DB-9, female

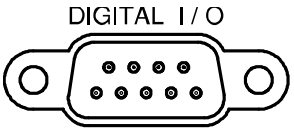

Digital I/O pin assignment

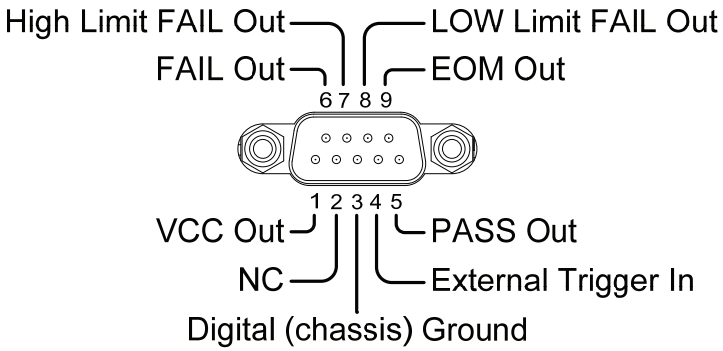

Pin4	External Trigger Input pin

Activate external trigger

Press the Shift key followed by the Trig key. The EXT indicator appears on the display.



Start trigger

Press the Trig key to start triggering manually. The reading indicator (*) turns On.

Reading indicator

The reading indicator * stays On before triggering. After triggering, the indicator flashes according to the external signal trigger timing.

Exit external trigger

Press the Shift key followed by the Trig key. The EXT indicator disappears and the trigger goes back to the internal mode.



Run Scan

Overview

Scan operation type	Scan	Measures all the specified channel ranges at each trigger event. The timer settings (page 106) apply to each scan.
	Step	Measures a single channel in the specified range at each trigger event. The timer settings (page 106) apply to each channel.
	Monitor	Continuously measures one channel.

Run Scan/Step

Activate Scan/Step

1. Press the Shift key followed by the ACV key (Scan) or DCV key (Step).

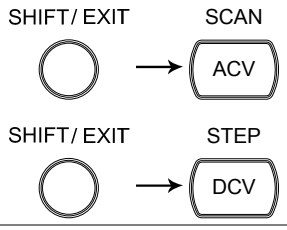

2. The STO indicator turns On. The Scan (Step) starts running and the data is recorded. After running the predefined count, the Scan (Step) stops running.

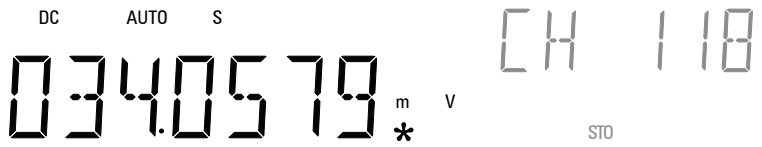

Retrigger/Restart Scan

To run the Scan (Step) again, press the Trig key. The previous data is overwritten by the new Scan.

Abort Scan/Step

To abort Scan/Step or to go back to the normal display, press the Shift key followed by the ACV key (Scan) or DCV key (Step) again.

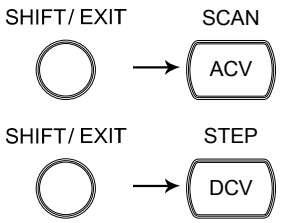

Recall Scan/Step Result

Panel operation

1. After the Scan/Step is completed, the data is stored internally. Press the Shift key followed by the ACI (Recall) key.



2. The first channel appears. (example: channel 101)

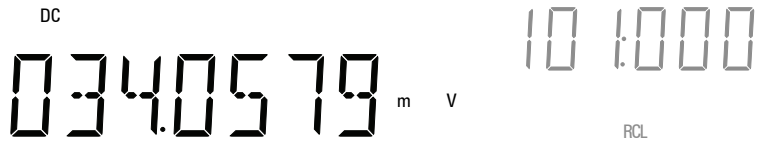

3. To view the Standard Deviation/Min/ Max/Average data, press the Left and Right keys.



4. To move to the next channel, press the Up/Down key.

5. Press the Exit key to get out from recall mode.

Setup and Run Monitoring

Panel operation

1. Press the Shift key, the 2nd (Menu) key, the Left key. The Scan menu appears.

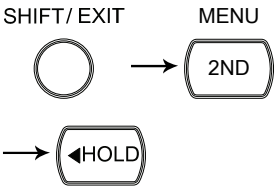

2. Press the Down key followed by the Left key twice. The Monitor Scan setting menu appears.

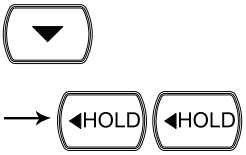

MONITOR LEVEL2

3. Press the Down key. The channel selection appears.

CHAN:101 MONITO

4. Move the cursor to the channel using the Left/Right key, and change the channel number using the Up/Down keys.

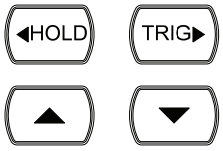

5. When finished, press the Enter key. The Monitoring starts.

DC AUTO S

034.0579 m V *

CH 101

STO

DIGITAL I/O

The rear panel Digital I/O terminal outputs the result of Compare measurements to external devices.

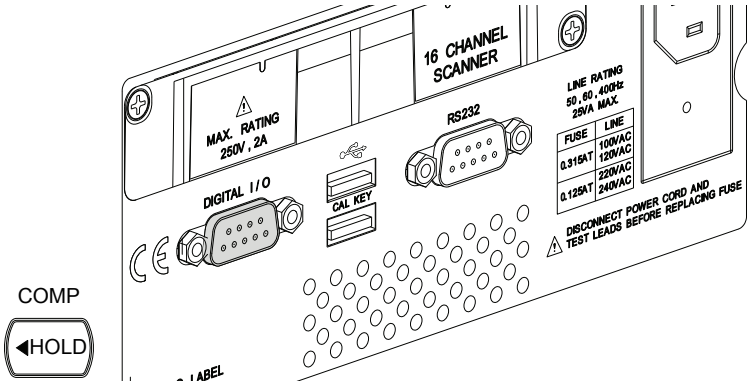

Terminal configuration	Digital I/O Terminal Configuration	115
Application	Application: Compare measurement	116
	Application: External trigger	119

Digital I/O Terminal Configuration

Background

The digital I/O terminal outputs the result of Compare measurements to control external devices. By providing separate VCC power for the terminal, the outputs can also be used as a power source for TTL and CMOS circuits.

Pin assignment

Connector type: DB-9 female

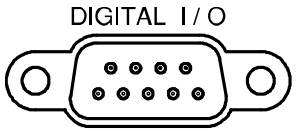

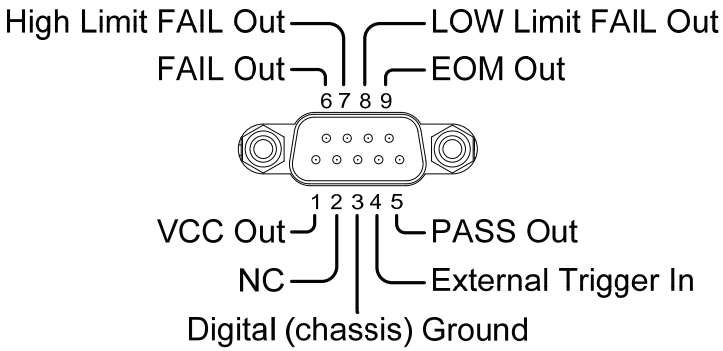

Pin1	VCC output, 5V. Serves as the power source for the external device/logic.
Pin2	NC (No Connection).
Pin3	Digital (chassis) Ground.
Pin4	External Trigger Input. Accepts external trigger signals. For using external signals, see page 110 (Scanner) or page 72 (Configuration).
Pin5-9	Pins 5-9 use open-collector outputs and thus require a pull-up resistor for each pin. The output resistor must have a minimum rating of 500Ω. All the outputs are active low.
Pins 5-9 output wiring diagram	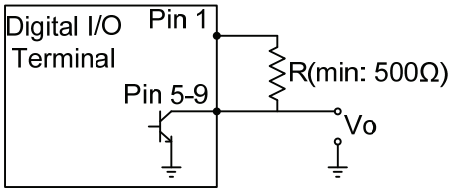
Pin5	PASS signal Output. Activates when the compare result is PASS.

Pin6	FAIL signal Output. Activates when the compare result is FAIL.
Pin7	HIGH Limit FAIL signal Output. Activates when the compare result is FAIL due to violating the HIGH Limit.
Pin8	LOW Limit FAIL signal Output. Activates when the compare result is FAIL due to violating the LOW Limit.
Pin9	EOM (End Of Measurement) signal Output. Activates when compare measurement is over.

EOM pulse width timing

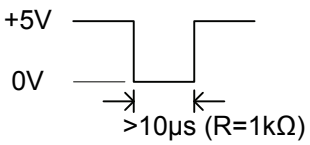

Application: Compare measurement

Applicable to	ACV DCV ACI DCI 2/4W Hz/P TEMP
Background	Compare measurement checks and updates if the measurement data stays between the upper (high) and lower (low) limit specified.
1. Activate Compare measurement	Press the Shift key, then the Hold (Comp) key. SHIFT/ EXIT → COMP (HOLD)
2. High limit setting	1.000000 V HIGH

1st display	Shows the high limit value
2nd display	Indicates high limit setting

1. Use the Left/Right key to move the cursor (flashing point) between high/low setting, digits, and decimal point. (HOLD) (TRIG)

2. Change the parameter using the Up/Down key.

3. Press the Enter key to confirm editing and move to the low limit setting.

AUTO
ENTER

3. Low limit setting

1st display	Shows the low limit value
2nd display	Indicates low limit setting

Set the low limit in the same way as in the high limit. Press the Enter key to confirm editing. The compare measurement starts right away.

AUTO
ENTER

4. Compare measurement appears

COMP	Indicates Compare mode
2nd display	Shows the compare measurement result: Pass, High, or Low.

5. Result

High	If the 2nd display shows High, the result is above the High limit. HIGH
	Digital I/O: FAIL Out (Pin 6) and HIGH Limit FAIL Out (Pin 7) are activated.
Low	If the 2nd display shows Low, the result is below the Low limit. LOW

		Digital I/O: FAIL Out (Pin 6) and LOW Limit FAIL Out (Pin 8) are activated.
	Pass	If the 2nd display shows Pass, the result is staying between the High and the Low limit. Digital I/O: PASS Out (Pin 5) is activated.
Timing Diagram for pins 5-8 when the Compare function is activated	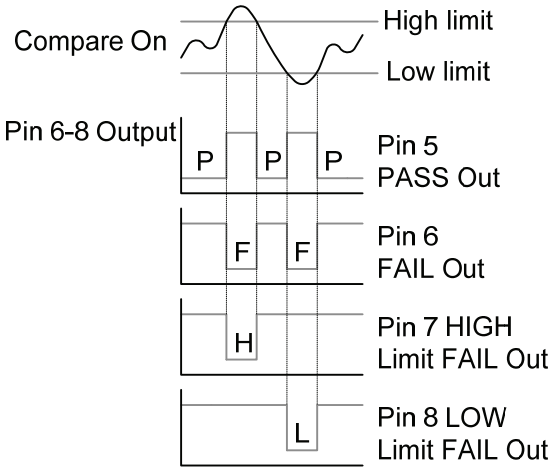	
Deactivate Compare measurement	To cancel the Compare measurement, press the Shift key followed by the Hold (Comp) key, or simply activate another measurement.	

Application: External trigger

Background

The GDM-8261 uses the internal trigger by default, for example to count the frequency and the period. Using an external trigger allows for customized triggering conditions.

Signal connection

Connect the external trigger signal to the Digital I/O port located on the rear panel.

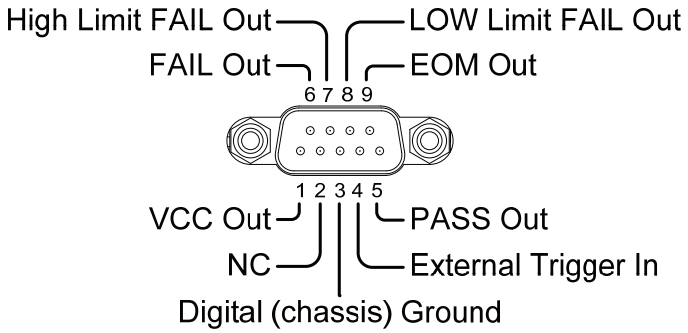

Pin4 External Trigger Input pin

Connection

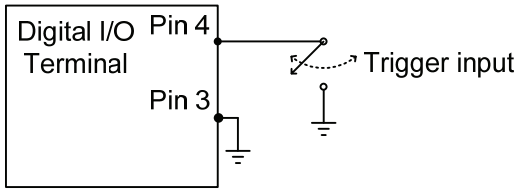

Pulse width timing

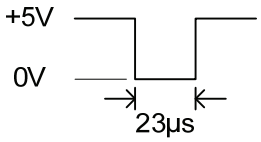

1. Activate external trigger

Press the Shift key followed by the Trig key. The EXT indicator appears on the display.



2. Start trigger	Press the Trig key to start triggering manually. The * indicator turns On.	
	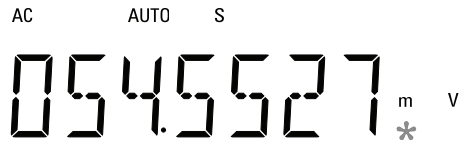	
Reading indicator	The reading indicator * stays On before triggering. After triggering, the indicator flashes according to the external signal trigger timing.	
Exit external trigger	Press the Shift key followed by the Trig key. The EXT indicator disappears and the trigger goes back to internal mode.	

REMOTE CONTROL

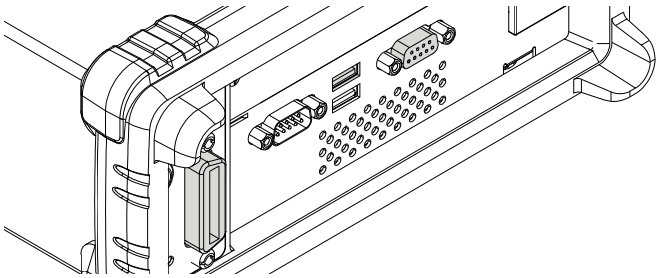

Interface	Overview	122
	Configure USB Interface	122
	Insert GPIB Card	123
	Configure GPIB Interface	124
	Configure RS-232C Interface	127
	Set the EOL Character	128
	Set the Separation Character	129
	Set the Return Format	130
Command Syntax	Command Syntax	132
Command Set	CONFigure Commands	141
	Secondary Display: CONFigure2 Commands	143
	Measure Commands	146
	SENSe Commands	149
	CALCulate Commands	162
	TRIGger Commands	165
	SYSTem Related Commands	168
	STATus Report Commands	170
	RS-232C Interface Commands	170
	IEEE 488.2 Common Commands	170
	ROUTe Commands	172

Configure Interface

Overview

Interface type	USB Device	USB 1.1 or 2.0, TypeA, female connector.
	RS-232C	D-sub 9 pin, male connector. Baud rate: 230400/115200/57600/38400/19200/9600.
	GPIB (optional)	24 Pin female GPIB port
Return to Local control mode	In order to switch back to the Local control mode (front panel operation), press the LOCAL key.	

Configure USB Interface

USB device port configuration

1. Press the Shift key, the 2nd (Menu) key, the left key repeatedly until the I/O configuration menu appears.

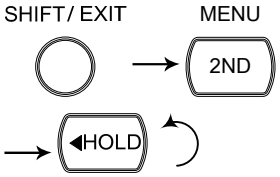

2. Press the Down key and the Right key. The USB selection display appears.



3. Press the Down key. The USB ON/OFF selection appears.

4. Press the Up/Down key to select ON or OFF.

5. Press the Enter key followed by the Exit key. The USB setting is stored and the display goes back to the default display.



6. Connect the USB cable to the rear panel terminal (upper port).

Insert GPIB Card

Power Off

Turn the Power Off and take out the power cord.

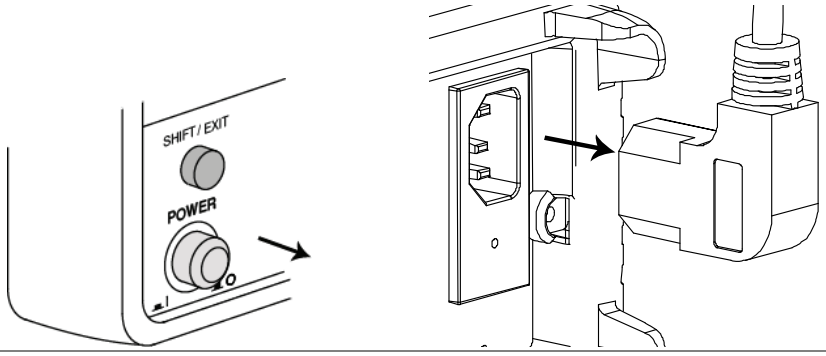

Open the GDM-8261 optional communication port

Take off the two screws on the slot corners to remove the optional communication port cover. Keep the screws for later reuse.

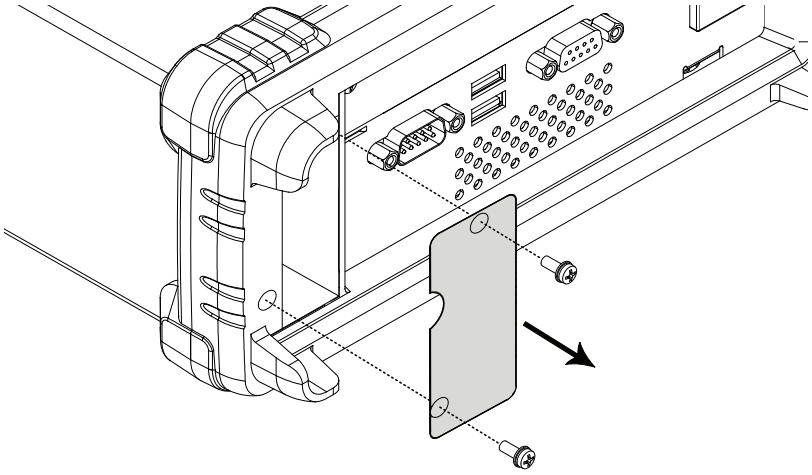

Insert the GPIB card

Insert the GPIB card into the slot. Close the cover by tightening the screws.

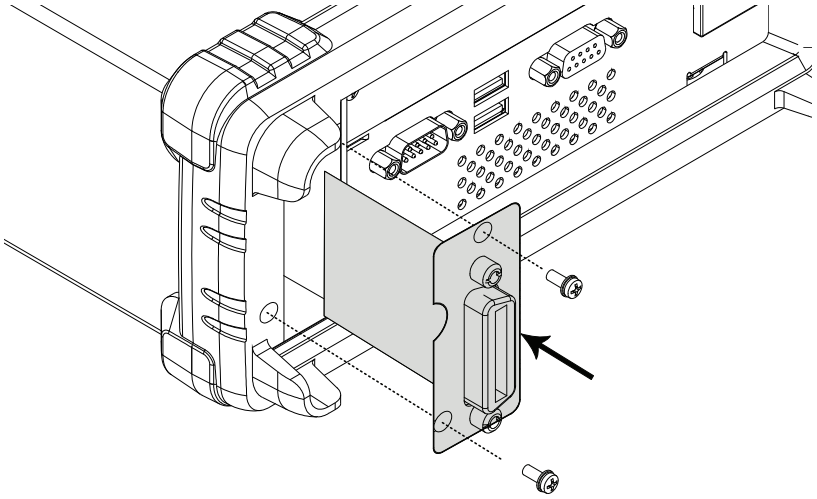

Power On

Connect the power cord and turn On the power.

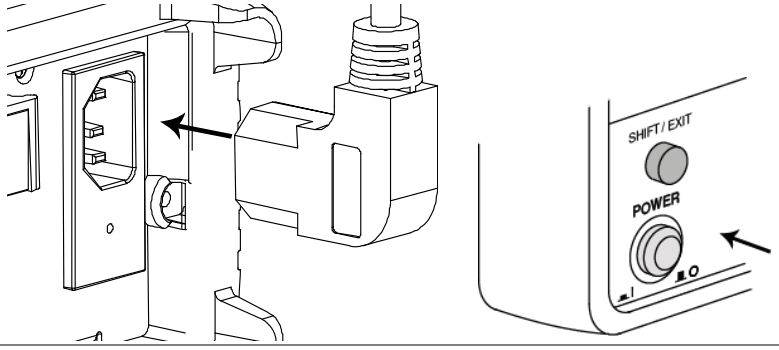

Configure GPIB Interface

GPIB port configuration

1. Press the Shift key, the 2nd (Menu) key, the left key repeatedly until the I/O configuration menu appears.

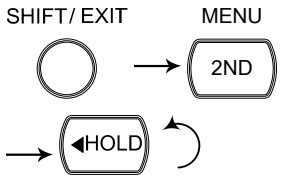

2. Press the Down key and the Left key. The GPIB selection display appears.



Note: The GPIB menu will be selectable only when the GPIB card is installed.

3. Press the Down key. The GPIB ON/OFF selection appears.

4. Press the Up/Down key to select ON or OFF.

5. To continue to the GPIB address configuration, press the Enter key. The GPIB address configuration menu appears.

1st display	Shows the GPIB address.
2nd display	Indicates GPIB address setting

6. Change the address using the Left/Right and Up/Down keys.

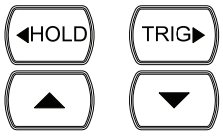

Range	0~30 (Default = 15)

7. Press the Enter key followed by the Exit key. The GPIB setting is stored and the display goes back to the default display.



8. Connect the GPIB cable to the rear panel optional communication port after the GPIB card has been installed (page 123).

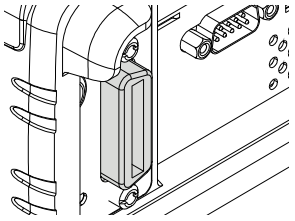

GPIB pin assignment

Pin	Signal	Pin	Signal
1	Data I/O 1	13	Data I/O 5
2	Data I/O 2	14	Data I/O 6
3	Data I/O 3	15	Data I/O 7
4	Data I/O 4	16	Data I/O 8
5	EOI	17	REN
6	DAV	18	Ground (DAV)
7	NRFD	19	Ground (NRFD)
8	NDAC	20	Ground (NDAC)
9	IFC	21	Ground (IFC)
10	SRQ	22	Ground (SRQ)
11	ATN	23	Ground (ATN)
12	SHIELD Ground	24	Single GND

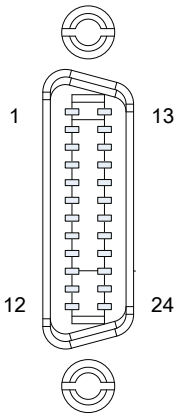

Configure RS-232C Interface

Configuration step

1. Press the Shift key, the 2nd (Menu) key, the left key repeatedly until the I/O configuration menu appears.

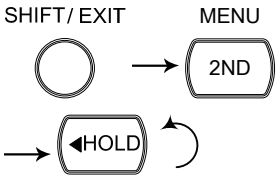

2. Press the Down key. The RS-232C selection display appears.

3. Press Enter or Down to confirm RS232 selection.



4. Press the Down or UP keys repeatedly to select the baud rate.

230400⇔115200⇔57600⇔38400⇔19200⇔9600

5. Press the Enter key followed by the Exit key. The RS-232 setting is stored and the display goes back to the default display.



6. Connect the RS-232C cable to the rear panel terminal.

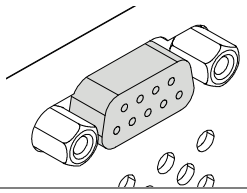

RS-232C pin assignment

Pin 2: RxD
Pin 3: TxD
Pin 5: GND
Pin 1, 4, 6 ~ 9: No Connection

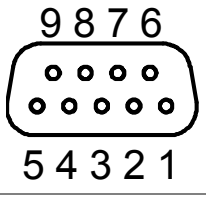

PC – GDM RS-232C Connection

A null-modem connection, in which transmit (TxD) and receive (RxD) lines are cross-linked, is required.

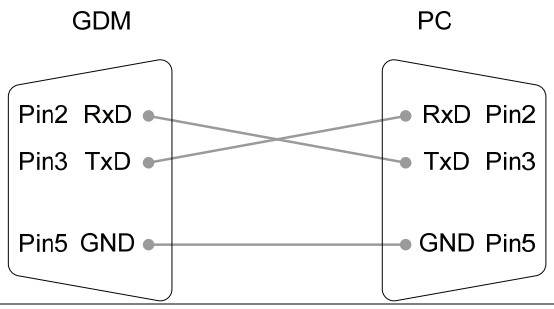

Set the EOL Character

Description

The TX TERM configuration menu can set the end-of-line (EOL) character for remote commands when used with USB and RS232. The GPIB EOL character is fixed as CR+LF.

EOL	CR, LF, CR+LF (default = CR+LF)

Configuration

1. Press the Shift key, the 2nd (Menu) key, the left key repeatedly until the TX TERM configuration menu appears.

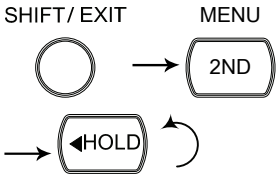

2. Press the Down key. The EOL menu appears.

3. Press the Down key. The EOL selection menu appears.

4. Press the Up/Down key to select the EOL character.



5. Press the Enter key followed by the Exit key. The EOL setting is stored and the display goes back to the default display.



Set the Separation Character

Description

The TX TERM configuration menu can set the separation character for remote commands.

Configuration

1. Press the Shift key, the 2nd (Menu) key, the left key repeatedly until the TX TERM configuration menu appears.

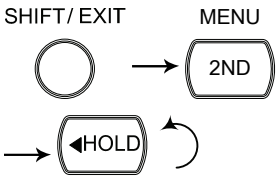

2. Press the Down key and then the Right key. The SEP selection display appears.



3. Press the Down key. The SEP selection menu appears.

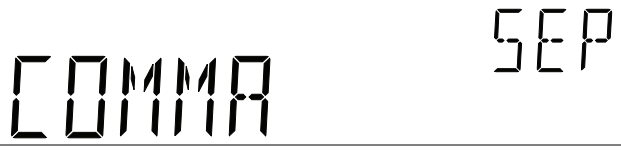

4. Press the Up/Down key to select the separation character.

EOL(CR+LF/LF/CR)⇔COMMA

5. Press the Enter key followed by the Exit key. The SEP setting is stored and the display goes back to the default display.



Set the Return Format

Description

When the VAL1?, VAL2?, TRACe:DATA? and FETCh? queries are used, the return measurement format can be configured in one of four ways: V (value), V+U (value, unit), V+C (value, count#), V+U+C (value, unit, count#). See page 165 and 166 for usage examples.

Note: The READ? query will not return values based on the return format settings, see page 165 for details.

Format	Description	Example
V	Value	+0.503E-4
V+U	Value, Unit	+0.503E-4, V DC
V+C	Value, Count#	+0.503E-4, +00001#
V+U+C	Value, Unit, Count#	+0.503E-4, V DC, +00001#

Configuration

1. Press the Shift key, the 2nd (Menu) key, the left key repeatedly until the TX TERM configuration menu appears.

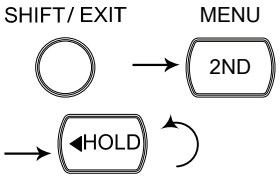

2. Press the Down key, the Right key. The FORMAT menu appears.



3. Press the Down key. The FORMAT selection menu appears.

FORMAT

1'

4. Press the Up/Down key to select the Return format.

1'⇔1'+U+C⇔1'+C⇔1'+U

5. Press the Enter key followed by the Exit key. The return format setting is saved and the display goes back to the default display.



Command Syntax

The commands are partially compatible with IEEE488.2 (1992) and SCPI (1994) standard. Commands are NON-case sensitive.

Example command	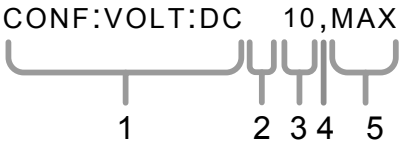	1: Command Header 2: Single space 3: Parameter 1 4: Comma (no space after comma) 5: Parameter 2
Parameter example	Boolean	Boolean logic: 0 or 1. Used for On (1) or Off (0) command.
	NR1	Integer: 0, 1, 2, 3.....
	NR2	Decimal number: 0.0, 0.1, 0.2,....
	NR3	Floating point number: 4.5e-1, 8.5e+1,...
	NRf	Any NR1,NR2 or NR3 value.
	MIN, MAX	The GDM-8261 automatically translates to the Minimum (min) or Maximum (max) value available.
	DEF	Default setting value.
Automatic parameter range selection	The GDM-8261 automatically translates the command parameter into the closest available value.	
	Example 1	CONF:VOLT:DC 1 (Sets the measurement item to DC Voltage and the range to 1V).
	Example 2	CONF:VOLT:DC 2 (Sets the measurement item to DC Voltage and the range to 2V). There is no 2V range so the GDM-8261 selects the closest range, 10V.
EOL	Marks the end of a command line. The following messages are in accordance with IEEE488.2 standard.	
	LF, CR,CR+LF	EOL, user configurable, see page 128.
Message Separator	EOL or ,	Command separator, user configurable (excluding GPIB), see page 129.

Square Brackets	[]	Square brackets denote function commands or parameters that can be omitted from the command or query. For example the query, [SENSe:]UNIT? can be expressed in 2 valid forms: [SENSe:]UNIT? or UNIT?

Command Set

CONFigure:VOLTage:DC 141
CONFigure:VOLTage:AC 141
CONFigure:CURRent:DC 141
CONFigure:CURRent:AC 141
CONFigure:RESistance 141
CONFigure:FRESistance 142
CONFigure:FREQuency 142
CONFigure:PERiod 142
CONFigure:CONTinuity 142
CONFigure:DIODe 142
CONFigure:TEMPerature:TCOuple 142
CONFigure:TEMPerature:FRTD 142
CONFigure:TEMPerature:RTD 143
CONFigure:FUNCtion? 143
CONFigure:RANGe? 143
CONFigure:AUTO 143
CONFigure:AUTO? 143
CONFigure2:VOLTage:DC 143
CONFigure2:VOLTage:AC 144
CONFigure2:CURRent:DC 144
CONFigure2:CURRent:AC 144
CONFigure2:RESistance 144
CONFigure2:FRESistance 144
CONFigure2:FREQuency 145
CONFigure2:PERiod 145
CONFigure2:OFF 145
CONFigure2:FUNCtion? 145
CONFigure2:RANGe? 145

CONFigure2:AUTO 145
CONFigure2:AUTO? 145
MEASure:VOLTage:DC? 146
MEASure:VOLTage:AC? 146
MEASure:CURRent:DC? 146
MEASure:CURRent:AC? 146
MEASure:RESistance? 146
MEASure:FRESistance? 147
MEASure:FREQuency? 147
MEASure:PERiod? 147
MEASure:CONTinuity? 147
MEASure:DIODe? 147
MEASure:TEMPerature:TCOuple? 147
MEASure:TEMPerature:FRTD? 148
MEASure:TEMPerature:RTD? 148
MEASure2:VOLTage:DC? 148
MEASure2:VOLTage:AC? 148
MEASure2:CURRent:DC? 148
MEASure2:CURRent:AC? 148
MEASure2:RESistance? 149
MEASure2:FRESistance? 149
MEASure2:FREQuency? 149
MEASure2:PERiod? 149
[SENSe:]TEMPerature:TCOuple:TYPE 149
[SENSe:]TEMPerature:TCOuple:TYPE? 149
[SENSe:]TEMPerature:RJUNction:SIMulated 150
[SENSe:]TEMPerature:RJUNction:SIMulated? 150
[SENSe:]TEMPerature:RTD:TYPE 150
[SENSe:]TEMPerature:RTD:TYPE? 150
[SENSe:]TEMPerature:RTD:ALPHa 150
[SENSe:]TEMPerature:RTD:ALPHa? 150
[SENSe:]TEMPerature:RTD:BETA 150
[SENSe:]TEMPerature:RTD:BETA? 150
[SENSe:]TEMPerature:RTD:DELTa 150
[SENSe:]TEMPerature:RTD:DELTa? 150
[SENSe:]TEMPerature:FRTD:TYPE 151
[SENSe:]TEMPerature:FRTD:TYPE? 151
[SENSe:]TEMPerature:FRTD:ALPHa 151

[SENSe:]TEMPerature:FRTD:ALPHa? 151
[SENSe:]TEMPerature:FRTD:BETA 151
[SENSe:]TEMPerature:FRTD:BETA? 151
[SENSe:]TEMPerature:FRTD:DELTa 151
[SENSe:]TEMPerature:FRTD:DELTa? 151
[SENSe:]DETector:RATE 151
[SENSe:]DETector:RATE? 151
[SENSe:]AVERage:TCONtrol 152
[SENSe:]AVERage:TCONtrol? 152
[SENSe:]AVERage:COUNt 152
[SENSe:]AVERage:COUNt? 152
[SENSe:]AVERage:STATe 152
[SENSe:]AVERage:STATe? 152
[SENSe:]FREQuency:APERture 152
[SENSe:]FREQuency:APERture? 152
[SENSe:]PERiod:APERture 152
[SENSe:]PERiod:APERture? 153
[SENSe:]FREQuency:INPutjack 153
[SENSe:]FREQuency:INPutjack? 153
[SENSe:]PERiod:INPutjack 153
[SENSe:]PERiod:INPutjack? 153
[SENSe:]DETector:BANDwidth 153
[SENSe:]DETector:BANDwidth? 153
[SENSe:]ZERO:AUTO 153
[SENSe:]ZERO:AUTO? 153
[SENSe:]GAIN:AUTO 153
[SENSe:]GAIN:AUTO? 154
[SENSe:]CONTinuity:THReshold 154
[SENSe:]CONTinuity:THReshold? 154
[SENSe:]CURRent:DETect 154
[SENSe:]CURRent:DETect? 154
[SENSe:]DIGital:SHIFt 154
[SENSe:]DIGital:SHIFt? 154
[SENSe:]UNIT 154
[SENSe:]UNIT? 154
[SENSe:]FUNCtion[1/2]? 154
[SENSe:]FUNCtion[1/2] 155
[SENSe:]VOLTage:DC:RANGe 155

[SENSe:]VOLTage:DC:RANGe? 155
[SENSe:]VOLTage:AC:RANGe 155
[SENSe:]VOLTage:AC:RANGe? 155
[SENSe:]CURRent:DC:RANGe 155
[SENSe:]CURRent:DC:RANGe? 155
[SENSe:]CURRent:AC:RANGe 155
[SENSe:]CURRent:AC:RANGe? 155
[SENSe:]RESistance:RANGe 156
[SENSe:]RESistance:RANGe? 156
[SENSe:]FRESistance:RANGe 156
[SENSe:]FRESistance:RANGe? 156
[SENSe:]FREQuency:VOLTage:RANGe 156
[SENSe:]FREQuency:VOLTage:RANGe? 156
[SENSe:]PERiod:VOLTage:RANGe 156
[SENSe:]PERiod:VOLTage:RANGe? 156
[SENSe:]VOLTage:DC:RANGe:AUTO 156
[SENSe:]VOLTage:DC:RANGe:AUTO? 157
[SENSe:]VOLTage:AC:RANGe:AUTO 157
[SENSe:]VOLTage:AC:RANGe:AUTO? 157
[SENSe:]CURRent:DC:RANGe:AUTO 157
[SENSe:]CURRent:DC:RANGe:AUTO? 157
[SENSe:]CURRent:AC:RANGe:AUTO 157
[SENSe:]CURRent:AC:RANGe:AUTO? 157
[SENSe:]RESistance:RANGe:AUTO 157
[SENSe:]RESistance:RANGe:AUTO? 157
[SENSe:]FRESistance:RANGe:AUTO 158
[SENSe:]FRESistance:RANGe:AUTO? 158
[SENSe:]FREQuency:VOLTage:RANGe:AUTO 158
[SENSe:]FREQuency:VOLTage:RANGe:AUTO? 158
[SENSe:]PERiod:VOLTage:RANGe:AUTO 158
[SENSe:]PERiod:VOLTage:RANGe:AUTO? 158
[SENSe:]VOLTage:DC:RESolution 158
[SENSe:]VOLTage:DC:RESolution? 158
[SENSe:]VOLTage:AC:RESolution 158
[SENSe:]VOLTage:AC:RESolution? 159
[SENSe:]CURRent:DC:RESolution 159
[SENSe:]CURRent:DC:RESolution? 159
[SENSe:]CURRent:AC:RESolution 159

[SENSe:]CURRent:AC:RESolution? 159
[SENSe:]RESistance:RESolution 159
[SENSe:]RESistance:RESolution? 159
[SENSe:]FRESistance:RESolution 159
[SENSe:]FRESistance:RESolution? 159
[SENSe:]CONTinuity:RESolution 160
[SENSe:]CONTinuity:RESolution? 160
[SENSe:]DIODe:RESolution 160
[SENSe:]DIODe:RESolution? 160
[SENSe:]TEMPerature:TCOuple:RESolution 160
[SENSe:]TEMPerature:TCOuple:RESolution? 160
[SENSe:]TEMPerature:FRTD:RESolution 160
[SENSe:]TEMPerature:FRTD:RESolution? 160
[SENSe:]TEMPerature:RTD:RESolution 161
[SENSe:]TEMPerature:RTD:RESolution? 161
[SENSe:]VOLTage:DC:NPLCycles 161
[SENSe:]VOLTage:DC:NPLCycles? 161
[SENSe:]CURRent:DC:NPLCycles 161
[SENSe:]CURRent:DC:NPLCycles? 161
[SENSe:]RESistance:NPLCycles 161
[SENSe:]RESistance:NPLCycles? 162
[SENSe:]FRESistance:NPLCycles 162
[SENSe:]FRESistance:NPLCycles? 162
CALCulate:FUNCtion 162
CALCulate:FUNCtion? 162
CALCulate:STATe 162
CALCulate:STATe? 162
CALCulate:MINimun? 162
CALCulate:MAXimun? 162
CALCulate:HOLD:REFerence 163
CALCulate:HOLD:REFerence? 163
CALCulate:REL:REFerence 163
CALCulate:REL:REFerence? 163
CALCulate:LIMit:LOWer 163
CALCulate:LIMit:LOWer? 163
CALCulate:LIMit:UPPer 163
CALCulate:LIMit:UPPer? 163
CALCulate:DB:REFerence 163

CALCulate:DB:REFerence? 163
CALCulate:DBM:REFerence 164
CALCulate:DBM:REFerence? 164
CALCulate:STORe:COUNt 164
CALCulate:STORe:COUNt? 164
CALCulate:AVERage:COUNt? 164
CALCulate:AVERage:MINimum? 164
CALCulate:AVERage:MAXimum? 164
CALCulate:AVERage:AVERage? 164
CALCulate:AVERage:PTPeak? 164
CALCulate:AVERage:SDEViation? 164
CALCulate:MATH:MMFactor 165
CALCulate:MATH:MMFactor? 165
CALCulate:MATH:MBFactor 165
CALCulate:MATH:MBFactor? 165
CALCulate:MATH:PERCent 165
CALCulate:MATH:PERCent? 165
READ? 165
VAL1? 165
VAL2? 166
TRIGger:SOURce 166
TRIGger:SOURce? 166
TRIGger:DELay 166
TRIGger:DELay? 166
TRIGger:AUTO 166
TRIGger:AUTO? 166
SAMPle:COUNt 166
SAMPle:COUNt? 167
TRIGger:COUNt 167
TRIGger:COUNt? 167
TRACe:DATA? 167
TRACe:CLEar 167
SYSTem:BEEPer:STATe 168
SYSTem:BEEPer:STATe? 168
SYSTem:BEEPer:ERRor 168
SYSTem:BEEPer:ERRor? 168
SYSTem:ERRor? 168
SYSTem:VERSion? 168

SYSTem:DISPlay 168
SYSTem:DISPlay? 168
SYSTem:OUTPut:FORMat 168
SYSTem:OUTPut:FORMat? 169
SYSTem:OUTPut:EOF 169
SYSTem:OUTPut:EOF? 169
SYSTem:OUTPut:SEParate 169
SYSTem:OUTPut:SEParate? 169
SYSTem:SERial? 169
SYSTem:PARameter:SAVE 169
SYSTem:PARameter:LOAD 169
SYSTem:PARameter:LOAD? 169
STATus:QUEStionable:ENABle 170
STATus:QUEStionable:ENABle? 170
STATus:QUEStionable:EVENt? 170
STATus:PRESet 170
SYSTem:LOCal 170
SYSTem:REMote 170
*CLS 170
*ESE? 170
*ESE 170
*ESR? 171
*IDN? 171
*OPC? 171
*OPC 171
*PSC? 171
*PSC 171
*RST 171
*SRE? 171
*SRE 171
*STB? 171
*TRG 171
ROUTe:CLOSe 172
ROUTe:OPEN:ALL 172
ROUTe:MULTiple:OPEN 172
ROUTe:MULTiple:STATe? 172
ROUTe:MULTiple:CLOSe 172
ROUTe:FUNCtion 172

ROUTe:FUNCtion? 172
ROUTe:CHANnel 173
ROUTe:CHANnel? 173
ROUTe:COUNt 173
ROUTe:COUNt? 173
ROUTe:DELay 173
ROUTe:DELay? 173
ROUTe:STATe? 173
ROUTe:ADVance 174
ROUTe:ADVance? 174
ROUTe:SCAN:COUNt? 174
ROUTe:SCAN:FINal 174
ROUTe:SCAN:FINal? 174
ROUTe:SCAN:BOX 174
ROUTe:SCAN:BOX? 174
INPut:IMPedance:AUTO 174
INPut:IMPedance:AUTO? 174
INITiate 174
FETCh? 175
DATA:POINts? 175

CONFigure Commands

CONFigure:VOLTage:DC

Sets measurement to DC Voltage on the first display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: CONF:VOLT:DC 1,MAX
Sets the voltage range to 1 volt and the resolution to the maximum.

CONFigure:VOLTage:AC

Sets measurement to AC Voltage on the first display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF:VOLT:AC
Sets the AC voltage range and resolution to auto range.

CONFigure:CURRent:DC

Sets measurement to DC Current on the first display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF:CURR:DC 10e-3,DEF
Sets the DC current to 10mA using the default resolution.

CONFigure:CURRent:AC

Sets measurement to AC Current on the first display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: CONF:CURR:AC 10e-2,MAX
Sets the measurement mode to ACI with a 100mA range at the maximum resolution.

CONFigure:RESistance

Sets measurement to 2W Resistance on the first display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: CONF:RES 10e3,MIN
Sets the range to 10kΩ with the lowest resolution.

CONFigure:FRESistance

Sets measurement to 4W Resistance on the first display and specifies the range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF:FRES 10e3,MAX
Sets the measurement mode to 4W with a range of 10kΩ at the maximum resolution.

CONFigure:FREQuency

Sets measurement to Frequency on the first display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF:FREQ MAX,MAX
Sets the frequency measurement range to max and the resolution to max.

CONFigure:PERiod

Sets measurement to Period on the first display and specifies the range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF:PER
Sets the DMM to period measurement using the previous range/resolution.

CONFigure:CONTinuity

Sets measurement to Continuity on the first display.
Parameter: None

CONFigure:DIODe

Sets measurement to Diode on the first display.
Parameter: None

CONFigure:TEMPerature:TCOuple

Sets measurement to Temperature thermocouple (T-CUP) on the first display.
Parameter: [None] | [Type(B | E | J | K | N | R | S | T)]
Example: CONF:TEMP:TCO J
Sets the measurement mode to TCO with a type J sensor.

CONFigure:TEMPerature:FRTD

Sets the measurement mode to 4W RTD measurement mode on the first display. Sets the sensor type.
Parameter: [None] | [Type(PT100 | D100 | F100 | PT385 | PT3916 | USER)]
Example: CONF:TEMP:FRTD PT100
Sets the sensor type to PT100 and sets the measurement mode to 4W RTD

CONFigure:TEMPerature:RTD

Sets the measurement mode to 2W RTD measurement mode on the first display. Sets the sensor type.
Parameter: [None] | [Type(PT100 | D100 | F100 | PT385 | PT3916 | USER)]
Example: CONF:TEMP:RTD PT100
Sets the sensor type to PT100 and sets the measurement mode to 2W RTD

CONFigure:FUNCtion?

Returns the current function on 1st display.
Return parameter: VOLT, VOLT:AC, CURR, CURR:AC, RES, FRES, FREQ, PER, TEMP:RTD, TEMP:TCO, DIOD, CONT

CONFigure:RANGe?

Returns the current range on 1st display.
Return Parameter:
DCV: 0 .1(100mV), 1(1V), 10(10V), 100(100V), 1000(1000V)
ACV: 0.1(100mV), 1(1V), 10(10V), 100(100V), 750(750V)
ACI: 0.001 (1mA), 0.01(10mA), 0.1(100mA), 1(1A), 10(10A)
DCI: 0.0001 (100μA), 0.001 (1mA), 0.01(10mA), 0.1(100mA), 1(1A), 10(10A)
RES: 10E+1(100Ω) 10E+2(1kΩ), 10E+3(10kΩ), 10E+4 (100kΩ), 10E+5(1MΩ), 10E+6(10MΩ), 10E+7(100MΩ)

CONFigure:AUTO

Sets Auto-Range on or off on the first display.
Parameter: ON | OFF
Example: CONF:AUTO ON

CONFigure:AUTO?

Returns the Auto-Range status of the function on the 1st display.
Return Parameter: 0|1, 1=Auto range, 0=Manual range

Secondary Display: CONFigure2 Commands

CONFigure2:VOLTage:DC

Sets measurement to DC Voltage on the second display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF2:VOLT:DC 1,MAX
Sets the voltage range to 1 volt and the resolution to the maximum.

CONFigure2:VOLTage:AC

Sets measurement to AC Voltage on the second display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF2:VOLT:AC
Sets the measurement mode to AC voltage.

CONFigure2:CURRent:DC

Sets measurement to DC Current on the second display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF2:CURR:DC 10e-3,DEF
Sets the DC current to 10mA using the default resolution on the second display.

CONFigure2:CURRent:AC

Sets measurement to AC Current on the second display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF2:CURR:AC 10e-2,MAX
Sets the measurement mode to ACI with a 100mA range at the maximum resolution.

CONFigure2:RESistance

Sets measurement to 2W Resistance on the second display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF2:RES 10e3,MIN
Sets the range to 10kΩ with the lowest resolution.

CONFigure2:FRESistance

Sets measurement to 4W Resistance on the second display and specifies the range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF2:FRES 10e3,MAX
Sets the measurement mode to 4W with a range of 10kΩ at the maximum resolution.

CONFigure2:FREQuency

Sets measurement to Frequency on the second display and specifies range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF2:FREQ MAX,MAX
Sets the frequency measurement range to max and the resolution to max.

CONFigure2:PERiod

Sets measurement to Period on the second display and specifies the range/resolution.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf> | MIN | MAX | DEF)]
Example: CONF2:PER
Sets the DMM to period measurement using the previous range/resolution.

CONFigure2:OFF

Turns the second display function off.
Parameter: None.

CONFigure2:FUNCtion?

Returns the current function on the second display.
Return parameter: VOLT, VOLT:AC, CURR, CURR:AC, RES, FRES, FREQ, PER, TEMP:RTD, TEMP:TCO, DIOD, CONT, NON

CONFigure2:RANGe?

Returns the range of the current function on the second display.
Return parameter:
DCV: 0 .1(100mV), 1(1V), 10(10V), 100(100V), 1000(1000V)
ACV: 0.1(100mV), 1(1V), 10(10V), 100(100V), 750(750V)
ACI: 0.001 (1mA), 0.01(10mA), 0.1(100mA), 1(1A), 10(10A)
DCI: 0.001 (1mA), 0.01(10mA), 0.1(100mA), 1(1A), 10(10A)
RES: 10E+1(100Ω) 10E+2(1kΩ), 10E+3(10kΩ), 10E+4 (100kΩ), 10E+5(1MΩ), 10E+6(10MΩ), 10E+7(100MΩ)

CONFigure2:AUTO

Sets Auto-Range on or off on the 2nd display.
Parameter: ON | OFF
Example: CONF2:AUTO ON

CONFigure2:AUTO?

Returns the Auto-Range status of the function on the 2nd display.
Return Parameter: 0|1, 1=Auto range, 0=Manual range

Measure Commands

MEASure:VOLTage:DC?

Returns the DC voltage measurement on the first display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS:VOLT:DC ?
>+0.488E-4
Returns the DC voltage measurement as 0.0488 mV.

MEASure:VOLTage:AC?

Returns the AC voltage measurement on the first display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS:VOLT:AC ?
>+0.511E-3
Returns the AC voltage measurement as 0.511 mV.

MEASure:CURRent:DC?

Returns the DC current measurement on the first display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS:CURR:DC ?
>+0.234E-4
Returns the DC current measurement as 0.0234 mA.

MEASure:CURRent:AC?

Returns the AC voltage measurement on the first display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS:CURR:AC ?
> +0.387E-2
Returns the AC current measurement.

MEASure:RESistance?

Returns the 2W resistance measurement on the first display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS:RES?
> +1.181372E+6
Returns the 2W measurement.

MEASure:FRESistance?

Returns the 4W resistance measurement on the first display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS:FRES?
> +1.181372E+6
Returns the 4W measurement.

MEASure:FREQuency?

Returns the frequency measurement on the first display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS:FREQ?
> +0.215029E+5
Returns the frequency (21.5 kHz).

MEASure:PERiod?

Returns the period measurement on the first display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS:PER? MAX
Returns the maximum period.

MEASure:CONTinuity?

Returns the continuity measurement on the first display.
Example: MEAS:CONT?
Returns the continuity.

MEASure:DIODe?

Returns the diode measurement on the first display.
Example: MEAS:DIOD?
Returns the diode measurement.

MEASure:TEMPerature:TCOuple?

Returns the temperature for the selected thermocouple type on the first display.
Parameter:[NONE] | B | E | J | K | N | S | T
Example: MEAS:TEMP:TCO? J
> +0.26348E+2
Returns the temperature.

MEASure:TEMPerature:FRTD?

Returns the 4W RTD temperature for the selected sensor type on the first display.
Parameter:[NONE] | PT100 | D100 | F100 | PT385 | PT3916 | USER
Example: MEAS:TEMP:FRTD? PT100
> +0.20050E+5
Returns the temperature.

MEASure:TEMPerature:RTD?

Returns the 2W RTD temperature for the selected sensor type on the first display.
Parameter:[NONE] | PT100 | D100 | F100 | PT385 | PT3916 | USER
Example: MEAS:TEMP:RTD? PT100
> +0.20050E+5
Returns the temperature.

MEASure2:VOLTage:DC?

Returns the DC voltage measurement on the second display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS2:VOLT:DC ?
>+0.488E-4
Returns the DC voltage measurement as 0.0488 mV.

MEASure2:VOLTage:AC?

Returns the AC voltage measurement on the second display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS2:VOLT:AC ?
>+0.511E-3
Returns the AC voltage measurement as 0.511 mV.

MEASure2:CURRent:DC?

Returns the DC current measurement on the second display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS2:CURR:DC ?
>+0.234E-4
Returns the DC current measurement as 0.0234 mA.

MEASure2:CURRent:AC?

Returns the AC current measurement on the second display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS2:CURR:AC ?
> +0.387E-2
Returns the AC current measurement.

MEASure2:RESistance?

Returns the 2W resistance measurement on the second display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS2:RES?
> +1.181372E+6
Returns the 2W measurement.

MEASure2:FRESistance?

Returns the 4W resistance measurement on the second display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS2:FRES?
> +1.181372E+6
Returns the 4W measurement.

MEASure2:FREQuency?

Returns the frequency measurement on the second display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS2:FREQ?
> +0.215029E+5
Returns the frequency (21.5 kHz).

MEASure2:PERiod?

Returns the period measurement on the second display.
Parameter: [None] | [Range(<NRf> | MIN | MAX | DEF),Resolution(<NRf>| MIN | MAX | DEF)]
Example: MEAS2:PER? MAX
Returns the maximum period.

SENSe Commands

[SENSe:]TEMPerature:TCOuple:TYPE

Sets thermocouple type.
Parameter: Type(B | E | J | K | N | R | S | T)
Example: SENS:TEMP:TCO:TYPE J
Sets the thermocouple to type J.

[SENSe:]TEMPerature:TCOuple:TYPE?

Returns the thermocouple type.
Return parameter: B, E, J, K, N, R, S, T

[SENSe:]TEMPerature:RJUNction:SIMulated
Set temperature simulation value.
Parameter: <NRf>(0.00 ~ 50.00)
Example: SENS:TEMP:RJUN:SIM 25.00
Sets the thermocouple junction temperature to 25˚C.

[SENSe:]TEMPerature:RJUNction:SIMulated?
Returns temperature simulation value.
Return parameter: <NR1> (+0000~+5000) ,where +0000=0.00˚C, +5000=50.00˚C

[SENSe:]TEMPerature:RTD:TYPE
Sets the 2W RTD sensor type.
Return parameter: Type(PT100 | D100 | F100 | PT385 | PT3916 | USER)
Example: SENS:TEMP:RTD:TYPE PT100
Sets the 2W RTD sensor to PT100

[SENSe:]TEMPerature:RTD:TYPE?
Returns the 2W RTD sensor type.
Return parameter: PT100, D100, F100, PT385, PT3916, USER

[SENSe:]TEMPerature:RTD:ALPHa
Sets the 2W RTD Alpha coefficient.
Parameter: <NRf> (0~10)
Example: SENS:TEMP:RTD:ALPH 0.00385

[SENSe:]TEMPerature:RTD:ALPHa?
Returns the 2W RTD Alpha coefficient.

[SENSe:]TEMPerature:RTD:BETA
Sets the 2W RTD BETA coefficient.
Parameter: <NRf> (0~10)
Example: SENS:TEMP:RTD:BETA 0.00495

[SENSe:]TEMPerature:RTD:BETA?
Returns the 2W RTD BETA coefficient.

[SENSe:]TEMPerature:RTD:DELTa
Sets the 2W RTD DELTa coefficient.
Parameter: <NRf> (0~10)
Example: SENS:TEMP:RTD:DELT 0.0000568

[SENSe:]TEMPerature:RTD:DELTa?
Returns the 2W RTD DELTa coefficient.

[SENSe:]TEMPerature:FRTD:TYPE
Sets the 4W RTD sensor type.
Parameter: Type(PT100 | D100 | F100 | PT385 | PT3916 | USER)
Example: SENS:TEMP:FRTD:TYPE PT100
Sets the 4W RTD sensor to PT100

[SENSe:]TEMPerature:FRTD:TYPE?
Returns the 4W RTD sensor type.
Return parameter: PT100, D100, F100, PT385, PT3916, USER

[SENSe:]TEMPerature:FRTD:ALPHa
Sets the 4W RTD Alpha coefficient.
Parameter: <NRf> (0~10)
Example: SENS:TEMP:FRTD:ALPH 0.00385

[SENSe:]TEMPerature:FRTD:ALPHa?
Returns the 4W RTD Alpha coefficient.

[SENSe:]TEMPerature:FRTD:BETA
Sets the 4W RTD BETA coefficient.
Parameter: <NRf> (0~10)
Example: SENS:TEMP:FRTD:BETA 0.00495

[SENSe:]TEMPerature:FRTD:BETA?
Returns the 4W RTD BETA coefficient.

[SENSe:]TEMPerature:FRTD:DELTa
Sets the 4W RTD DELTa coefficient.
Parameter: <NRf> (0~10)
Example: SENS:TEMP:FRTD:DELT 0.0000568

[SENSe:]TEMPerature:FRTD:DELTa?
Returns the 4W RTD DELTa coefficient.

[SENSe:]DETector:RATE
Sets the detection rate (sample rate)
Parameter: RATE(S | M | F)
Example: SENS:DET:RATE S
Sets the rate to slow (S).

[SENSe:]DETector:RATE?
Returns the sample rate.
Return parameter: SLOW, MID, FAST

[SENSe:]AVERage:TCONtrol

Selects the digital filter.
Parameter: MOV | REP
Example: SENS:AVER:TCON MOV
Sets the digital filter to the Moving filter.

[SENSe:]AVERage:TCONtrol?

Returns the current digital filter type.
Return parameter: MOV (moving), REP (repeating)

[SENSe:]AVERage:COUNt

Sets the digital filter count.
Parameter: <NR1> (2 ~ 100) | MIN | MAX
Example: SENS:AVER:COUN 100
Sets the digital filter count number to 100.

[SENSe:]AVERage:COUNt?

Returns the digital filter count.
Return parameter: <NR1> (+002~+100)

[SENSe:]AVERage:STATe

Turns the digital filter On/Off.
Parameter: ON | OFF
Example: SENS:AVER:STAT ON
Turns the digital filter on.

[SENSe:]AVERage:STATe?

Returns the state of the digital filter (on or off).
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]FREQuency:APERture

Sets the aperture time (gate time) for the frequency function (0.01=F, 0.1=M, 1=S).
Parameter: (0.01 | 0.1 | 1)
Example: SENS:FREQ:APER 0.01
Sets the gate time to 0.01 seconds.

[SENSe:]FREQuency:APERture?

Returns aperture time (gate time) for the frequency function.

[SENSe:]PERiod:APERture

Sets the aperture time (gate time) for the period function(0.01=F, 0.1=M, 1=S).
Parameter: <NRf>(0.01 | 0.1 | 1)
Example: SENS:PER:APER 0.1
Sets the gate time to 0.1 seconds for the period function.

[SENSe:]PERiod:APERture?
Returns the aperture time (gate time) for the period function.

[SENSe:]FREQuency:INPutjack
Assigns an input port for the frequency function.
Parameter: (0|1|2) 0=volt, 1=1A, 2=10A
Example: SENS:FREQ:INP 0
Sets the input jack to the Volt input port.

[SENSe:]FREQuency:INPutjack?
Returns the assigned input port used for the frequency function.
Return Parameter: VOLT, 1A, 10A

[SENSe:]PERiod:INPutjack
Assigns an input port for the period function.
Parameter: (0|1|2) 0=volt, 1=1A, 2=10A
Example: SENS:PER:INP 0
Sets the input jack to the Volt input port.

[SENSe:]PERiod:INPutjack?
Returns the assigned input port used for the period function.
Return Parameter: VOLT, 1A, 10A

[SENSe:]DETector:BANDwidth
Sets the AC bandwidth (AC filter).
Parameter: (3 | 20 | 200)
Example: SENS:DET:BAND 20
Sets the AC bandwidth to 20Hz.

[SENSe:]DETector:BANDwidth?
Returns the AC bandwidth.

[SENSe:]ZERO:AUTO
Sets the Auto zeroing mode to on, off or once only.
Parameter: ON | OFF | ONCE
Example: SENS:ZERO:AUTO ONCE
Sets the auto zeroing to once only.

[SENSe:]ZERO:AUTO?
Returns the Auto zero mode.
Return Parameter: 0|1, 1=ON, 0=OFF

[SENSe:]GAIN:AUTO
Sets the Auto gain mode to on, off or once only.
Parameter: ON | OFF | ONCE
Example: SENS:GAIN:AUTO OFF
Turns the Auto gain mode off.

[SENSe:]GAIN:AUTO?

Returns the Auto gain mode.
Return parameter: 0|1, 1=ON, 0=OFF

[SENSe:]CONTinuity:THReshold

Sets the continuity threshold in ohms.
Parameter: <NRf> (0 ~ 1000)
Example: SENS:CONT:THR 500
Sets the continuity threshold to 500

[SENSe:]CONTinuity:THReshold?

Returns the continuity threshold.

[SENSe:]CURRent:DETect

Sets the current auto-detect mode on or off for the current functions.
Parameter: ON | OFF
Example: SENS:CURR:DET ON
Turns the current auto-detect on for the current function.

[SENSe:]CURRent:DETect?

Returns the auto-detect status for the current functions.
Return Parameter: 0|1 1=ON, 0=OFF

[SENSe:]DIGital:SHIFt

Sets the Digital Shift function on or off.
Parameter: ON | OFF
Example: SENS:DIG:SHIF ON
Turn the digital shift function on.

[SENSe:]DIGital:SHIFt?

Returns the Digital Shift function status.
Return Parameter: 0|1 1=ON, 0=OFF

[SENSe:]UNIT

Sets the temperature unit.
Parameter: C|F
Example: SENS:UNIT C
Sets the temperature unit to ˚C.

[SENSe:]UNIT?

Returns the temperature unit.

[SENSe:]FUNCtion[1/2]?

Returns the function displayed on the first or second display.
Return parameter(display 1): VOLT, VOLT:AC, CURR, CURR:AC, RES, FRES, FREQ, PER, TEMP:RTD, TEMP:TCO, DIOD, CONT, NON (2nd display only)

[SENSe:]FUNCtion[1/2]

Sets the function for the first or second display.
Parameter: “VOLT[:DC]”, “VOLT:AC”, “CURR[:DC]”, “CURR:AC”, “RES”, “FRES”, “FREQ”, ‘PER”, “TEMP:RTD”, “TEMP:TCO”, “DIOD”, “CONT”, “NON” (2nd display only)
Example: SENS:FUNC1 “VOLT:DC”
Sets the 1st display to the VDC function.

[SENSe:]VOLTage:DC:RANGe

Sets the DC Voltage measurement range.
Parameter: (<NRf> | MIN | MAX)
Example: SENS:VOLT:DC:RANG MIN
Set the DC voltage range to lowest range allowed.

[SENSe:]VOLTage:DC:RANGe?

Returns the DC Voltage measurement range.
Parameter: [None] | [MIN | MAX]

[SENSe:]VOLTage:AC:RANGe

Sets the AC Voltage measurement range.
Parameter: (<NRf> | MIN | MAX)
Example: SENS:VOLT:AC:RANG MIN
Set the AC voltage range to lowest range allowed.

[SENSe:]VOLTage:AC:RANGe?

Returns the AC Voltage measurement range.
Parameter: [None] | [MIN | MAX]

[SENSe:]CURRent:DC:RANGe

Sets the DC Current measurement range.
Parameter: Range(<NRf> | MIN | MAX)
Example: SENS:CURR:DC:RANG 10 e-2
Sets the DC current range to 100mA.

[SENSe:]CURRent:DC:RANGe?

Returns the DC Current measurement range.
Parameter: [None] | [MIN | MAX]

[SENSe:]CURRent:AC:RANGe

Sets the AC Current measurement range.
Parameter: Range(<NRf> | MIN | MAX)
Example: SENS:CURR:AC:RANG 10 e-2
Sets the AC current range to 100mA.

[SENSe:]CURRent:AC:RANGe?

Returns the AC Current measurement range.
Parameter: [None] | [MIN | MAX]

[SENSe:]RESistance:RANGe
Sets the 2W resistance measurement range.
Parameter: Range(<NRf> | MIN | MAX)
Example: SENS:RES:RANG 1000
Sets the resistance range to 1kΩ.

[SENSe:]RESistance:RANGe?
Returns the 2W resistance measurement range.
Parameter: [None] | [MIN | MAX]

[SENSe:]FRESistance:RANGe
Sets the 4W resistance measurement range.
Parameter: Range(<NRf> MIN | MAX)
Example: SENS:FRES:RANG 1000
Sets the 4W resistance range to 1kΩ.

[SENSe:]FRESistance:RANGe?
Returns the 4W resistance measurement range.
Parameter: [None] | [MIN | MAX]

[SENSe:]FREQuency:VOLTage:RANGe
Sets the frequency measurement range.
Parameter: Range(<NRf> MIN | MAX)
Example: SENS:FREQ:VOLT:RANG MIN
Sets the frequency to the minimum frequency range.

[SENSe:]FREQuency:VOLTage:RANGe?
Returns the frequency measurement range.
Parameter: [None] | [MIN | MAX]

[SENSe:]PERiod:VOLTage:RANGe
Sets the period measurement range.
Parameter: Range(<NRf> MIN | MAX)
Example: SENS:PER:VOLT:RANG MIN
Sets the period to the minimum range.

[SENSe:]PERiod:VOLTage:RANGe?
Returns the period measurement range.
Return parameter: [None] | [MIN | MAX]

[SENSe:]VOLTage:DC:RANGe:AUTO
Sets the DC voltage Auto range on/off.
Parameter: ON | OFF
Example: SENS:VOLT:DC:RANG:AUTO ON
Turns Auto-range on for DC voltage measurements.

[SENSe:]VOLTage:DC:RANGe:AUTO?
Returns the DC voltage Auto-range settings.
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]VOLTage:AC:RANGe:AUTO
Sets the AC voltage Auto range on/off.
Parameter: ON|OFF
Example: SENS:VOLT:AC:RANG:AUTO ON
Turns Auto-range on for AC voltage measurements.

[SENSe:]VOLTage:AC:RANGe:AUTO?
Returns the AC voltage Auto-range settings.
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]CURRent:DC:RANGe:AUTO
Sets the DC Current Auto-range settings on/off.
Parameter: ON|OFF
Example: SENS:CURR:DC:RANG:AUTO OFF
Turns Auto-range off for DC current measurements.

[SENSe:]CURRent:DC:RANGe:AUTO?
Returns the DC current Auto-range settings.
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]CURRent:AC:RANGe:AUTO
Sets the AC Current Auto-range settings on/off.
Parameter: ON|OFF
Example: SENS:CURR:AC:RANG:AUTO OFF
Turns Auto-range off for AC current measurements.

[SENSe:]CURRent:AC:RANGe:AUTO?
Returns the AC current Auto-range settings.
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]RESistance:RANGe:AUTO
Sets the 2W resistance Auto-range settings on/off.
Parameter: ON|OFF
Example: SENS:RES:RANG:AUTO ON
Turns Auto-range on for 2W resistance measurements.

[SENSe:]RESistance:RANGe:AUTO?
Returns the 2W resistance Auto-range setting.
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]FRESistance:RANGe:AUTO
Sets the 4W resistance Auto-range settings on/off.
Parameter: ON|OFF
Example: SENS:FRES:RANG:AUTO ON
Turns Auto-range on for 4W resistance measurements.

[SENSe:]FRESistance:RANGe:AUTO?
Returns the 4W resistance Auto-range setting.
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]FREQuency:VOLTage:RANGe:AUTO
Sets the Frequency Auto-range settings on/off.
Parameter: ON|OFF
Example: SENS:FREQ:VOLT:RANG:AUTO ON
Turns the Auto-range on for the frequency function.

[SENSe:]FREQuency:VOLTage:RANGe:AUTO?
Returns the frequency Auto-range setting.
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]PERiod:VOLTage:RANGe:AUTO
Sets the Period Auto-range settings on/off.
Parameter: ON|OFF
Example: SENS:PER:VOLT:RANG:AUTO OFF
Turns the Auto-range setting off for period measurements.

[SENSe:]PERiod:VOLTage:RANGe:AUTO?
Returns the Period Auto-range setting.
Return parameter: 0|1, 0=OFF, 1=ON

[SENSe:]VOLTage:DC:RESolution
Sets the DC Voltage measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:VOLT:DC:RES MAX
Sets the DC Voltage resolution to MAX.

[SENSe:]VOLTage:DC:RESolution?
Returns the DC Voltage resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]VOLTage:AC:RESolution
Sets the AC Voltage measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:VOLT:AC:RES MAX
Sets the AC Voltage resolution to MAX.

[SENSe:]VOLTage:AC:RESolution?
Returns the AC Voltage resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]CURRent:DC:RESolution
Sets the DC Current measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:CURR:DC:RES 0.01
Sets the DC Current resolution to 0.01

[SENSe:]CURRent:DC:RESolution?
Returns the DC Current resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]CURRent:AC:RESolution
Sets the AC Current measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:CURR:AC:RES 0.0001
Sets the AC Current resolution to 0.0001

[SENSe:]CURRent:AC:RESolution?
Returns the AC Current resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]RESistance:RESolution
Sets the 2W Resistance measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:RES:RES 0.01
Sets the 2W Resistance resolution to 0.01

[SENSe:]RESistance:RESolution?
Returns the 2W Resistance resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]FRESistance:RESolution
Sets the 4W Resistance measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:FRES:RES 0.01
Sets the 4W Resistance resolution to 0.01

[SENSe:]FRESistance:RESolution?
Returns the 4W Resistance resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]CONTinuity:RESolution

Sets the Continuity measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:CONT:RES 0.001
Sets the Continuity resolution to 0.001

[SENSe:]CONTinuity:RESolution?

Returns the Continuity measurement resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]DIODe:RESolution

Sets the Diode measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example:SENS:DIOD:RES 0.1e-4
Sets the Diode resolution to 0.00001

[SENSe:]DIODe:RESolution?

Returns the Diode measurement resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]TEMPerature:TCOuple:RESolution

Sets the thermocouple (T-CUP) measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:TEMP:TCO:RES MAX
Sets the thermocouple resolution to the maximum.

[SENSe:]TEMPerature:TCOuple:RESolution?

Returns the thermocouple measurement resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]TEMPerature:FRTD:RESolution

Sets the 4W RTD measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:TEMP:FRTD:RES MAX
Sets the 4W RTD resolution to the maximum.

[SENSe:]TEMPerature:FRTD:RESolution?

Returns the 4W RTD measurement resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]TEMPerature:RTD:RESolution

Sets the 2W RTD measurement resolution. The resolution depends on the rate and range settings.
Parameter: Resolution(<NRf> | MIN | MAX)
Example: SENS:TEMP:RTD:RES MAX
Sets the 2W RTD resolution to the maximum.

[SENSe:]TEMPerature:RTD:RESolution?

Returns the 2W RTD measurement resolution.
Parameter: [None] | [MIN | MAX]

[SENSe:]VOLTage:DC:NPLCycles

Sets the integration time for DC Voltage measurements in PLCs (power line cycles). Where one PLC is equal to 16.6 milliseconds. For any <NRf> parameter, the DMM will automatically set the PLC to the closest acceptable PLC value (0.025, 0.1, 0.25, 1, 2, 12).
Parameter: NPLCycles(<NRf> | MIN | MAX)
Example: SENS:VOLT:DC:NPLC 12
Sets the integration time to 12 PLCs for DC Voltage.

[SENSe:]VOLTage:DC:NPLCycles?

Returns the integration time for DC Voltage measurement in PLCs (power line cycles). Where one PLC is equal to 16.6 milliseconds.
Return parameter: 0.025, 0.1, 0.25, 1, 2, 12

[SENSe:]CURRent:DC:NPLCycles

Sets the integration time for DC Current measurements in PLCs (power line cycles). Where one PLC is equal to 16.6 milliseconds. For any <NRf> parameter, the DMM will automatically set the PLC to the closest acceptable PLC value (0.025, 0.1, 0.25, 1, 2, 12).
Parameter: NPLCycles(<NRf> | MIN | MAX)
Example: SENS:CURR:DC:NPLC 2
Sets the integration time to 2 PLCs for DC Current.

[SENSe:]CURRent:DC:NPLCycles?

Returns the integration time for DC Current measurement in PLCs (power line cycles). Where one PLC is equal to 16.6 milliseconds.
Return parameter: 0.025, 0.1, 0.25, 1, 2, 12

[SENSe:]RESistance:NPLCycles

Sets the integration time for 2W resistance measurements in PLCs (power line cycles). Where one PLC is equal to 16.6 milliseconds. For any <NRf> parameter, the DMM will automatically set the PLC to the closest acceptable PLC value (0.025, 0.1, 0.25, 1, 2, 12).
Parameter: NPLCycles(<NRf> | MIN | MAX)
Example: SENS:RES:NPLC MIN
Sets the integration time to 0.025 PLCs for 2W resistance measurements.

[SENSe:]RESistance:NPLCycles?

Returns the integration time for 2W resistance measurements in PLCs (power line cycles). Where one PLC is equal to 16.6 milliseconds.
Return parameter: 0.025, 0.1, 0.25, 1, 2, 12

[SENSe:]FRESistance:NPLCycles

Sets the integration time for 4W resistance measurements in PLCs (power line cycles). Where one PLC is equal to 16.6 milliseconds. For any <NRf> parameter, the DMM will automatically set the PLC to the closest acceptable PLC value (0.025, 0.1, 0.25, 1, 2, 12).
Parameter: NPLCycles(<NRf> | MIN | MAX)
Example: SENS:FRES:NPLC MAX
Sets the integration time to the maximum for 4W resistance measurements.

[SENSe:]FRESistance:NPLCycles?

Returns the integration time for 4W resistance measurements in PLCs (power line cycles). Where one PLC is equal to 16.6 milliseconds.
Return parameter: 0.025, 0.1, 0.25, 1, 2, 12

CALCulate Commands

CALCulate:FUNCtion

Sets the Advanced function.
Parameter: OFF | MIN | MAX | HOLD | REL | COMP | DB | DBM | STORE | AVER | MXB | INV | REF
Example: CALC:FUNC REL
Sets the Advanced function to REL (relative)

CALCulate:FUNCtion?

Returns the current Advanced function.

CALCulate:STATe

Turns the Advanced function on/off.
Parameter: ON|OFF
Example: CALC:STAT OFF
Turns the Advanced function off.

CALCulate:STATe?

Returns the status of the Advanced function.
Return Parameter: 0 | 1, 1=ON, 0=OFF

CALCulate:MINimun?

Returns the minimum value from the Max/Min measurement.

CALCulate:MAXimun?

Returns the maximum value from the Max/Min measurement.

CALCulate:HOLD:REFerence
Sets the percentage threshold for the Hold function.
Parameter: <NRf> (0.01, 0.1, 1, 10)
Example: CALC:HOLD:REF 10
Sets the hold percentage to 10%.

CALCulate:HOLD:REFerence?
Returns the percentage threshold from the Hold function.

CALCulate:REL:REFerence
Sets the reference value for the relative function.
Parameter: <NRf> | MIN | MAX
Example: CALC:REL:REF MAX
Sets the reference value to the maximum allowed.

CALCulate:REL:REFerence?
Returns the reference value from the relative function.

CALCulate:LIMit:LOWer
Sets the lower limit of the compare function.
Para meter: <NRf> | MIN | MAX
Example: CALC:LIM:LOW 1.0
Sets the lower limit to 1.0

CALCulate:LIMit:LOWer?
Returns the lower limit of the compare function.

CALCulate:LIMit:UPPer
Sets the upper limit of the compare function.
Para meter: <NRf> | MIN | MAX
Example: CALC:LIM:UPP 1.0
Sets the upper limit to 1.0

CALCulate:LIMit:UPPer?
Returns the upper limit of the compare function.

CALCulate:DB:REFerence
Sets the reference value for the dB function.
Parameter: <NRf> | MIN | MAX
Example: CALC:DB:REF MAX
Sets the reference value for dB measurements to the maximum allowed.

CALCulate:DB:REFerence?
Returns the reference value from the dB function.

CALCulate:DBM:REFerence
Sets the reference value for the dBm function.
Parameter: <NRf> | MIN | MAX
Example: CALC:DBM:REF MAX
Sets the reference value for dBm measurements to the maximum allowed.

CALCulate:DBM:REFerence?
Returns the reference value from the dBm function.

CALCulate:STORe:COUNt
Set the number of measurement counts that are recorded with the Store measurement function.
Parameter: <NR1> (2 ~ 9999) | MIN | MAX
Example: CALC:STOR:COUN 1000
Sets the number of counts to be recorded as 1000.

CALCulate:STORe:COUNt?
Returns the number of counts that are recorded with the Store measurement function.
Parameter: [None] | MIN | MAX

CALCulate:AVERage:COUNt?
Returns the total number of recorded counts.
Parameter: None | <NR1> (0~2) 0=Store, 1=Scan, 2=Stats
Example: CALC:AVER:COUN? 0
>+0010
Returns the total number of counts set for the Store function (10 counts).

CALCulate:AVERage:MINimum?
Returns the minimum recorded value.
Parameter: None | <NR1>(0~2) 0=Store, 1=Scan, 2=Stats

CALCulate:AVERage:MAXimum?
Returns the maximum recorded value.
Parameter: None | <NR1>(0~2) 0=Store, 1=Scan, 2=Stats

CALCulate:AVERage:AVERage?
Returns the average recorded value.
Parameter: None | <NR1> (0~2) 0=Store, 1=Scan, 2=Stats

CALCulate:AVERage:PTPeak?
Returns the recorded peak to peak value (max value – min value).
Parameter: None | <NR1> (0|1|2) 0=Store, 1=Scan, 2=Stats
Return Parameter: <NRf>

CALCulate:AVERage:SDEViation?
Returns the recorded Standard Deviation.
Parameter: None | <NR1> (0~2) 0=Store, 1=Scan, 2=Stats

CALCulate:MATH:MMFactor

Sets the scale factor M for math measurements.
Para meter: <NRf> | MIN | MAX
Example: CALC:MATH:MMF MIN
Sets the scale factor M to the minimum allowed value.

CALCulate:MATH:MMFactor?

Returns the scale factor M used in the math measurement.

CALCulate:MATH:MBFactor

Sets the offset factor B for math measurements.
Para meter: <NRf> | MIN | MAX
Example: CALC:MATH:MBF MIN
Sets the offset factor B to the minimum allowed value.

CALCulate:MATH:MBFactor?

Returns the offset factor B used in the math measurement.

CALCulate:MATH:PERCent

Sets the Percent value setting for the math function.
Para meter: <NRf> | MIN | MAX
Example: CALC:MATH:PERC MAX
Sets the percent value to the maximum.

CALCulate:MATH:PERCent?

Returns the Percent value setting for the Math function.

TRIGger Commands

READ?

Returns 1st and 2nd display value. The Read query will not return the unit or count number of the reading.

VAL1?

Returns the 1st display reading in the unit format specified in the Configuration menu (Return Format, page 130) or from the SYSTem:OUTPut:FORMat command (page 168).
Example: SAMP:COUN 100
VAL1?
>+0.333E-4,V DC
>+0.389E-4,V DC
> etc, for 100 counts.
Queries 100 counts of stored samples from the 1st display.

VAL2?

Returns the 2nd display reading in the unit format specified in the Configuration menu (Return Format, page 130) or from the SYSTem:OUTPut:FORMat command (page 168).
Example: SAMP:COUN 100
VAL2?
>+0.345E-4,V DC
>+0.391E-4,V DC
> etc, for 100 counts.
Queries 100 counts of stored samples from the 2nd display.

TRIGger:SOURce

Selects the trigger source.
Parameter: INT | EXT
Example: TRIG:SOUR INT
Sets the trigger source as internal.

TRIGger:SOURce?

Returns current trigger source.

TRIGger:DELay

Sets the trigger delay in milliseconds
Parameter: <NRf>(0 ~ 9999) | MIN | MAX
Example: TRIG:DEL MAX
Sets the trigger delay to the maximum.

TRIGger:DELay?

Returns the trigger delay time in milliseconds.
Parameter: None | MIN | MAX

TRIGger:AUTO

Turns Trigger Auto mode on/off.
Parameters: ON | OFF
Example: TRIG:AUTO OFF
Turns the Trigger Auto mode off.

TRIGger:AUTO?

Returns the Trigger Auto mode.
Return parameter: 0|1, 0=OFF, 1=ON

SAMPle:COUNt

Sets the number of samples.
Parameter: <NR1>(1 ~ 9999) | MIN | MAX
Example: SAMP:COUN 10
Sets the number of samples to 10.

SAMPle:COUNt?

Returns the number of samples.
Parameter: None | MIN | MAX

TRIGger:COUNt

Sets the number of trigger counts.
Parameter: <NR1>(1 ~ 9999) | MIN | MAX
Example: TRIG:COUN 10
Sets the number of trigger counts to 10.

TRIGger:COUNt?

Returns the number of trigger counts.
Parameter: None | MIN | MAX

TRACe:DATA?

Returns the buffer contents of the last logged/recorded measurements.

TRACe:CLEar

Clears the buffer contents.

SYSTem Related Commands

SYSTem:BEEPer:STATe

Selects the beeper mode; no beep, beep on fail and beep on pass.
Parameter: <NR1>(0 | 1 | 2) 0=no beep, 2=fail, 1=pass
Example: SYST:BEEP:STAT 0
Turns the beeper off.

SYSTem:BEEPer:STATe?

Returns the beeper mode.
Return parameter: Beep on Pass | Beep on Fail | No Beep

SYSTem:BEEPer:ERRor

Sets the beeper to sound on an SCPI error.
Parameter: ON | OFF
Example: SYST:BEEP:ERR ON
Allows the beeper to sound when an SCPI error occurs.

SYSTem:BEEPer:ERRor?

Returns the beeper error mode.
Return parameter: 0|1, 0=OFF, 1=ON

SYSTem:ERRor?

Returns the current system error, if any.

SYSTem:VERSion?

Returns system version.
Return Parameter: X.XX.

SYSTem:DISPlay

Turns the Display on/off.
Parameter: ON | OFF
Example: SYST:DISP ON
Turns the display on.

SYSTem:DISPlay?

Returns the status of the display
Return parameter: 0|1, 0=OFF, 1=ON

SYSTem:OUTPut:FORMat

Sets the output format for the VAL1?, VAL2?, TRACe:DATA? and FETC? queries. The measured value (V) can be set to be displayed with the measurement units (U) and/or with the count number (C).
Parameter: <NR1>(0 ~ 3) 0=V, 1=V+U, 2=V+C, 3=V+U+C
Example: SYST:OUTP:FORM 3

SYSTem:OUTPut:FORMat?

Returns the output format.
Return parameter: (0|1|2) 0=V, 1=V+U, 2=V+C, 3=V+U+C

SYSTem:OUTPut:EOF

Sets the EOL character (CR+LF, LF, CR).
Parameter: <NR1>(0 | 1 | 2) (0=CR+LF, 1=LF, 2=CR)
Example: SYST:OUTP:EOF 0
Sets the EOL character as CR+LF.

SYSTem:OUTPut:EOF?

Returns the EOL character.
Return parameter: <NR1>(0 | 1 | 2) (0=CR+LF, 1=LF, 2=CR)

SYSTem:OUTPut:SEParate

Sets the command separation character.
Parameter: <Boolean>(0|1) (0=EOL, 1=,)
Example: SYST:OUTP:SER 0
Sets the command separation character as the EOL character.

SYSTem:OUTPut:SEParate?

Returns the command separation character.
Return parameter: <Boolean>(0|1) (0=EOL, 1=,)

SYSTem:SERial?

Returns the serial number (eight characters/numbers)

SYSTem:PARameter:SAVE

Saves the system parameters into 1 of 5 memory slots.
Parameter: <NR1> (1~5)
Example: SYST:PAR:SAVE 1
Saves the system parameters to memory 1.

SYSTem:PARameter:LOAD

Load the system parameters from 1 of 6 memory locations.
Parameter: <NR1> (0~5) (0=Default settings, 1~5= memory number)
Example: SYST:PAR:LOAD 0
Loads the default system parameters.

SYSTem:PARameter:LOAD?

Returns the loaded system parameters.
Return parameter: <NR1> (0~5) (0=Default settings, 1~5= memory number)

STATus Report Commands

STATus:QUEStionable:ENABle
Set bits in the Questionable Data Enable register.

STATus:QUEStionable:ENABle?
Returns the contents of the Questionable Data Enable register.

STATus:QUEStionable:EVENt?
Returns the contents of the Questionable Data Event register.

STATus:PRESet
Clears the Questionable Data Enable register.
Example: STAT:PRES

RS-232C Interface Commands

SYSTem:LOCal
Enables local control (front panel control) and disables remote control.

SYSTem:REMote
Enables remote control and disables local control (front panel control)

IEEE 488.2 Common Commands

*CLS
Clears the Event Status register (Output Queue, Operation Event Status, Questionable Event Status, Standard Event Status)

*ESE?
Returns the ESER (Event Status Enable Register) contents.
Example: *ESE?
>130
Returns 130. ESER=10000010

*ESE
Sets the ESER contents.
Parameter: <NR1> (0~255)
Example: *ESE 65
Sets the ESER to 01000001

*ESR?

Returns and clears SESR (Standard Event Status Register).
Example: *ESR?
>198
Returns 198. SESR=11000110

*IDN?

Returns the manufacturer, model No., serial number and system version number.
Example: *IDN?
>GWInstek,GDM8261,00000000,1.0

*OPC?

"1" is placed in the output queue when all the pending operations are completed.

*OPC

Sets operation complete bit (bit0) in SERS (Standard Event Status Register) when all pending operations are completed.

*PSC?

Returns power On clear status.
Return parameter: <Boolean>(0 | 1) 0=clear, 1=don't clear

*PSC

Clears power On status.
Parameter: <Boolean>(0|1) 0=clear, 1=don't clear

*RST

Recalls default panel setup (reset the device).

*SRE?

Returns the SRER (Service Request Enable Register) contents.

*SRE

Sets SRER contents.
Parameter: <NR1>(0~255)
Example: *SRE 7
Sets the SRER to 00000111.

*STB?

Returns the SBR (Status Byte Register) contents.
Example:*STB?
>81
Returns the contents of the SBR as 01010001.

*TRG

Manually triggers the GDM-8261.

ROUTe Commands

ROUTe:CLOSe

Close a specified scanner channel.
Parameter: <NR1>(101~118)
Example: ROUT:CLOS 102
Closes channel 102.

ROUTe:OPEN:ALL

Opens all scanner channels.

ROUTe:MULTiple:OPEN

Enable all channels in a specified range. Channels that are not in the range are not affected.
Parameter: <NR1>(101~118)
Example: ROUT:MULT:OPEN 105,110
Channels 105 to 110 are enabled.

ROUTe:MULTiple:STATe?

Returns the status of all the scanner channels that are open.
Return parameter: 101 OFF, 102 ON, 103 ON etc.

ROUTe:MULTiple:CLOSe

Disable channels in a specified range.
Parameter: <NR1> (101~118)
Example: ROUT:MULT:CLOS 105,110
Disables channels 105~110.

ROUTe:FUNCtion

Enables scan related functions
Parameter: OFF | SCAN | STEP
Example: ROUT:FUNC SCAN
Enables scan related functions.

ROUTe:FUNCtion?

Returns the Scan related function status.

ROUTe:CHANnel

Advanced configuration mode for the scanner channels. The channel function, voltage and Auto-range mode can be configured.
Parameter: Channel(<NR1>), Function(String), Range(<NRf>), Auto
Function: 1(VOLT), 2(VOLT:AC), 3(CURR [DCI]), 4(CURR:AC [ACI]), 5 (CURR [DCmA]), 6 (CURR:AC [ACmA]), 7(RES), 8(FREQ), 9(TEMP:TCO:C), 13(CONT), 14(PER), 15(TEMP:TCO:F), 16(FRES), 17(DIOD), 18(TEMP:RTD:C), 19(TEMP:FRTD:C), 20(TEMP:RTD:F), 21(TEMP:FRTD:F)
Range: <NRf>
Autorange: 0=Off, 1=On
Range(ON|OFF)
Example: ROUT:CHAN 101,1,1,0
Sets channel 1 (101) to VOLT (1), 1V range (1) and disables Auto-range (0).

ROUTe:CHANnel?

Returns the advanced channel configuration settings of each channel. See the ROUTe:CHANnel command for return parameters.
Return parameter: Channel, Function, Range, Auto Range
Example: ROUT:CHAN? 101
> 101,VOLT,0.1,ON
Returns channel 101, function is VOLT with range at 0.1V and Auto range on.

ROUTe:COUNt

Set the number of counts for the scan.
Parameter: <NR1>(1 ~ 999) | MIN | MAX
Example: ROUT:COUN 50
Sets the scan count to 50 counts.

ROUTe:COUNt?

Returns the number of counts for the scan.
Parameter: None | MIN | MAX

ROUTe:DELay

Set the Delay timer for the scan in milliseconds.
Parameter: <NR3> (0 ~ 9999) | MIN | MAX
Example: ROUT:DEL 100
Sets the delay time to 100 milliseconds.

ROUTe:DELay?

Returns the Delay timer settings.
Parameter: None | MIN | MAX

ROUTe:STATe?

Queries whether the scanner box is installed or not.
Return parameter: Boolean(0|1) 0=not installed, 1=installed

ROUTe:ADVance

Turns the scanner Advanced mode on/off.
Parameter: ON|OFF
Example: ROUT:ADV OFF
Turns advanced scanner mode off.

ROUTe:ADVance?

Returns the advanced mode status (on/off).
Return parameter: ON|OFF

ROUTe:SCAN:COUNt?

Returns the current scan count number.
Return parameter: <NR1>(1~999)

ROUTe:SCAN:FINal

Configures the DMM to send a "Scan OK" message at the completion of the scan.
Parameter: ON | OFF
Example: ROUT:SCAN:FIN ON
"Scan Ok" will be sent at the completion of the scan.

ROUTe:SCAN:FINal?

Returns the status of the OUTe:SCAN:FINal command.

ROUTe:SCAN:BOX

Sets type of scanner box (voltage/current).
Parameter: Volt | Curr
Example: ROUT:SCAN:BOX VOLT
Sets the scanner box type to voltage.

ROUTe:SCAN:BOX?

Returns the configured scanner box type.
Return parameter: VOLT | CURR

INPut:IMPedance:AUTO

Sets the Automatic input impedance for DCV mode.
Parameter: ON|OFF
Example: INP:IMP:AUTO ON
Turns the Automatic input impedance on.

INPut:IMPedance:AUTO?

Returns the Automatic input impedance mode.
Return parameter: ON|OFF

INITiate

Set the trigger system to wait-for-trigger mode and to store readings.

FETCh?

Transfer the stored readings to the output buffer.

DATA:POINts?

Returns the number of readings.

Parameter: None | <NR1> (0~2) 0=Store, 1=Scan, 2=Stats

FAQ

- What is the Output key used for?
- I pressed the EXIT key but cannot get out of Scanner mode.
- The GDM-8261 performance does not match the specifications.

What is the Output key used for?

The Output key is used for turning the display output on or off as well as locking the front panel keys on/off.

I pressed the EXIT key but cannot get out of Scanner mode.

Press the Exit key, followed by the ACV (Scan) or DCV (Step) key.

The GDM-8261 performance does not match the specifications.

Make sure the device is powered On for at least 1 hour. This is necessary to stabilize the unit to match the specifications.

If there is still a problem, please contact your local dealer or GWInstek at marketing@goodwill.com.tw.

APPENDIX

System Info	Firmware Version	178
Fuse Replacement	Replace AC Source Fuse	179
	Replace Input Current Fuse	180
Menu Tree	Menu Tree	181
Specifications	General	183
	DC Characteristics [1]	184
	AC Characteristics [1]	186
	Frequency and Period Characteristics	189
	Temperature Characteristics	190
	Dimensions	191
EC Declaration	EC Declaration of Conformity	192

Firmware Version

Background

Firmware version is available from the system menu.

Firmware version	Shows the GDM-8261 firmware version number.

View firmware version

1. Press the Shift key followed by the 2nd (Menu) key. The system menu appears.



2. Press the Down key followed by the Right key. The firmware version menu appears.



3. Press the Down key. The firmware version appears.

4. Press the Exit key to go back to the default display.

Fuse Replacement

Replace AC Source Fuse

Steps

1. Take off the power cord and remove the fuse socket using a minus driver.

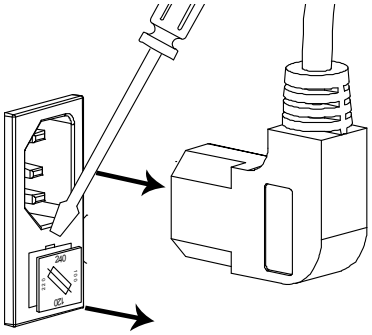

2. Replace the fuse in the holder.

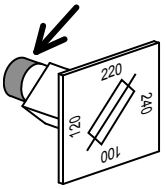

3. Ensure the correct line voltage is lined up with the arrow on the fuse holder. Insert the fuse socket.

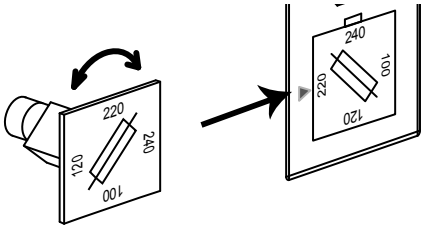

Rating	0.315AT, 100/120VAC; 0.125AT, 220/240VAC

Replace Input Current Fuse

Step

1. Press the Fuse holder.

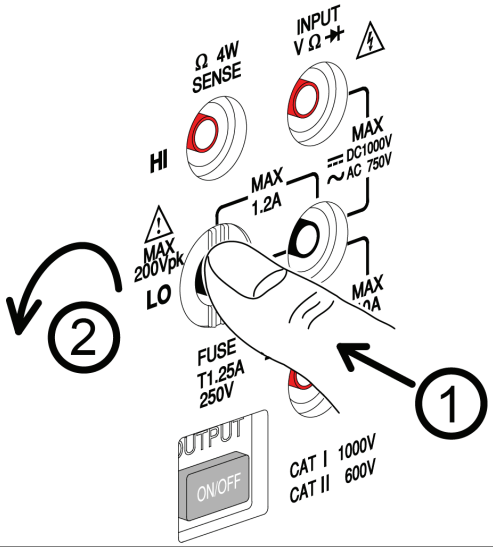

2. The fuse holder comes out. Replace the fuse inserted at the end of the holder.

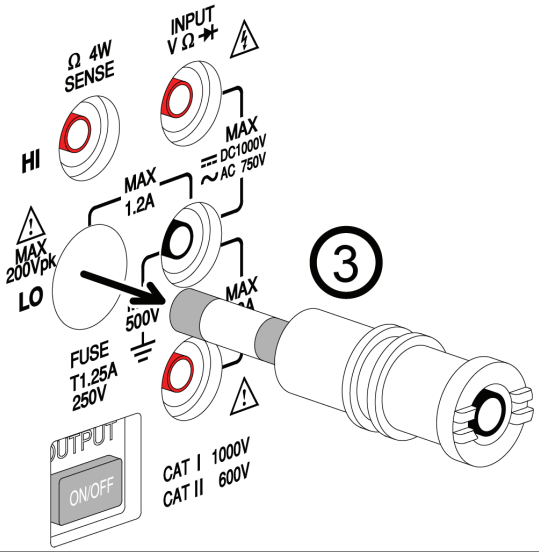

Rating T1.25A, 250V

Menu Tree

Menu Tree

Background

The menu tree diagram shown on the next page represents the configuration menu that is accessed by pressing the Shift key and 2ND (Menu) key. The menu tree is arranged as a three-level tree structure.

Menu Tree Navigation

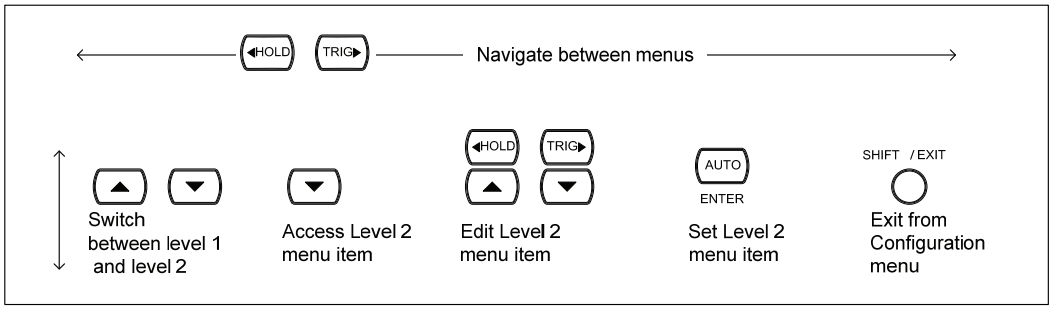

Continued next page.

Configuration Menu Tree

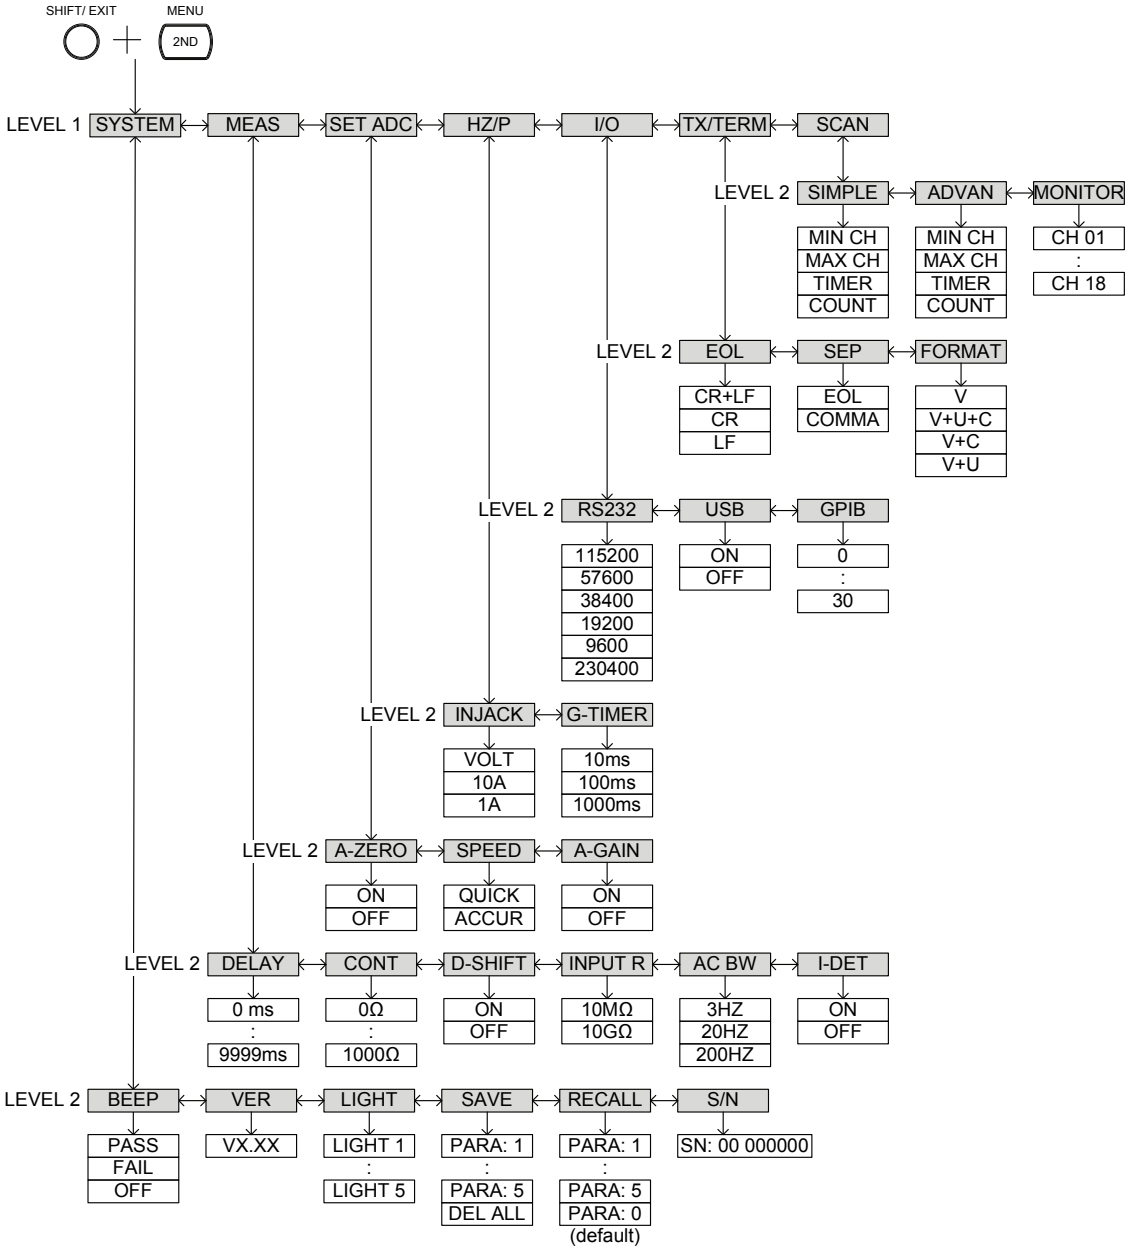

Specifications

General

Note	• All specifications are ensured only under a single display. • At least 1 hour of warm-up time is required before applying these specifications. (Auto-Zero on, Auto-Gain on, Slow mode) • Make sure the power ground is connected.
Power Supply	100 V / 120 V / 220 V / 240 V ±10%
Power Line Frequency	45 Hz to 66 Hz and 360 Hz to 440 Hz
Operating Environment	Full accuracy for 0°C to 55°C, Full accuracy to 80% R.H. at 40°C
Storage Environment	-40°C to 70°C
Power Consumption	Max 25VA
Dimensions	220 mm (W) X 88 mm (H) X 325.1 mm (D)
Weight	Approximately 3.1 kg

DC Characteristics [1]

DC Voltage

Range[3]	24 Hour [2] 23˚C±1˚C	90 Day 23˚C±5˚C	1 Year 23˚C±5˚C	Temperature Coefficient/˚C [6]
100.0000 mV	0.0030 + 0.0030	0.0040 + 0.0035	0.0050 + 0.0035	0.0005 + 0.0005
1.000000 V	0.0015 + 0.0004	0.0020 + 0.0005	0.0035 + 0.0005	0.0005 + 0.0001
10.00000 V	0.0020 + 0.0006	0.0030 + 0.0007	0.0040 + 0.0007	0.0005 + 0.0001
100.0000 V	0.0020 + 0.0006	0.0035 + 0.0006	0.0045 + 0.0006	0.0005 + 0.0001
1000.000 V	0.0020 + 0.0006	0.0035 + 0.0010	0.0045 + 0.0010	0.0005 + 0.0001

Accuracy Specifications: ± (% of reading + % of range)

Resistance [4][7]

Range[3]	Test Current	24 Hour [2] 23˚C±1˚C	90 Day 23˚C±5˚C	1 Year 23˚C±5˚C	Temperature Coefficient/˚C [6]
100.0000 Ω	1 mA	0.0030 + 0.0030	0.008 + 0.004	0.010 + 0.004	0.0008 + 0.0005
1.000000 kΩ	1 mA	0.0020 + 0.0005	0.008 + 0.001	0.010 + 0.001	0.0008 + 0.0001
10.00000 kΩ	100µA	0.0020 + 0.0005	0.008 + 0.001	0.010 + 0.001	0.0008 + 0.0001
100.0000 kΩ	10µA	0.0020 + 0.0005	0.008 + 0.001	0.010 + 0.001	0.0008 + 0.0001
1.000000 MΩ	3.5µA	0.002 + 0.001	0.008 + 0.001	0.010 + 0.001	0.0010 + 0.0002
10.00000 MΩ	350nA	0.015 + 0.001	0.020 + 0.001	0.040 + 0.001	0.0030 + 0.0004
100.0000 MΩ	350 nA//10 MΩ	0.300 + 0.010	0.800 + 0.010	0.800 + 0.010	0.1500 + 0.0002

Accuracy Specifications: ± (% of reading + % of range)

DC Current

Range[3]	Burden Voltage	24 Hour [2] 23˚C±1˚C	90 Day 23˚C±5˚C	1 Year 23˚C±5˚C	Temperature Coefficient/˚C [6]
100.0000 µA	< 0.015 V	0.01 + 0.02	0.04 + 0.025	0.05 + 0.025	0.002 + 0.0030
1.000000 mA	< 0.15 V	0.007 + 0.005	0.030 + 0.005	0.05 + 0.005	0.002 + 0.0005
10.00000 mA	< 0.07 V	0.005 + 0.010	0.030 + 0.020	0.05 + 0.020	0.002 + 0.0020
100.0000m A	< 0.7 V	0.01 + 0.004	0.030 + 0.005	0.05 + 0.005	0.002 + 0.0005
1.000000 A	< 0.8 V	0.05 + 0.006	0.080 + 0.010	0.100 + 0.010	0.005 + 0.0010
10.00000 A	< 0.5 V	0.10 + 0.008	0.120 + 0.008	0.15 + 0.008	0.005 + 0.0008

Accuracy Specifications: ± (% of reading + % of range)

Continuity

Range	Test Current	24 Hour [2] 23˚C±1˚C	90 Day 23˚C±5˚C	1 Year 23˚C±5˚C	Temperature Coefficient/˚C [6]
1000.000Ω	1 mA	0.002 + 0.030	0.008 + 0.030	0.010 + 0.030	0.001 + 0.002

Accuracy Specifications: ± (% of reading + % of range)

Diode Test [5]

Range[3]	Test Current	24 Hour [2] 23˚C±1˚C	90 Day 23˚C±5˚C	1 Year 23˚C±5˚C	Temperature Coefficient/˚C [6]
1.000000 V	1 mA	0.002 + 0.010	0.008 + 0.020	0.010 + 0.020	0.001 + 0.002

Accuracy Specifications: ± (% of reading + % of range)

Measuring Characteristics

DC Voltage	Input Resistance	Range	
		0.1V	10MΩ or >10GΩ Selectable
		1V	10MΩ or >10GΩ Selectable
		10V	11.11MΩ ±1%
		100V	10.1MΩ±1%
		1000V	10.1MΩ±1%
	Input Bias	30pA (Typ, 25°C)	
	Input Protection	1000V on all ranges	

Measurement Method: Sigma-delta A/D Converter

Resistance	Max. Lead Resistance	10% of range per lead for 100Ω, 1 kΩ ranges. 1 kΩ per lead on all other ranges.
	Input Protection	1000 V on all ranges

Measurement Method: Selectable 4-wire or 2-wire ohms. Current source referenced to LO input

DC Current	Shunt Resistor	100Ω for 100uA, 1mA. 5Ω for 10mA and 100 mA. 0.1Ω for 1A. 0.01Ω for 10A.
	Input Protection	Externally accessible 1.25A, 250 V fuse; Internal 12A, 600 V fuse

Reading Rate (Readings/sec)	Continuity/ Diode	Rate	Digits	Rate	
		Slow	6 ½	100	
		Mid	5 ½	200	
		Fast	4 ¼	300	
	DCV, DCI, Resistance	Rate	Digits	Accurate	Quick
		Slow	6 ½	5	30
		Mid	5 ½	60	600
		Fast	4 ¼	240	2400

[1] Accurate Speed setting.

[2] Relative to calibration standards.

[3] 20% overrange on all ranges, except 1000 Vdc, 10A range and Continuity and Hold.

[4] Specifications are for 4-wire ohms function, or 2-wire ohms using REL function. Without REL function, add 0.2 Ω additional error in 2-wire ohms function.

[5] Accuracy specifications are for the voltage measured at the input terminals only. 1 mA test current is typical. Variation in the current source

will create some variation in the voltage drop across a diode junction.
[6] 0˚C~18˚C, 28˚C~55˚C
[7] When making 4W resistance measurements please note the following: Due to the Seebeck effect, please insert the banana plugs of the 4W test cables into the dedicated female terminals on the GDM-8261 and wait for the terminals and banana plugs to reach an equilibrium temperature.

AC Characteristics [1]

True RMS AC Voltage [4]

Range[3]	Frequency	24 Hour [2] 23˚C±1˚C	90 Day 23˚C±5˚C	1 Year 23˚C±5˚C	Temperature Coefficient/˚C [9]
100.0000 mV	3Hz - 5Hz	1.00 + 0.03	1.00 + 0.04	1.00 + 0.04	0.100 + 0.004
	5Hz - 10Hz	0.35 + 0.03	0.35 + 0.04	0.35 + 0.04	0.035 + 0.004
	10Hz - 20kHz	0.04 + 0.03	0.05 + 0.04	0.06 + 0.04	0.005 + 0.004
	20kHz - 50kHz	0.10 + 0.05	0.11 + 0.05	0.12 + 0.05	0.011 + 0.005
	50kHz - 100kHz	0.55 + 0.08	0.60 + 0.08	0.60 + 0.08	0.060 + 0.008
	100kHz - 300kHz [6]	4.00 + 0.50	4.00 + 0.50	4.00 + 0.50	0.20 + 0.02
1.000000 V to 750.000 V	3Hz – 5Hz	1.00 + 0.02	1.00 + 0.03	1.00 + 0.03	0.100 + 0.003
	5Hz – 10Hz	0.35 + 0.02	0.35 + 0.03	0.35 + 0.03	0.035 + 0.003
	10Hz – 20kHz	0.04 + 0.02	0.05 + 0.03	0.06 + 0.03	0.005 + 0.003
	20kHz – 50kHz	0.10 + 0.04	0.11 + 0.05	0.12 + 0.05	0.011 + 0.005
	50kHz – 100kHz [5]	0.55 + 0.08	0.60 + 0.08	0.60 + 0.08	0.060 + 0.008
	100kHz – 300kHz [6]	4.00 + 0.50	4.00 + 0.50	4.00 + 0.50	0.20 + 0.02

Accuracy Specifications: ± (% of reading + % of range)

True RMS AC Current[4]

Range[3]	Frequency	24 Hour [2] 23˚C±1˚C	90 Day 23˚C±5˚C	1 Year 23˚C±5˚C	Temperature Coefficient/˚C [9]
1.000000 mA	3Hz – 5Hz	1.00 + 0.04	1.00 + 0.04	1.0+0.04	0.1+0.006
	5Hz – 10Hz	0.30 + 0.04	0.30 + 0.04	0.3+0.04	0.035+0.006
	10Hz – 5kHz	0.10 + 0.04	0.10 + 0.04	0.1+0.04	0.015+0.006
	5kHz – 10kHz	0.2 + 0.25	0.2 + 0.25	0.2+0.25	0.03+0.006

10.00000 mA	3Hz – 5Hz	1.1 + 0.06	1.1 + 0.06	1.1+0.06	0.2+0.006
	5Hz – 10Hz	0.35 + 0.06	0.35 + 0.06	0.35+0.06	0.1+0.006
	10Hz – 5kHz	0.15 + 0.06	0.15 + 0.06	0.15+0.06	0.015+0.006
	5kHz – 10kHz	0.35 + 0.7	0.35 + 0.7	0.35+0.7	0.03+0.006
100.0000 mA	3Hz – 5Hz	1.0 + 0.04	1.0 + 0.04	1.0+0.04	0.1+0.006
	5Hz – 10Hz	0.3 + 0.04	0.3 + 0.04	0.3+0.04	0.035+0.006
	10Hz – 5kHz	0.1 + 0.04	0.1 + 0.04	0.1+0.04	0.015+0.006
	5kHz – 10kHz	0.2 + 0.25	0.2 + 0.25	0.2+0.25	0.03 + 0.006
1.000000 A	3Hz – 5Hz	1.0 + 0.04	1.0 + 0.04	1.0+0.04	0.1+0.006
	5Hz – 10Hz	0.3 + 0.04	0.3 + 0.04	0.3+0.04	0.035+0.006
	10Hz – 5kHz	0.1 + 0.04	0.1 + 0.04	0.1+0.04	0.015+0.006
	5kHz – 10kHz	0.35 + 0.7	0.35 + 0.7	0.35+0.7	0.03 + 0.006
10.00000 A	3Hz – 5Hz	1.1 + 0.06	1.1 + 0.06	1.10 + 0.06	0.1+0.006
	5Hz – 10Hz	0.35 + 0.06	0.35 + 0.06	0.35 + 0.06	0.035 + 0.006
	10Hz – 5kHz	0.15 + 0.06	0.15 + 0.06	0.15 + 0.06	0.015 + 0.006
	5kHz – 10kHz	0.35 + 0.7	0.35 + 0.7	0.35+0.7	0.03 + 0.006

Accuracy Specifications: ± (% of reading + % of range)

Additional Crest Factor Errors (non-sine wave)[7]

Crest Factor	Error (% of reading)
1-2	0.05%
2-3	0.15%
3-4	0.30%
4-5	0.40%

Additional Low Frequency Errors (% of reading)

Frequency	Slow	AC Filter Medium	Fast
10Hz~20Hz	0	0.74	-
20Hz~40Hz	0	0.22	-
40Hz~100Hz	0	0.06	0.73
100Hz~200Hz	0	0.01	0.22
200Hz~1kHz	0	0	0.18
>1kHz	0	0	0

Measuring Characteristics

True RMS AC Voltage	Measurement Method:	AC-coupled True RMS – measures the ac component of input with up to 400 Vdc of bias on any range.	
	Crest Factor	Maximum 5:1 at full scale	
AC Filter Bandwidth	Slow	3 Hz – 300 kHz	
	Medium	20 Hz – 300 kHz	
	Fast	200 Hz – 300 kHz	
	Input Impedance:	1 MΩ ± 2%, in parallel with 100 pF	
	Input Protection:	750 Vrms on all ranges	
True RMS AC Current	Range	Shunt	Burden Voltage
	1mA	100Ω	<0.15V
	10mA	5Ω	<0.07V
	100mA	5Ω	<0.7V
	1A	0.1Ω	<0.8V
	10A	10mΩ	<0.5V
	Input Protection:	Externally accessible 1.25A, 250 V fuse Internal 12A, 250 V fuse	

Operating Characteristics [8]

Function	Rate	Digits	Readings/s	AC Bandwidth
ACV,ACI	Slow	6 ½	1.2 (sec/reading)	3 Hz – 300 kHz
	Medium	5 ½	3.38	20 Hz – 300 kHz
	Fast	4 ½	30	200 Hz – 300 kHz

[1] Specifications are for 1-hour warm-up at 6 1/2 digits, Slow ac filter, sinewave input.

[2] Relative to calibration standards.

[3] 20% overrange on all ranges, except 750 Vac, 10A range.

[4] Specifications are for sinewave input >5% of range. For inputs from 1% to 5% of range and <50 kHz, add 0.1% of range additional error. For 50 kHz to 100 kHz, add 0.13% of range.

[5] 750 Vac range limited to 100 kHz

[6] Typically 30% of reading error at 1 MHz.

[7] For frequencies below 100 Hz, slow AC filter specified for sinewave input only.

[8] Additional settling delay required when input dc level varies.

[9] 0˚C~18˚C, 28˚C~55˚C

Frequency and Period Characteristics

Frequency Period [3]

Range [2]	Frequency	24 Hour [1] 23˚C±1˚C	90 Day 23˚C±5˚C	1 Year 23˚C±5˚C	Temperature Coefficient/˚C [5]
100 mV to 750 V [4]	3Hz - 5Hz	0.1	0.1	0.1	0.005
	5Hz - 10Hz	0.05	0.05	0.05	0.005
	10Hz - 40Hz	0.03	0.03	0.03	0.001
	40Hz - 300kHz	0.006	0.01	0.01	0.001

Accuracy Specifications: ± % of reading

Measuring Characteristics

Frequency and Period	Measurement Method:	Reciprocal-counting technique. AC-coupled input using the ac voltage measurement function.
	Voltage Ranges	100 mV rms full scale to 750 V rms. Auto or manual ranging.
Settling Considerations	Errors will occur when attempting to measure the frequency or period of an input following a dc offset voltage change. The input blocking RC time constant must be allowed to fully settle (up to 1 sec) before the most accurate measurements are possible.	
Measurement Considerations	All frequency counters are susceptible to error when measuring low-voltage, low-frequency signals. Shielding inputs from external noise pickup is critical for minimizing measurement errors.	

Operating Characteristics

Function	Digits	Readings/s
Frequency, Period	6 ½	1
	5 ½	10
	4 ½	100

[1] Relative to calibration standards.

[2] 20% overrange on all ranges, except 750 Vac.

[3] Input > 100 mV. For 10 mV to 100 mV inputs, multiply % of reading error x10.

[4] 750 Vac range limited to 100 kHz

[5] 0˚~18˚C & 28˚~55˚C

Temperature Characteristics

(Display in °C, °F, Exclusive of probe errors.)

RTD (Accuracy based on PT100):

(100Ω platinum [PT100], D100, F100,PT385, PT3916, or user type) [1]

Range	Resolution	1 Year (23°C ±5°C)*	Temperature Coefficient 0°-18°C & 28°-55°C
-200°C~ -100°C	0.001°C	0.09°C	0.004 °C / °C
-100°C~-20°C	0.001°C	0.08°C	0.005 °C / °C
-20°C~20°C	0.001°C	0.06°C	0.005 °C / °C
20°C~100 °C	0.001°C	0.08°C	0.005 °C / °C
100°C~300 °C	0.001°C	0.12°C	0.007 °C / °C
300°C~600 °C	0.001°C	0.22°C	0.009 °C / °C

Thermocouples (Accuracy based on ITS-90)[1]:

Type	Range	Resolution	90 Day/1 Year (23°C±5°C)*	Temperature Coefficient 0°-18°C & 28°-55°C
E	-200 to +1000°C	0.002 °C	0.2 °C	0.03 °C / °C
J	-210 to +1200˚C	0.002 °C	0.2 °C	0.03 °C / °C
T	-200 to +400°C	0.002 °C	0.3 °C	0.04 °C / °C
K	-200 to +1372˚C	0.002 °C	0.3 °C	0.04 °C / °C
N	-200 to +1300˚C	0.003 °C	0.4 °C	0.05 °C / °C
R	-50 to +1768˚C	0.01 °C	1 °C	0.14 °C / °C
S	-50 to +1768˚C	0.01 °C	1 °C	0.14 °C / °C
B	+350 to +1820˚C	0.01 °C	1 °C	0.14 °C / °C

[1] Specifications do not include probe accuracy

*Relative to simulated junction

Dimensions

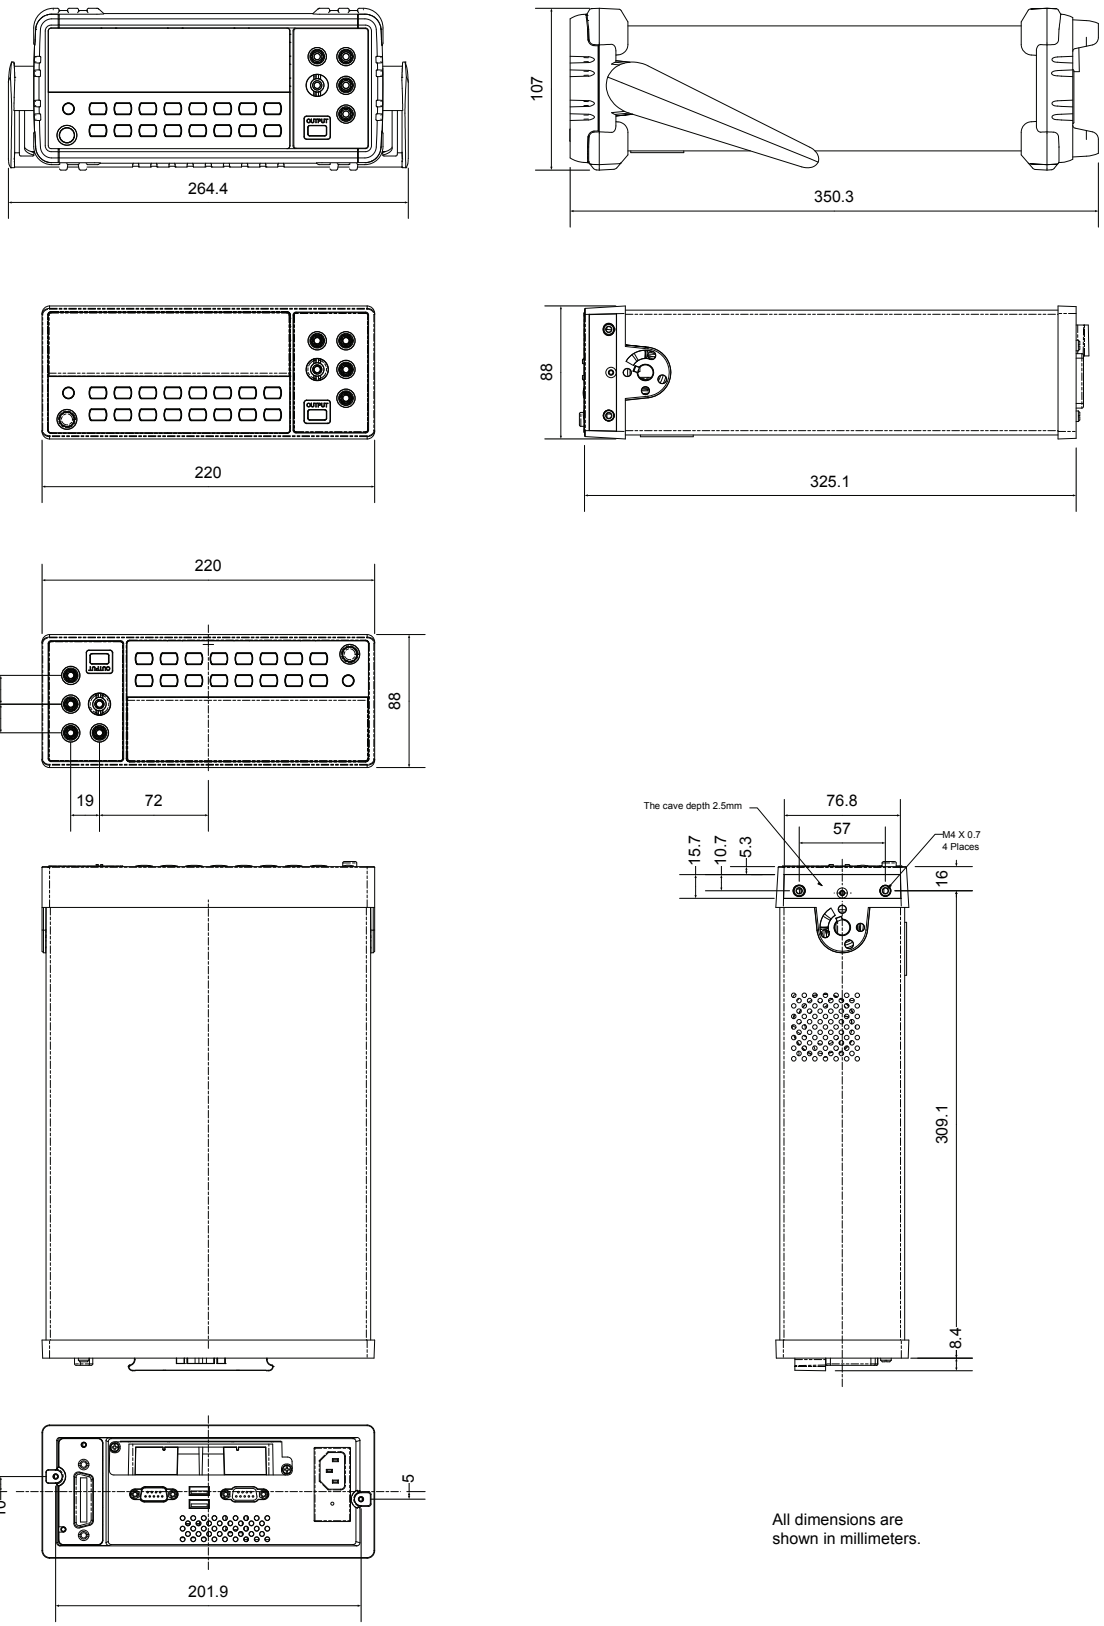

All dimensions are shown in millimeters.

EC Declaration of Conformity

We
GOOD WILL INSTRUMENT CO., LTD.
(1) No.7-1, Jhongsing Rd., Tucheng Dist., New Taipei City, Taiwan (R.O.C.)
(2) No. 69, Lu San Road, Suzhou City (Xin Qu), Jiangsu Sheng, China
declare, that the below mentioned product

Type of Product: **Digital Multimeter**
Model Number: **GDM-8261**

are herewith confirmed to comply with the requirements set out in the Council Directive on the Approximation of the Law of Member States relating to Electromagnetic Compatibility (2004/108/EC) and Low Voltage Directive (2006/95/EC).
For the evaluation regarding the Electromagnetic Compatibility and Low Voltage Directive, the following standards were applied:

◎ EMC

EN 61326-1: Electrical equipment for measurement, control and laboratory use — EMC requirements (2006)	
Conducted & Radiated Emission EN 55011: 1998 + A1: 1999 + A2: 2002, Class B	Electrostatic Discharge EN 61000-4-2: 1995 + A1: 1998 + A2: 2001
Current Harmonics EN 61000-3-2: 2000 + A2: 2005	Radiated Immunity EN 61000-4-3: 2002 + A1: 2002
Voltage Fluctuations EN 61000-3-3: 1995 + A1: 2001 + A2: 2005	Electrical Fast Transients EN 61000-4-4: 2004
----------	Surge Immunity EN 61000-4-5: 1995 + A1: 2001
----------	Conducted Susceptibility EN 61000-4-6: 1996 + A1: 2001
----------	Power Frequency Magnetic Field EN 61000-4-8: 1993 + A1: 2001
----------	Voltage Dip/ Interruption EN 61000-4-11: 2004

◎ Safety

Low Voltage Equipment Directive 2006/95/EC
Safety Requirements IEC/EN 61010-1: 2001

INDEX

A

AC bandwidth
setting 80
ADC speed
setting 86
Auto-gain
setting 85
Auto-zero
setting 83

B

Beeper
setting 37

C

Command IEE488.2 commands 170
Command set
CALCulate commands 162
CONFigure commands 141
CONFigure2 commands 143
Measure commands 146
Remote commands 170
ROUTe commands 172
SENSe commands 149
STATus report commands 170
SYSTem related commands 168
TRIGger commands 165
Command syntax
configuration
EOL 128
return format 130
separation character 129
overview 132
Compare value
setting 61
Continuity
scanner configuration 98
setting 35
Crest factor 29
Current
scanner configuration 98
setting 30
Current auto-detect
input port setting 82

D

dB
setting 55
Digital filter
setting 75
Digital I/O
Compare application 116
configuration 115
External trigger application 119
Diode test
scanner configuration 98
setting 34
Display on/off 78
Disposal instructions 8
D-Shift
setting 78
Dual measurement
applications 46
operation 48
overview 46

E

EN 55011 declaration of conformity 192
EN 61010
declaration of conformity 192
measurement category 7
pollution degree 8
Environment
operation 8
storage 8

F

FAQ 176
Firmware version 178

Frequency
scanner configuration....98
setting....38
Frequency/period
gate time setting....88
input port setting....87
Front panel
overview....12
Fuse
AC fuse replacement....179
current fuse replacement....180
safety instruction....8

G

Getting Started chapter....10
GPIB configuration....124
GPIB installation....123

I

Indicator
reading....25
Input resistance
setting....79

K

Key lock....78

L

Line voltage safety instruction....7

M

Main features....11
Math
1/X....66
MX+B....64
Percentage....66
setting....64
Standard deviation....67
Statisics....67
Measurement keys
overview....13
Menu tree....181
Monitor channel....112

O

Output key faq....176

P

Period
scanner configuration....98
setting....38

R

Rear panel
overview....17
Recall instrument settings....94
Recall measurements....92
Refresh rate....24, 53
Refresh rate
setting....71
Relative value
setting....58
Resistance
scanner configuration....98
setting....32
RS-232C configuration....127

S

Safety instruction
fuse....8
Line voltage....7
symbol....6
Save instrument settings....93
Save parameters....93
Scanner
advanced settings....107
command set....172
get out of scanner mode....176
installation....97
Overview....104
run scan....111
simple settings....105
step operation....111
triggering....110
Scanner configuration record/log....103
Serial number
setting....71
Service contact....176
Specification conditions....176
Specifications
AC
characteristics....186
measuring chacteristics....188

Operating characteristics 188
DC
characteristics 184
measuring characteristics 185
Dimensions 191
Frequency and Period
characteristics 189
measuring characteristics 189
Operating characteristics 189
General 183
Temperature characteristics 190
Store measurements 91

T

Table of contents 3
Temperature
RTD setting 44
scanner configuration 98
setting 40, 43
Thermocouple
junction setting 42
setting 41
Tilt stand 19
Trigger
delay 74
external 72

U

United Kingdom power cord 9
USB configuration 122

V

Voltage
scanner configuration 98
setting 26

W

Waveform type voltage comparison 28